

PHASE 1 ASSESSMENT
ST TYDFIL'S HOSPITAL
MERTHYR TYDFIL
ST TYDFIL'S DEVELOPMENTS LLP
DS-21988-19-321 REVA
AUGUST 2020

IDOM



PHASE 1 ASSESSMENT
ST TYDFIL'S HOSPITAL
MERTHYR TYDFIL
ST TYDFIL'S DEVELOPMENTS LLP
DS-21988-19-321 REVA
AUGUST 2020

Current Document Details


Authors

Simon Edwards
Chloe Kirkpatrick

Approved by


.....
Simon Edwards

Issued by


.....
Tim Crowe

M:\Jobs 21000-22000\21988 Merthyr Tydfil Hospital\4.0 Project Documents\4.13
Reports\4.13.1 Desk Study\DS-21988-19-321 RevA.docx

Document Revisions

Rev	Date	Author	Approved	Issued	Remarks
-	30/07/2019	SE / CK	SE	TC	First Issue
A	19/08/2020	SE/CK	SE	TC	Revised Client Name

Report issued from

DERBYSHIRE Cromford Mills, Mill Lane, Matlock, Derbyshire. DE4 3RQ Tel: 01773 829988

TABLE OF CONTENTS

EXECUTIVE SUMMARY	I
SECTION 1 INTRODUCTION	1
SECTION 2 PHASE 1 (NON-INTRUSIVE INVESTIGATION)	2
2.1 INTRODUCTION	2
2.2 SITE LOCATION AND SETTING	2
2.3 SITE HISTORY	4
2.4 GEOLOGY	5
2.5 HYDROGEOLOGY	5
2.6 HYDROLOGY	6
2.7 COAL MINING	6
2.8 CURRENT SITE ISSUES	6
2.9 INDICATIVE GROUND STABILITY HAZARDS	8
2.10 RADON GAS	8
2.11 AIR QUALITY	8
2.12 ECOLOGY	8
2.13 PLANNING RECORDS	8
2.14 PREVIOUS INVESTIGATIONS	9
2.15 ABATEMENT NOTICE	9
2.16 STOCKPILE TESTING BY OTHERS	10
2.17 SAMPLE TESTING BY IDOM	10
2.18 COMMENTARY ON EXISTING CONDITIONS	10
2.19 PRELIMINARY CONCEPTUAL SITE MODEL AND RISK ASSESSMENT	11
SECTION 3 CONCLUSIONS AND RECOMMENDATIONS	13
APPENDIX 1	
▪ Drawings	
APPENDIX 2	
▪ Site walkover photographs	
APPENDIX 3	
▪ Groundsure Report	
APPENDIX 4	
▪ Coal Mining Consultants Report	
APPENDIX 5	
▪ Asbestos Register and Summary	
APPENDIX 6	
▪ Asbestos testing results 2018	
APPENDIX 7	
▪ Asbestos testing results from IDOM walkover	

EXECUTIVE SUMMARY

A Geo-Environmental Assessment was requested by St Tydfil's Developments LLP. The purpose of the assessment was to identify any contaminative issues associated with former land use at St Tydfil's Hospital, Merthyr Tydfil, Merthyr Tydfil which might impact on the redevelopment of the site

SITE DETAILS

Approximate site area	2.12 ha
Current use / historic use	Unused demolished site/ Workhouse and hospital
Proposed use	Residential housing with gardens

PHASE 1 NON-INTRUSIVE INVESTIGATION

Expected geology	Probable made ground associated with reprofiling of site for development over: Glacial till; over Lower Coal Measures
Groundwater	Secondary aquifer in Lower Coal Measures although not expected to be extracted locally.
Surface water	None identified on site. Expected to drain via established urban sewerage system.
Other	Not in radon risk area but possibility of naturally occurring gases from coal measures.

RECOMMENDATIONS

Remediation	It is recommended that a site investigation is carried out to assess the nature of material within demolition materials and below slabs. Investigation should include assessment of hydrocarbon contamination adjacent to tanks and gas regime. Investigation should be carried out in combination with remediation contractor attendance.
Waste classification	Assumed non-haz classification for majority of demolition material. Identified asbestos containing materials (ACM) will have hazardous classification.
Re-use of site-won materials	It is likely that stockpiled materials may be suitable for bulk filling after testing and processing.

SECTION 1 INTRODUCTION

- 1.1 St Tydfil's Developments LLP proposes to develop an area of land located in Merthyr Tydfil, on the site of the old St Tydfil's Hospital for residential purposes. The proposed development comprises new build houses and flats together with refurbished accommodation with the historic workhouse building. IDOM Merebrook Limited (IDOM) has been commissioned by St Tydfil's Developments LLP to undertake Phase 1 studies including walkover and surface sampling and to provide initial advice on the actions necessary to allow redevelopment of the site for the proposed end use.
- 1.2 The objectives of the investigation are to:
- i.* Review published and available documentation concerning the site;
 - ii.* Undertake preliminary walkover inspection;
 - iii.* Collect surface samples of potentially contaminated material;
 - iv.* Prepare an initial conceptual model; and
 - v.* Make recommendations for further actions.
- 1.3 This report presents the findings of the Phase 1 study and recommendations.
- 1.4 This report has been prepared for St Tydfil's Developments LLP for the sole purpose described above and no extended duty of care to any third party is implied or offered. Third parties making reference to the report should consult St Tydfil's Developments LLP and IDOM as to the extent to which the findings may be appropriate for their use.

SECTION 2 PHASE 1 (NON-INTRUSIVE INVESTIGATION)**2.1 INTRODUCTION**

- 2.1.1 The study has been conducted with reference to the documents and sources detailed in Table 1 below:

Table 1: Published Data and Information Sources

SOURCE DATA	GROUNDSURE DATA
BGS 1:50,000 Series Geological Sheet 231 and online data	Ordnance Survey (OS) historical maps scaled at 1:10,560, 1:10,000, 1:2,500 and 1:1,250 dated 1875 - 2014
Google Earth satellite imagery	BGS Geology of Britain 1:50,000 online maps
Radon: guidance on protection measures for new dwellings	Water abstraction, discharge and pollution data
Environment Agency (EA) online data maps	Registered waste management sites
UK National Air Quality Archive, online	Mining records and natural ground stability data
Protected areas of environmentally sensitive land use or conservation	
Other relevant designations and/or authorisations and Trade Directory entries	
Planning records from Methyr Tydfil Borough Council	

- 2.1.2 The above sources are all authoritative and it is believed they are reasonably reliable. However, independent verification of the information supplied has not necessarily been carried out and IDOM cannot be held liable for inaccuracies or deficiencies in the information.

2.2 SITE LOCATION AND SETTING

- 2.2.1 The site is located around 150 m east of the Merthyr Tydfil High Street and immediately west of the Thomastown Park Recreation Ground.
- 2.2.2 The site occupies an area of approximately 2.12 hectares located at National Grid Reference SO 05168 06442 and indicated on drawing 001-001, presented in Appendix 1 of this report.
- 2.2.3 The site is bounded by Thomastown Park Recreation Ground to the west. To the east is open public space and residential buildings. To the north and to the south of the site are residential terraced houses.

- 2.2.4 A site walkover visit was undertaken by IDOM engineers on 9 July 2019, accompanied by representatives of St Tydfil's Developments LLP and Bath Demolition Ltd. Entrance to the site was via gates in the south western part of the site and through remaining historical buildings.
- 2.2.5 The boundaries of the site are walled and fenced to various standards and visiting security is provided however it is considered that the site is not secure. There is frequent evidence of unauthorised use of the site including drug paraphernalia, removed ironworks, cable stripping and burning.
- 2.2.6 Surrounding land use includes housing to the north, north west, south and south west; a recreation ground including tennis courts to the east; and a former cemetery now laid out as a park to the west.
- 2.2.7 The site has been subject to demolition activities and stockpiles of demolition material are present over much of the site area.
- 2.2.8 Some material screening has taken place resulting in several areas of stockpiles processed to a nominal 6F2 grading. The processed material has a majority component of brick and contains significant amounts of wood and other unsuitable materials including metal and plastic. The material would not meet the requirements of 6F2 (or other category material) without further processing
- 2.2.9 The majority of the stockpiles on the site are, however, unprocessed and contain extensive amounts of material unsuitable as a bulk fill or aggregate material including large concrete, wood, metal, plastic, rubber, glass and other materials.
- 2.2.10 Asbestos cement sheet was visually identified in a number of locations around the site in processed and unprocessed material and lying as discrete items on the surface. Further items having the fibrous appearance or resembling other known asbestos containing materials.
- 2.2.11 The site rises in elevation to the east and it is clear that the former hospital site was on various levels with retaining structures and sloping roads. The most marked level difference is the raised westerly area which was most recently used as a parking area and assumed fire water tank.
- 2.2.12 The large majority of ground slabs appear to have been left in-situ and it is apparent that a ducting system was present and remains substantially in place. Lagged pipes are present in some ducts but it is also apparent that some works have been carried out to remove and cut up steel pipes for recycling.
- 2.2.13 A concrete bund was present to the central eastern part of site with evidence of surface heating oil/diesel spillage. The tanks have been removed.
- 2.2.14 The site visit noted two areas of possible Japanese Knotweed infestation although no detailed survey was undertaken and it is understood that St Tydfil's Developments LLP has appointed specialist advisors to provide a survey.

2.2.15 Noise monitoring from fixed long-term noise meters was established on site. At the time of visit, the noise monitoring station was being moved from the south west to the northern area of the site.

2.2.16 Selected photographs from the site walkover are attached in Appendix 2.

2.3 SITE HISTORY

2.3.1 The site history, based on a review of the historic and current map, dating from 1875 to 2014, and Google Earth satellite images dating from 1945 - 2018 are summarised below. Potentially contaminative land uses are shown in **bold**. Copies of key maps used in this review are provided in Appendix 3.

Table 2: Summary of the key features shown on historic maps

DATA SOURCE	SITE / SURROUNDINGS
1875-1919 (1:2,500 and 1:500 scale).	Site – There was an infirmary in the east of the site serving a workhouse in the south of the site. In the south west, a school and a laundry was present. The rest of the site consisted of open fields with some trees. By 1900, a second infirmary was built in the north of the site. In 1904, in the building previously identified as the Laundry, a water main was identified. By 1919 the infirmary in the north of the site was extended.
	Surroundings – In 1875, to the west of the site there was a cemetery . To the south and to the west of the site there was a residential area and to the east of the site sloping ground was present possibly indicating mineral working spoil. By 1919 Taff Vale Brewery was built on the land just to the north of the site and the cemetery was no longer in use.
1945-1990 (1:1,250, 1:2,500 scale and satellite/ aerial imagery).	Site – Aerial imagery shows the original infirmary building to be reduced in size and may be under demolition at the time. By 1948, the original infirmary was fully demolished and a small ruin was left in the east of the site. By 1957, the site was called St Tydfil's Hospital. By 1982 a tank was depicted in the east of the site. The flue to the boiler house is apparent by 1975 but the twin fuel tanks adjacent to this cannot be distinguished clearly until 1989. By 1989 further new building had been added to the central part of the site and by 1990 the northern block was further extended.
	Surroundings – The Taff Vale Brewery, to the north of the site, was converted into the Taff Vale Works of unspecified use.
1995-2018 (1:1,250 scale and satellite / aerial imagery).	Site – By 2001 satellite imagery shows the presence of twin fuel tanks in a bunded area coincident with the feature observed during walkover. By 2016, the majority of the site had been demolished and demolition waste covered most of the site. The tank on the elevated car park to the east remained. The images from 2016 and 2018 show clearly how

DATA SOURCE	SITE / SURROUNDINGS
	the tanks and flue have been removed and stocked presumably awaiting removal. By 2018, all the structures except the historic workhouse building had been removed and some of the demolition waste appears to have been processed and the stockpiles regularised.
	Surroundings – By 1995 the Taff Vale Works were demolished, and the land was redeveloped into a residential area .

2.3.2 In summary, historic plans show that the site was originally in use as a corporation workhouse which incorporated an infirmary. Later, the site's principal use was as a district hospital. Demolition occurred in approximately 2014 and some processing was carried out.

2.3.3 The historic maps do not show any evidence of potentially significant contamination. However, within 50 m of the site there was a cemetery, a brewery and a works located on the maps.

2.3.4 Given the nature of the historical mapping process (scale, representation of conditions at discrete time intervals frequency etc.), any such maps and plans may not provide a comprehensive account of a site's history. Identification of pertinent land uses and associated potentially contaminative activities, may therefore be absent from mapping records.

2.4 GEOLOGY

2.4.1 The British Geological Survey (BGS) online viewer indicates the presence of superficial drift deposits of Devensian till (diamicton).

2.4.2 The underlying bedrock geology comprises of South Wales Lower Coal Measures formation (coal-bearing mudstones/siltstones with seatearths and minor sandstones).

2.4.3 The log for BGS Borehole SO00NW212, 450 m southwest of the site, contains descriptions of 'lower coal measures' to approximately 25m in depth. Other BGS boreholes in the surrounding area describe layers of gravel, hard and soft grey mudstone and siltstone consistent with the South Wales Lower Coal Measures.

2.4.4 On site, there is potentially infilled land due to cemetery along the western border. There are also areas of potentially infilled land immediately to the east of the site.

2.5 HYDROGEOLOGY

2.5.1 The superficial Devensian Till deposits on site are classified by the Environment Agency as a Secondary Aquifer with undifferentiated layers. The bedrock South

Wales Lower Coal Measures is classified as a Secondary (a) Aquifer with permeable layers.

2.5.2 No source protection zones were identified within 500 m of the site.

2.5.3 There are no groundwater abstraction licenses within 1 km of the site.

2.6 HYDROLOGY

2.6.1 The Nant Morlais is located 250 m east west of the site, running northeast to south west, a tributary of the River Taff located 600 m west of the site.

2.6.2 There are no surface water abstraction licences within 1 km of the site.

2.6.3 The site itself is not located in an area identified by Natural Resources Wales as being at risk of flooding from rivers and the sea (RoFRaS), although there is a medium flood risk area 18 m west of the site.

2.6.4 British Geological Survey groundwater flooding susceptibility areas have been identified within 50 m of the site boundary. Further consideration of groundwater flooding should be made as part of a flood risk assessment as the areas are close to the site boundary.

2.6.5 The site is located in an area identified by the British Geological Survey as having a potential at surface for groundwater flooding.

2.6.6 The British Geological Survey (BGS) has identified susceptibility for groundwater flooding within 50 m of the site. This is identified as clearwater flooding: flooding resulting from a rising water table in an unconfined major aquifer setting, usually as a response to extreme rainfall. The BGS indicates there is potential at the surface for groundwater flooding to occur, meaning that the groundwater flooding hazard should be considered on all land-use planning decisions. The confidence rating in this classification is, however, low.

2.7 COAL MINING

2.7.1 A Coal Mining Report issued by the Coal Authority has not identified any surface or subsurface features within or near to the boundary of the site. A copy of the coal mining report is included in Appendix 4.

2.8 CURRENT SITE ISSUES

2.8.1 Potentially significant environmental issues have been investigated within relevant distances of the site, based on the database of records supplied by Groundsure. These relate to the following searches:

i. Water discharge or pollution incidents within 250 m of the site;

ii. Waste management sites within 250 m of the site;

- iii.** Statutory authorisations within 50 m of the site;
- iv.** Trade directory entries of possible contaminative use within 50 m of the site;
- v.** Special protection or conservation areas within 50 m of the site; and
- vi.** Any other relevant issues.

2.8.2 Potentially significant environmental issues identified by the above searches are summarised in Table 3 below.

Table 3: Potentially significant environmental issues

ENVIRONMENTAL CATEGORY	DESCRIPTION
Water discharge or pollution incidents within 250 m	16 m north, 27 November 2001, organic chemicals/products – no water land or air impact 98 m west, 18 June 2001, sewage materials – minor water impact 178 m west, 24 July 2001, sewage materials – minor water impact It is considered unlikely that these incidents would affect the site.
Waste management sites within 250 m	There are no records of waste management sites within 250 m of the site boundary.
Statutory authorisations within 50 m	There are no records of any statutory authorisations within 50 m of the site boundary
Trade directory entries of possible contaminative use within 50 m	On site, electricity substation On site, tank 34 m west, Cymru Carpets & Vinyl Specialists – construction completion services 49 m north west, Dais, electrical equipment repair and servicing These are considered unlikely to affect the contaminative status of the subject site.
Special protection or conservation areas within 50 m	There are no recorded special protection or conservation areas within 50 m of the site boundary.
Other relevant issues	None.

2.9 INDICATIVE GROUND STABILITY HAZARDS

2.9.1 Data provided by the British Geological Survey (BGS) on six natural ground stability hazards have been assessed. The maximum hazard rating of each dataset has been included below:

- i.* Shrink-swell clays – very low risk;
- ii.* Landslides – very low, low and moderate risk (majority of site low and moderate risk);
- iii.* Ground dissolution of soluble rocks – negligible risk;
- iv.* Compressible deposits – negligible and very low risk (vast majority of site negligible risk);
- v.* Collapsible deposits – very low risk;
- vi.* Running sands – very low risk.

2.10 RADON GAS

2.10.1 The site does not lie within a Radon Affected Area as defined by the former Health Protection Agency, now Public Health England (less than 1% of properties are above the action level). Guidance issued by the Buildings Research Establishment (BRE-211) indicates no radon protective measures are necessary.

2.11 AIR QUALITY

2.11.1 The site does not lie within a designated Air Quality Management Area (AQMA) for Merthyr Tydfil County Borough Council.

2.12 ECOLOGY

2.12.1 Information from environmental and ecological datasets was obtained from a review of the MAGIC (Multi-Agency Geographic Information for the Countryside) website and the Groundsure report to identify any ecological receptors that might be relevant to the contamination risk assessment for the site. There are no potentially relevant ecological receptors for this site.

2.13 PLANNING RECORDS

2.13.1 Records are held for five applications for minor works at the site from 1998 to 2006. None of these are of significance with respect to contamination matters.

2.13.2 Two prenotifications were made in 2014 for demolition of site structures. The council website does not currently provide access to associated documents relating to these planning notifications which might include for instance requirements to provide asbestos removal plans and clearance testing. Further information has been requested and will be reported under separate cover.

2.14 PREVIOUS INVESTIGATIONS

- 2.14.1 IDOM is unaware of any site investigations having been carried out on the site.
- 2.14.2 Following a request to Merthyr Tydfil County Borough Council, IDOM has been provided with an asbestos survey carried out on structures in 2012 by Santia Asbestos Management Ltd (Santia). It is likely that this was commissioned by the health authority as part of its duty under the Control of Asbestos Regulations 2012. The full register plus a summary table for the positively identified asbestos on site is presented in Appendix 5.
- 2.14.3 The register would have been supported by a report with additional information likely to also have included maps and photographs.
- 2.14.4 Santia is unable to provide a copy of the full report but advises that if the Health Authority permits, the report will be made available. A freedom of information request was made to the authority on 3 July 2019 and a response is expected within 20 working days.
- 2.14.5 The asbestos register shows that asbestos was present in the structures in a number of forms including bitumen, vinyl floor covering, gasket and cement sheet. The majority of materials identified were assessed as "very low" or "low" risk materials in the context of continued use of the structures at the time. However, some of these materials (asbestos insulating board, thermal insulation) have the capacity to generate significant levels of fibre if disturbed.
- 2.14.6 It is possible that a programme of asbestos removal (soft stripping) was carried out prior to demolition but no evidence has been obtained in respect of this.

2.15 ABATEMENT NOTICE

- 2.15.1 Historic maps indicate the hospital previously standing on site was renovated and expanded throughout the 20th Century. Any building having undergone construction or renovation prior to 2000 is at a risk of containing asbestos and this includes St Tydfil's Hospital and supporting service structures.
- 2.15.2 Analysis of Google Earth satellite imagery from 1945 to 2018 indicates the site was substantially demolished by 2016 and that further site works was undertaken up to 2018.
- 2.15.3 On 4 May 2018, Merthyr Tydfil County Borough Council issued Abatement Notices to JDM Contractors (Ref. 2018/612340/AN2), Merthyr Developments (Ref. 2018/612340/AN4) and Shillibiers Ltd (Ref. 2018/612340/AN3). The Abatement Notices were in respect of a dust nuisance at the Former St Tydfil's Hospital, arising from:

'demolition waste being crushed in the open air when it has not been shown that the said waste contains <0.001% asbestos, and that any asbestos fibres released by the process of crushing in the open air are likely be prejudicial to health'.

- 2.15.4 The Abatement Notices orders Shillibiers Ltd to '*Cease crushing in the open air any **materials that** have not been shown to contain <0.001% asbestos.*' JDM Contractors and Merthyr Developments are instructed to '*Cover or frequently damp down any crushed or dusty materials on site.*'

2.16 STOCKPILE TESTING BY OTHERS

- 2.16.1 IDOM was provided with results of testing undertaken on behalf of Terra Firma (Wales) Ltd of seven soil samples and two miscellaneous items samples from the stockpiles as shown on the photographs in Appendix 2.
- 2.16.2 Asbestos in the form of a bundle of chrysotile fibres was found within a single soil sample. The sample did not include any quantification of the asbestos content.
- 2.16.3 No asbestos was detected in the remaining eight samples. Results of asbestos testing are attached in Appendix 6.

2.17 SAMPLE TESTING BY IDOM

- 2.17.1 During the site walkover visit by IDOM engineers, eleven potentially asbestos-containing materials were identified, sampled and laboratory tested for asbestos identification.
- 2.17.2 Materials selected for testing included pipe lagging, vinyl floor covering, bitumen, and other materials having visual indication of possible fibrous content.
- 2.17.3 Pieces of cement board were not sampled as it is considered almost certain that these contain asbestos.
- 2.17.4 Of these eleven samples, two samples were positively identified; a chrysotile containing floor tile and chrysotile containing bitumen. Positive detection of asbestos was made in samples of vinyl floor tile and bitumen sealant from the underside of broken out concrete slabs.
- 2.17.5 Results of asbestos testing by IDOM are attached in Appendix 7.

2.18 COMMENTARY ON EXISTING CONDITIONS

- 2.18.1 In summary the site was formerly in use as a workhouse, later infirmary and hospital until approximately 2014 when demolition of above ground structures took place.
- 2.18.2 It is known that asbestos was present in structures prior to demolition but that the majority of material was of low risk in the context of continued use as a hospital. Some of the asbestos containing materials identified have the capacity to present a higher risk in the context of future use or in uncontrolled stockpiles on site.
- 2.18.3 It is clear some asbestos containing materials from structures remain on site and have become incorporated into stockpiles of crushed material.

2.19 PRELIMINARY CONCEPTUAL SITE MODEL AND RISK ASSESSMENT

2.19.1 From the Phase 1 assessment a preliminary site conceptual model and risk assessment have been produced using the framework established in Part IIA of the ***Environmental Protection Act 1990*** and detailed in Contaminated Land Report ***CLR11 - Model Procedures for the Management of Land Contamination***.

2.19.2 Risk from contamination has been assessed using the source-pathway-receptor and pollutant linkage methodology, whereby a risk can only exist if all elements of: source, pathway and receptor, are present.

2.19.3 Potential sources

2.19.3.1 The following land uses have been identified as potential sources:

- i.* Fuel storage associated with heating/ emergency backup generation;
- ii.* Asbestos containing materials associated with former construction materials;
- iii.* Medical waste;
- iv.* Gas from coal measures and any made ground that may be present;
- v.* Other unknown contaminants arising from site use; and
- vi.* Drug paraphernalia.

2.19.4 Potential Pathways

2.19.4.1 The following potential pathways are identified:

- i.* Airborne exposure to particulates especially asbestos; and
- ii.* Migration of liquid/ soluble contaminants vertically and horizontally.

Topical exposure to surface contamination

2.19.5 Potential Receptors

2.19.5.1 The following receptors are identified under the current use:

- i.* Illegal users of the site;
- ii.* Neighbours and neighbouring land; and
- iii.* Sensitive water courses/ bodies.

2.19.5.2 In the case of the proposed development the following additional receptors are identified:

- i.* Construction workers; and

ii. Future site users/ Residents.

2.19.6 Pollutant Linkages and Risk Ratings

2.19.7 From the Phase 1 assessment, a preliminary site conceptual model has been produced as Table 4 which identifies the potential pollutant linkages. These have been used to inform the Phase 2 intrusive investigation presented in the subsequent sections.


Table 4: Preliminary Conceptual Model

POSSIBLE POLLUTANT LINKAGE			RISK CHARACTERISATION
POTENTIAL SOURCES	PATHWAYS	RECEPTORS	
Asbestos in soil/ material piles	Airborne exposure	Neighbours	Low Risk identified without disturbance to material present, dust generation is considered to be low.
		Construction Workers	Moderate to high risk identified Potential for dust generation to occur during site works
		Future Residents	Moderate risk identified to users from exposure to contaminated garden soils
Hydrocarbons	Contact with contaminated soil/ water	Neighbours	Low risk identified Low potential for onsite spills and for hydrocarbons to impact offsite sources.
	Contact with contaminated soil/ water	Future residents and construction workers)	Low to Moderate risk Construction workers are initially at the greatest risk. Potential for made ground to contain hydrocarbons.
	Migration to sensitive water body	Groundwater/ surface water	Low to Moderate risk identified Potential for made ground to impact groundwater. No surface water features located within the vicinity.
	Contact	Services/ pipes	Moderate Risk identified Potential for made ground to contain Hydrocarbons. Cannot be ruled out at this time.
Medical clinical waste/ drug paraphernalia	Direct exposure	Construction workers	Moderate Risk identified Items have been identified onsite during site walkover. Greatest risk identified during site works.
		Future residents	Low to Moderate identified Without mitigating measures, potential for worked ground to contain materials identified.
Hazardous Gas/Vapours In soil	Ingress into buildings and voids	Future residents	Moderate risk identified Potential for natural geological gas sources for coal measures. Cannot rule out fuel spillages as source of vapours
Adjacent Land	Horizontal migration through made ground materials	Future Residents and Offsite Receptors	Moderate Risk identified Cannot rule out the potential for made ground to impact offsite land uses.

SECTION 3 CONCLUSIONS AND RECOMMENDATIONS

- 3.1 The site was formerly intensively used for medical/ workhouse purposes and was densely developed with most of the construction being completed in 1980's.
- 3.2 A demolition exercise was undertaken in approximately 2016 and demolition materials were partially processed however the processing operation appears to have stalled and this may be coincidental to abatement notices issued by Merthyr Council in respect of dust and potential asbestos contamination.
- 3.3 Initial testing by other and limited inspection by IDOM does not suggest that asbestos is widely present at least in surface parts of the site. Some isolated instances of ACM were identified but the material so far identified is of low risk with respect to airborne fibre generation.
- 3.4 From the records available it is clear that the majority of asbestos in the hospital prior to demolition was of lower risk however some evidence of higher risk materials was present. Efforts should be made to establish whether such material was stripped and removed from site prior to demolition. Information from a Freedom of Information Request is awaited.
- 3.5 It is recommended that a phase II intrusive site investigation be undertaken. The investigation should comprise:
- i.* Careful investigation into the nature of stockpiled material accompanied by St Tydfil's Developments LLP selected remediation contractor. Sufficient testing of the material identified should be undertaken to suitably classify it;
 - ii.* Boreholes and trial pits in selected locations to establish the ground and water conditions beneath existing slabs and in natural ground; and
 - iii.* Targeted investigation around the above ground tank where hydrocarbon staining has been identified.

APPENDIX 1 ▪ Drawings

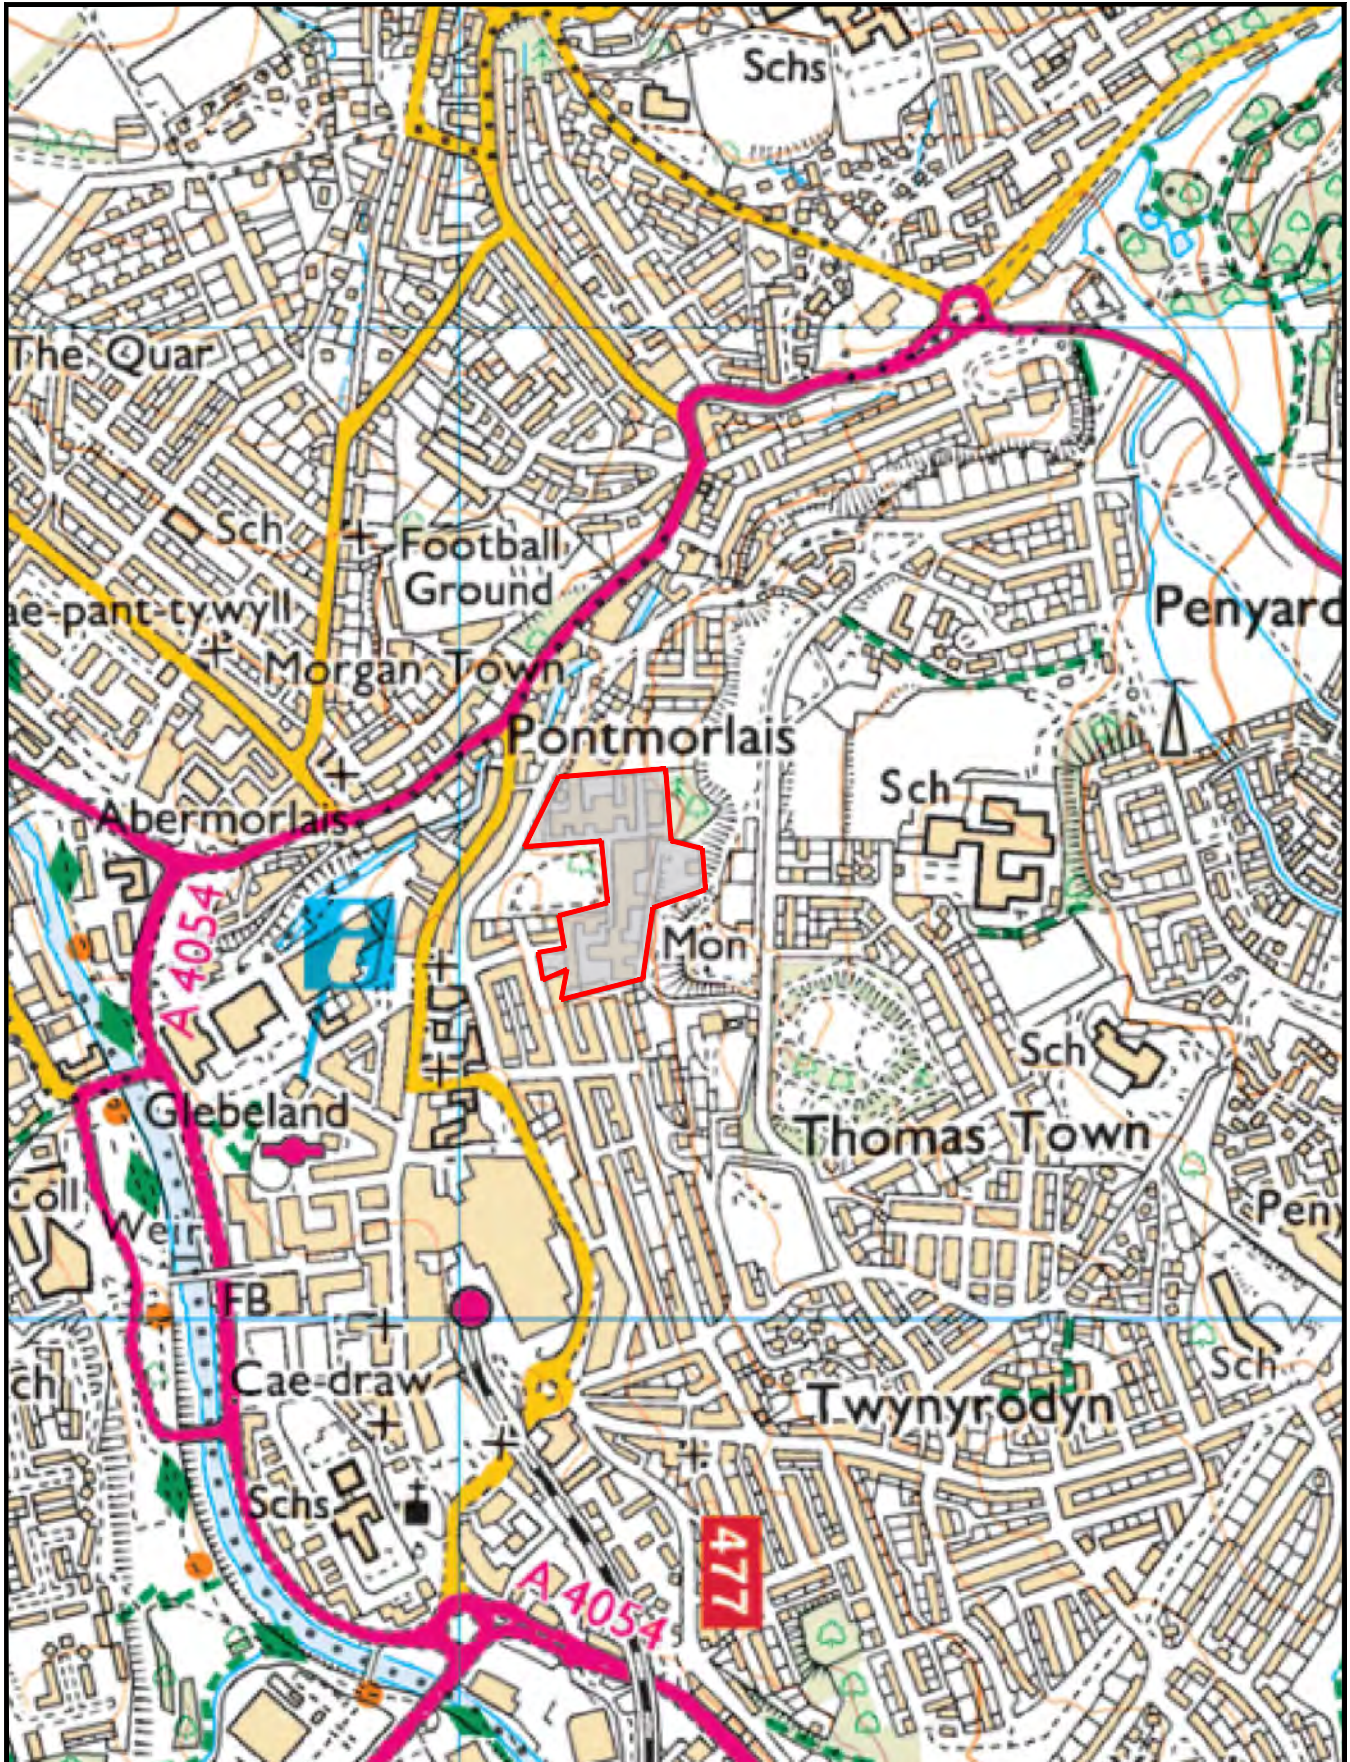

Reproduced from the Ordnance Survey's 1:25000 map published with the permission of the Controller of Her Majesty's Stationery Office, © Crown copyright.
IDOM Merebrook Limited AL 100048771

IDOM

Coronado Property Developments Ltd
Merthyr Tidfil Hospital
Site Location Plan

Cromford Mills, Mill Lane, Matlock, Derbyshire DE4 3RQ
t: +44(0)1773 829 988 f: +44(0)1773 829 393 e: info.derbyshire@idom.com

First Issue		02-07-2019		
Issue Details		FDO	TPC	TPC
Job No.		Dwn	Chd	App'd
21988				
Dwg No.		Revision		
001-001		-		
Scale		Date		
N.T.S		July 2019		
Drawn		Frame Dimensions mm (A4) 250x181		
FDO		Approved		
Checked		TPC		
		TPC		

APPENDIX 2 ▪ Site walkover photographs

APPENDIX 2 - SITE WALKOVER PHOTOGRAPHS

Bund exterior



Bund interior



Asbestos sheets



Unprocessed demolition waste stockpile



Processed demolition waste stockpiles



Pipe showing lagging



APPENDIX 3 ▪ Groundsure Report

Site Details:

MERTHYR TYDFIL, CF47 0BL

Client Ref: 19-S715-TPC-21988
Report Ref: HMD-154-6127015
Grid Ref: 305157, 206430

Map Name: County Series


Map date: 1875

Scale: 1:2,500

Printed at: 1:2,500



Surveyed 1875
Revised 1875
Edition N/A
Copyright N/A
Levelled N/A

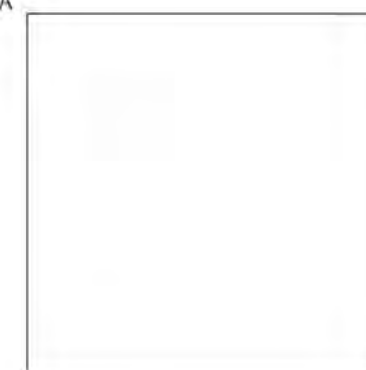



Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 26 June 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

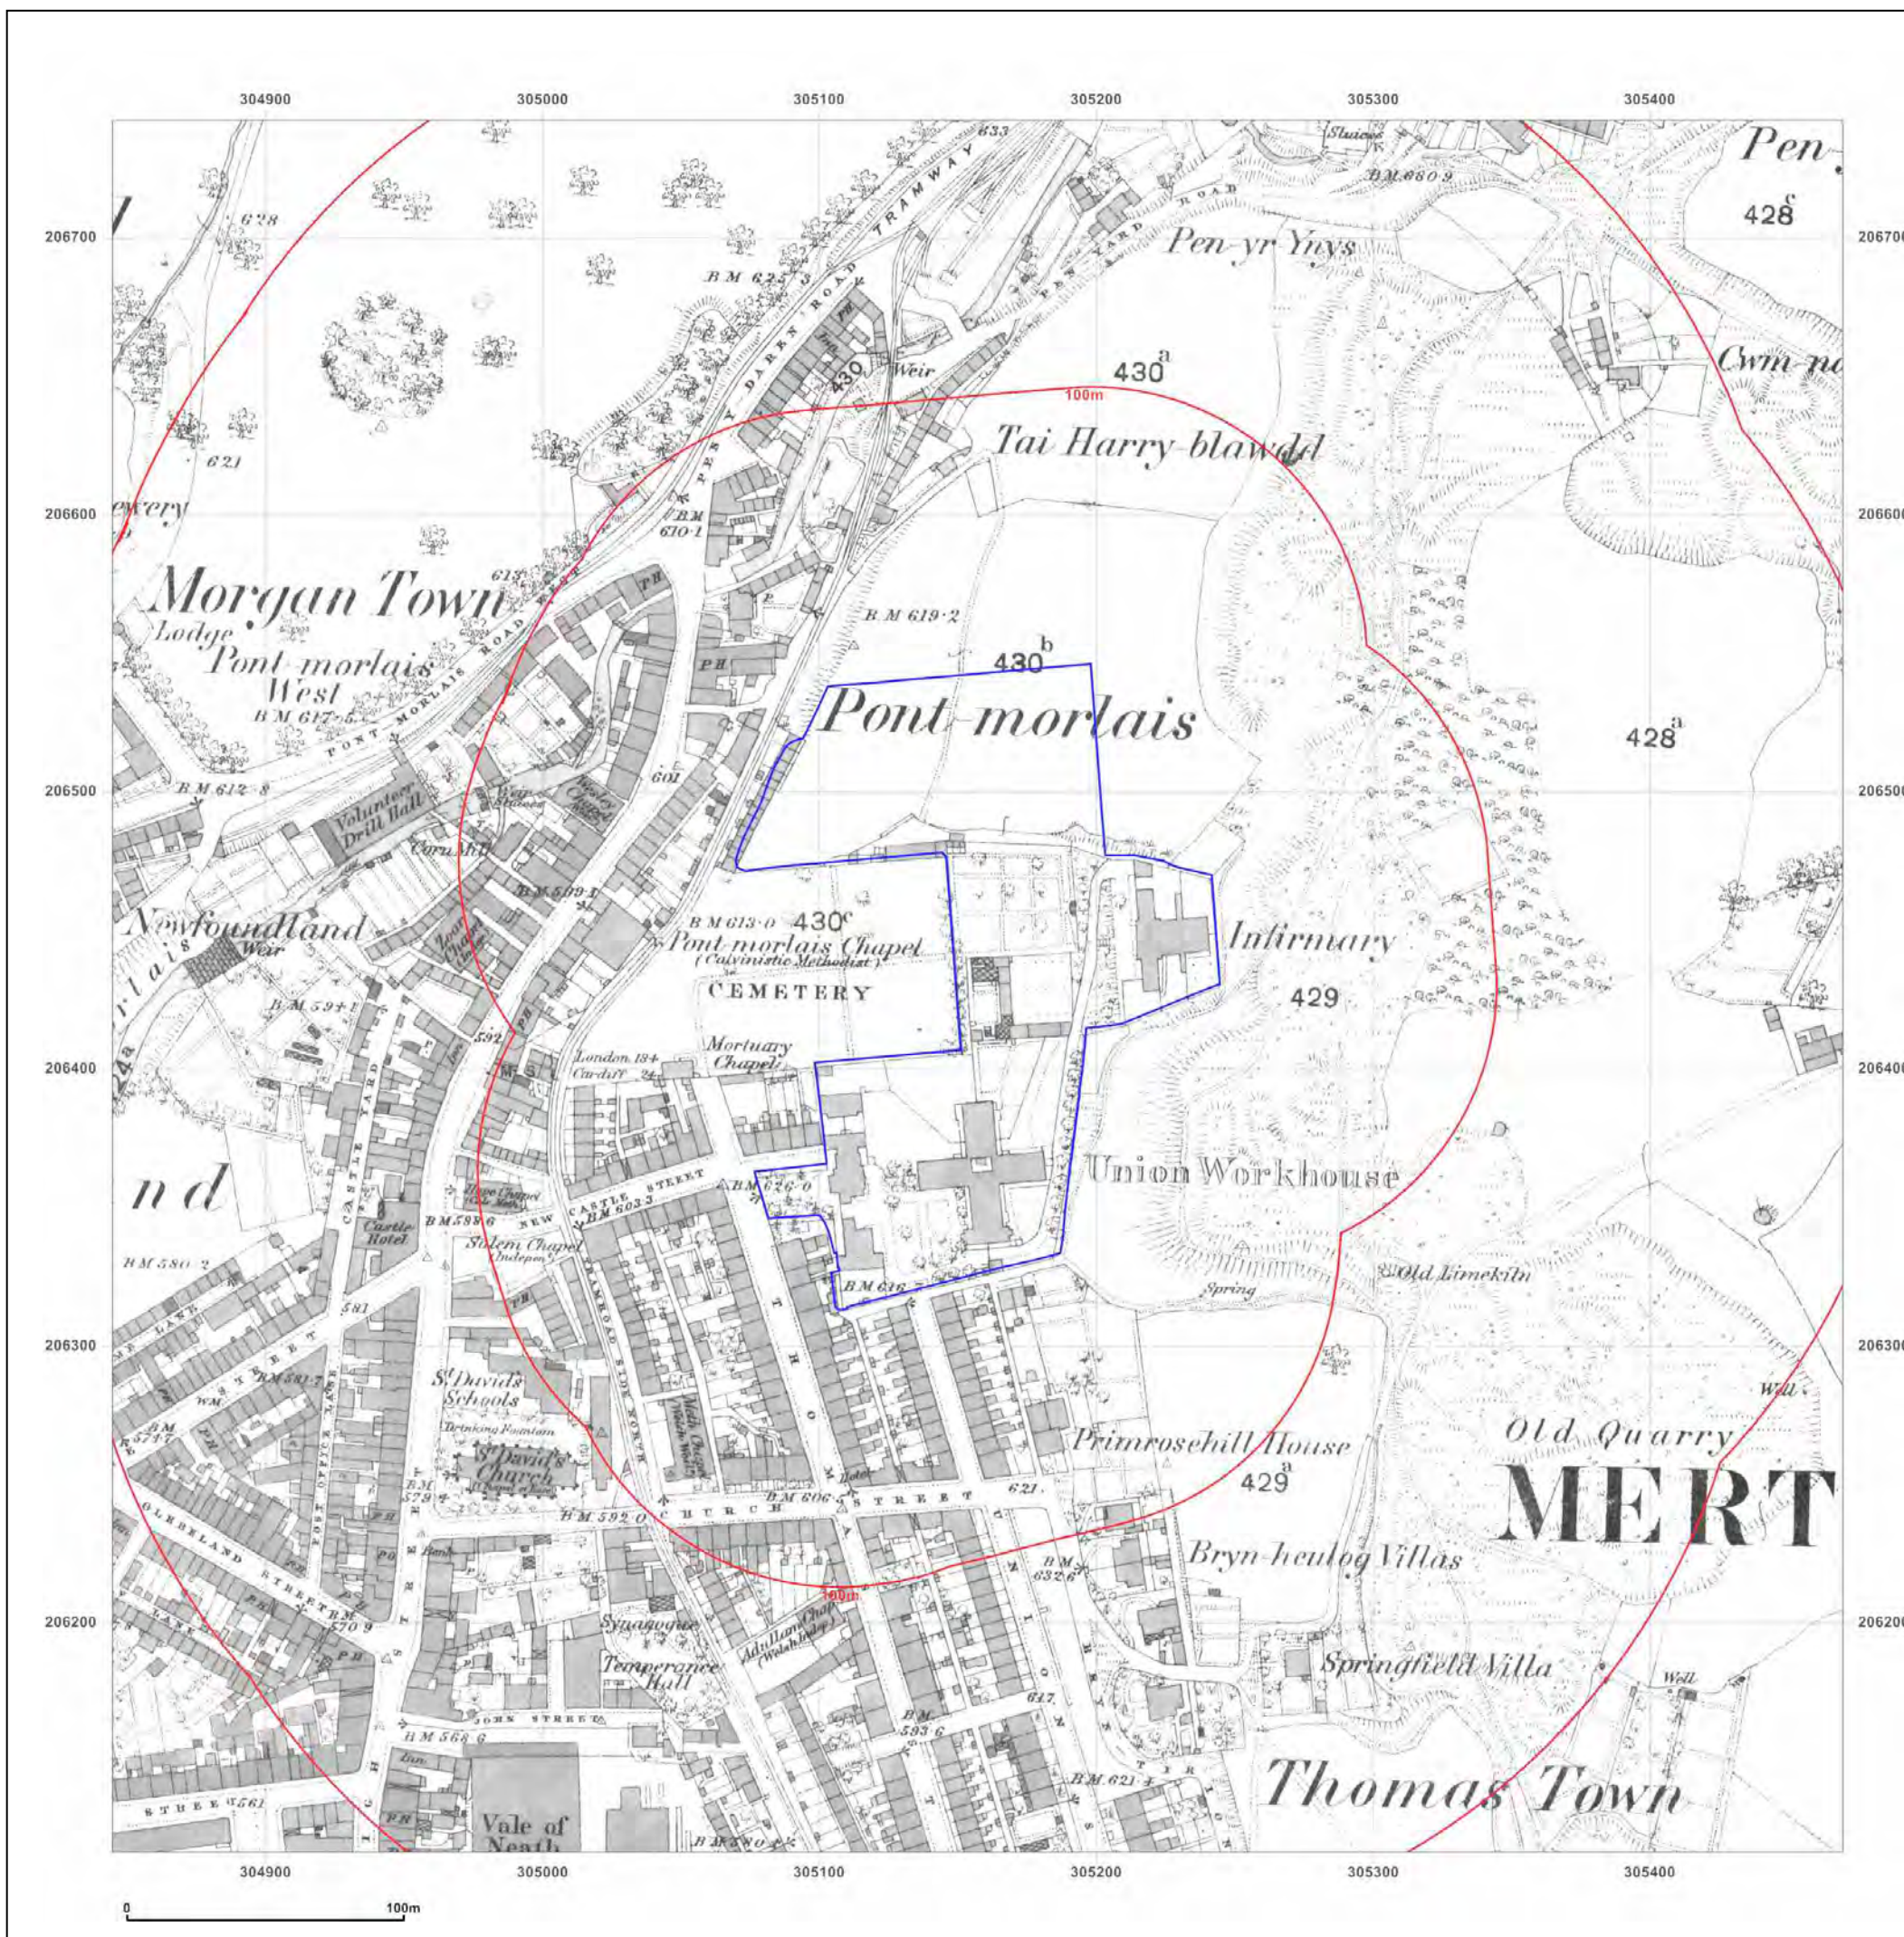

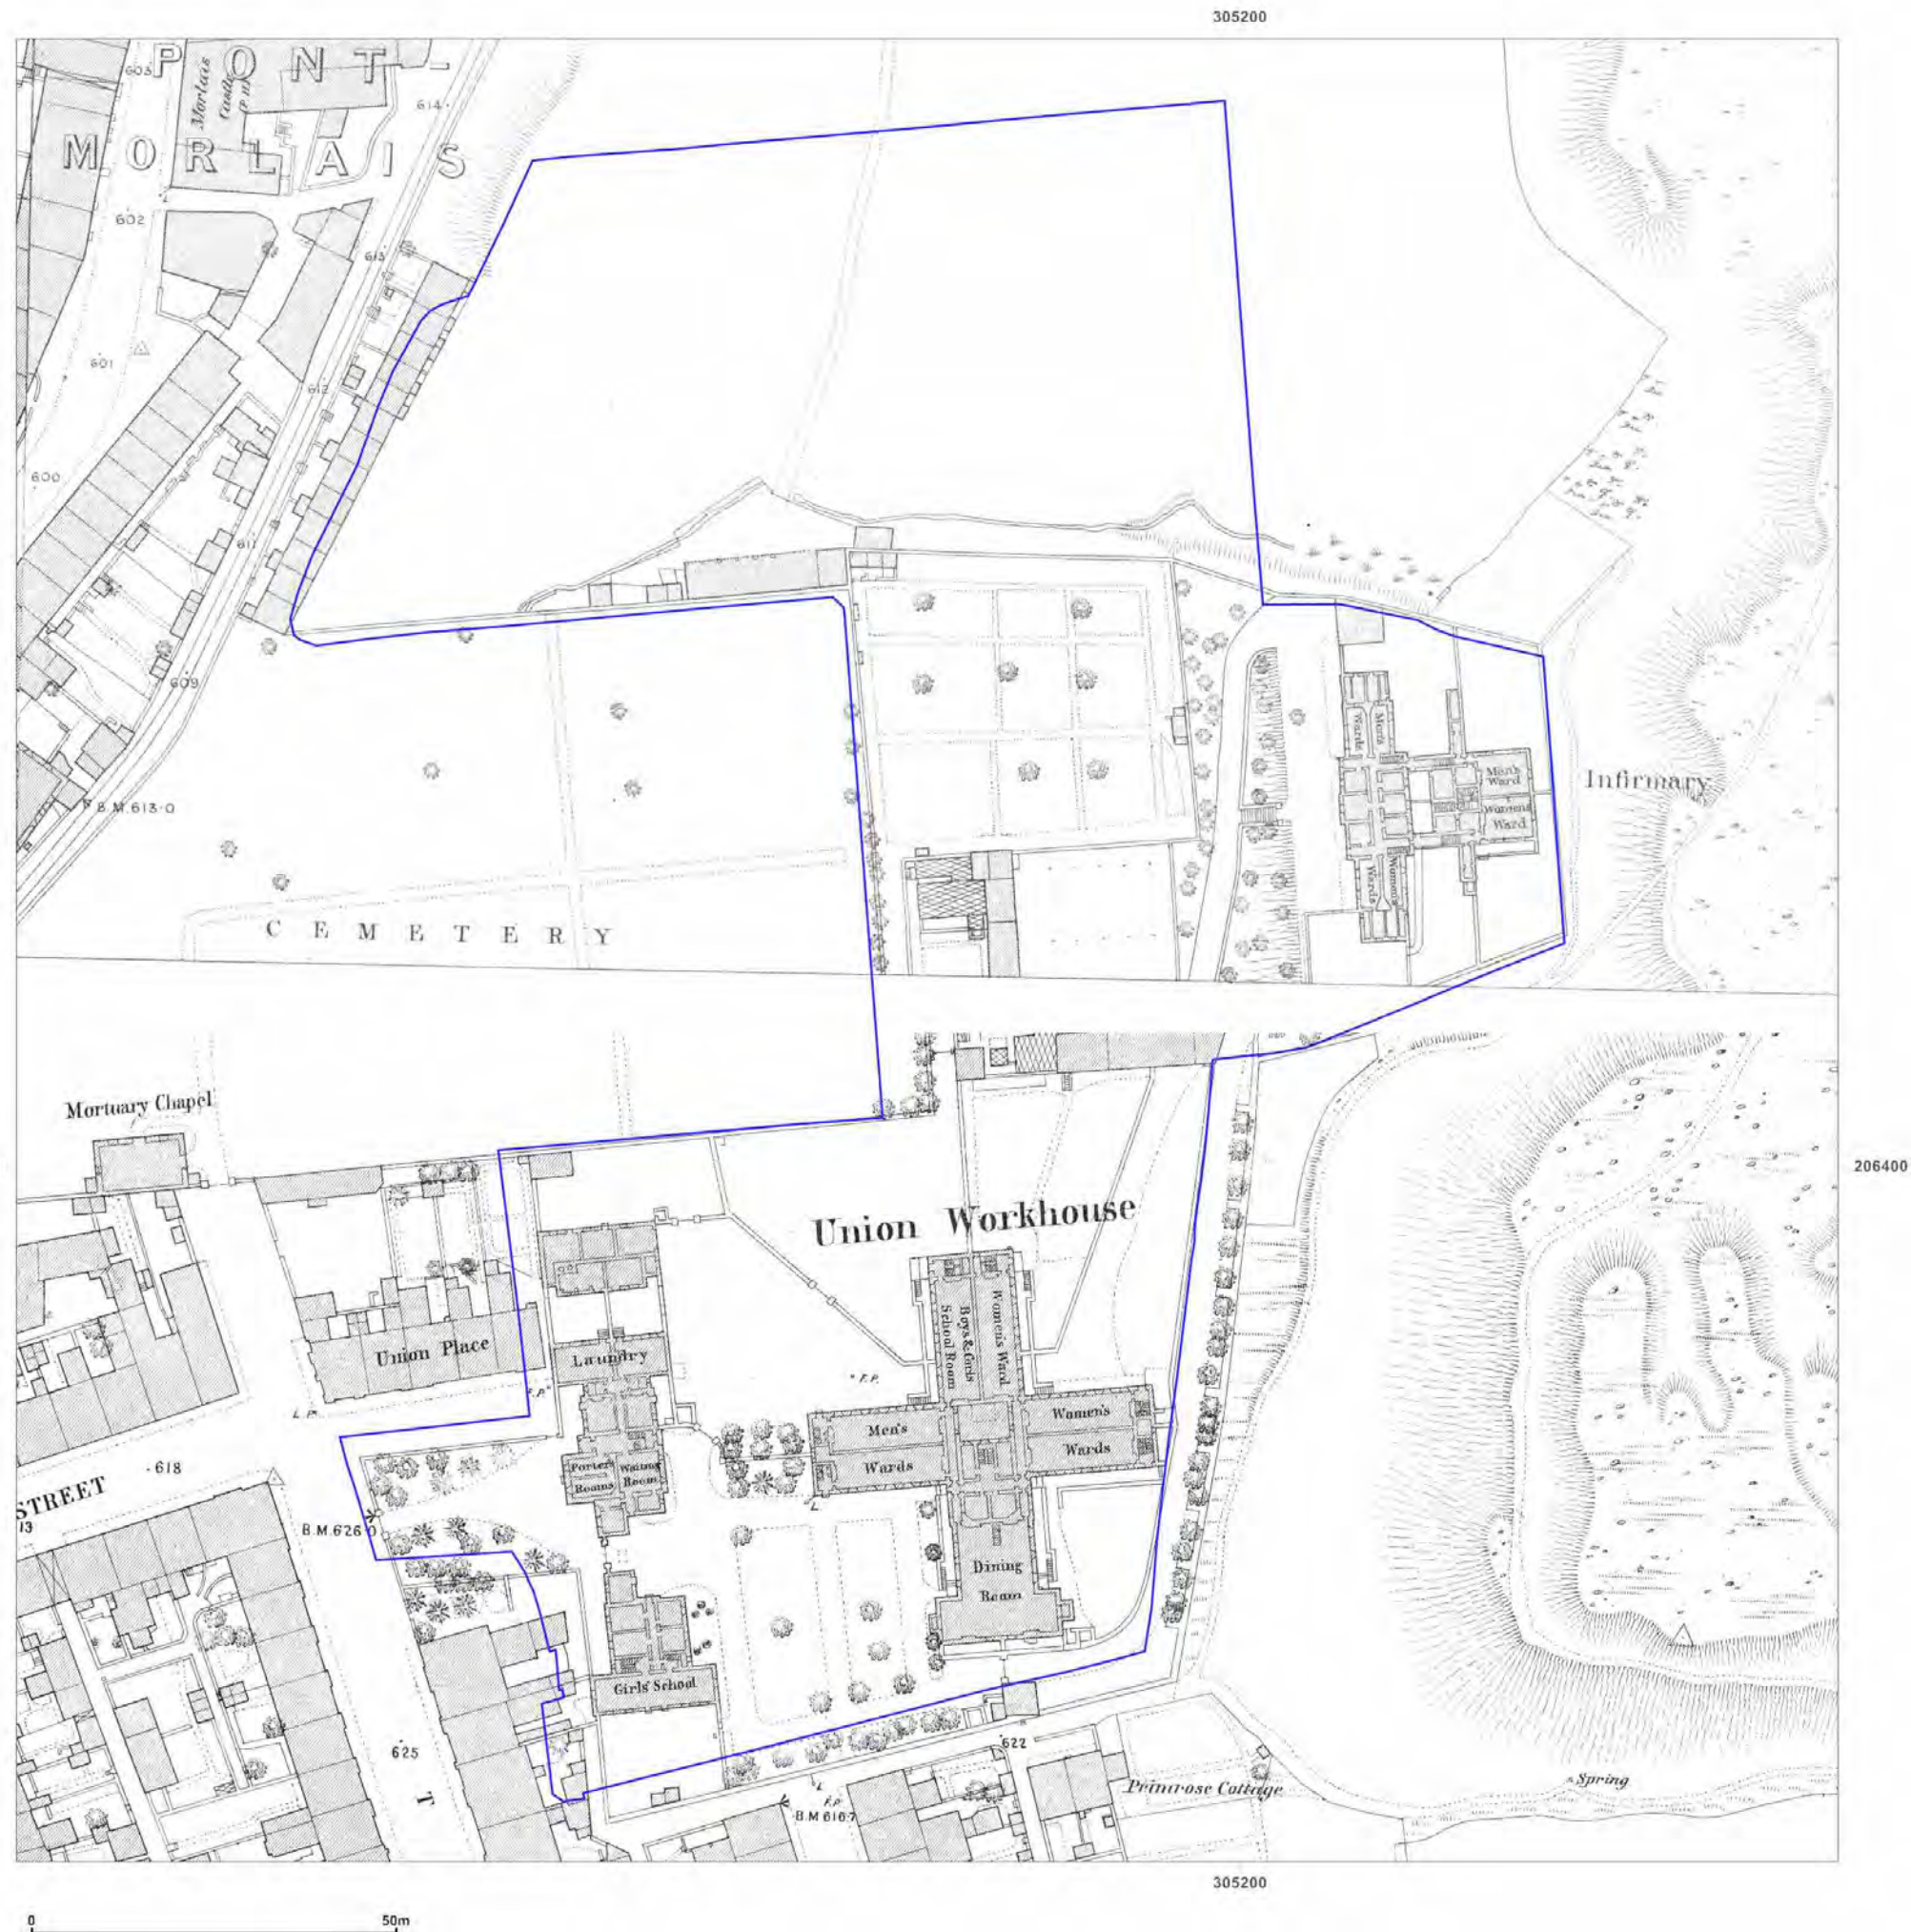

Site Details:

MERTHYR TYDFIL, CF47 0BL

Client Ref: 19-S715-TPC-21988
Report Ref: HMD-154-6127015
Grid Ref: 305157, 206430

Map Name: County Series Town Plan

Map date: 1875

Scale: 1:500

Printed at: 1:1,000



Surveyed 1875
Revised N/A
Edition N/A
Copyright N/A
Levelled N/A

Surveyed 1875
Revised N/A
Edition N/A
Copyright N/A
Levelled N/A

Surveyed 1875
Revised N/A
Edition N/A
Copyright N/A
Levelled N/A



Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 26 June 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

Site Details:

MERTHYR TYDFIL, CF47 0BL

Client Ref: 19-S715-TPC-21988
Report Ref: HMD-154-6127015
Grid Ref: 305157, 206430

Map Name: County Series


Map date: 1900

Scale: 1:2,500

Printed at: 1:2,500



Surveyed 1900
 Revised 1900
 Edition N/A
 Copyright N/A
 Levelled N/A

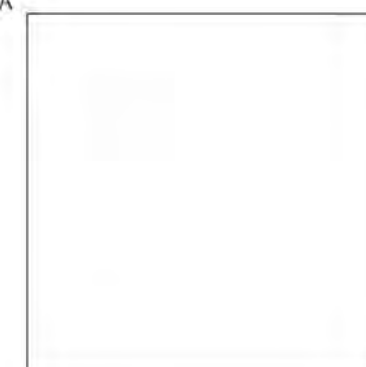

Produced by
 Groundsure Insights
 T: 08444 159000
 E: info@groundsure.com
 W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 26 June 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf



Site Details:

MERTHYR TYDFIL, CF47 0BL

Client Ref: 19-S715-TPC-21988

Report Ref: HMD-154-6127015

Grid Ref: 305157, 206430

Map Name: County Series


Map date: 1904

Scale: 1:2,500

Printed at: 1:2,500



Surveyed 1904
Revised 1904
Edition N/A
Copyright N/A
Levelled N/A

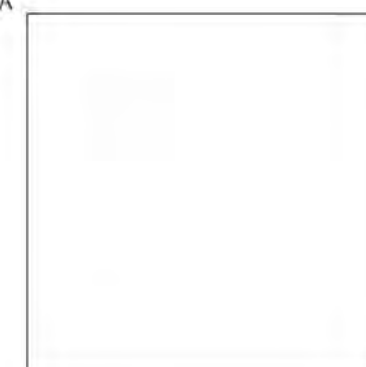


Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 26 June 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

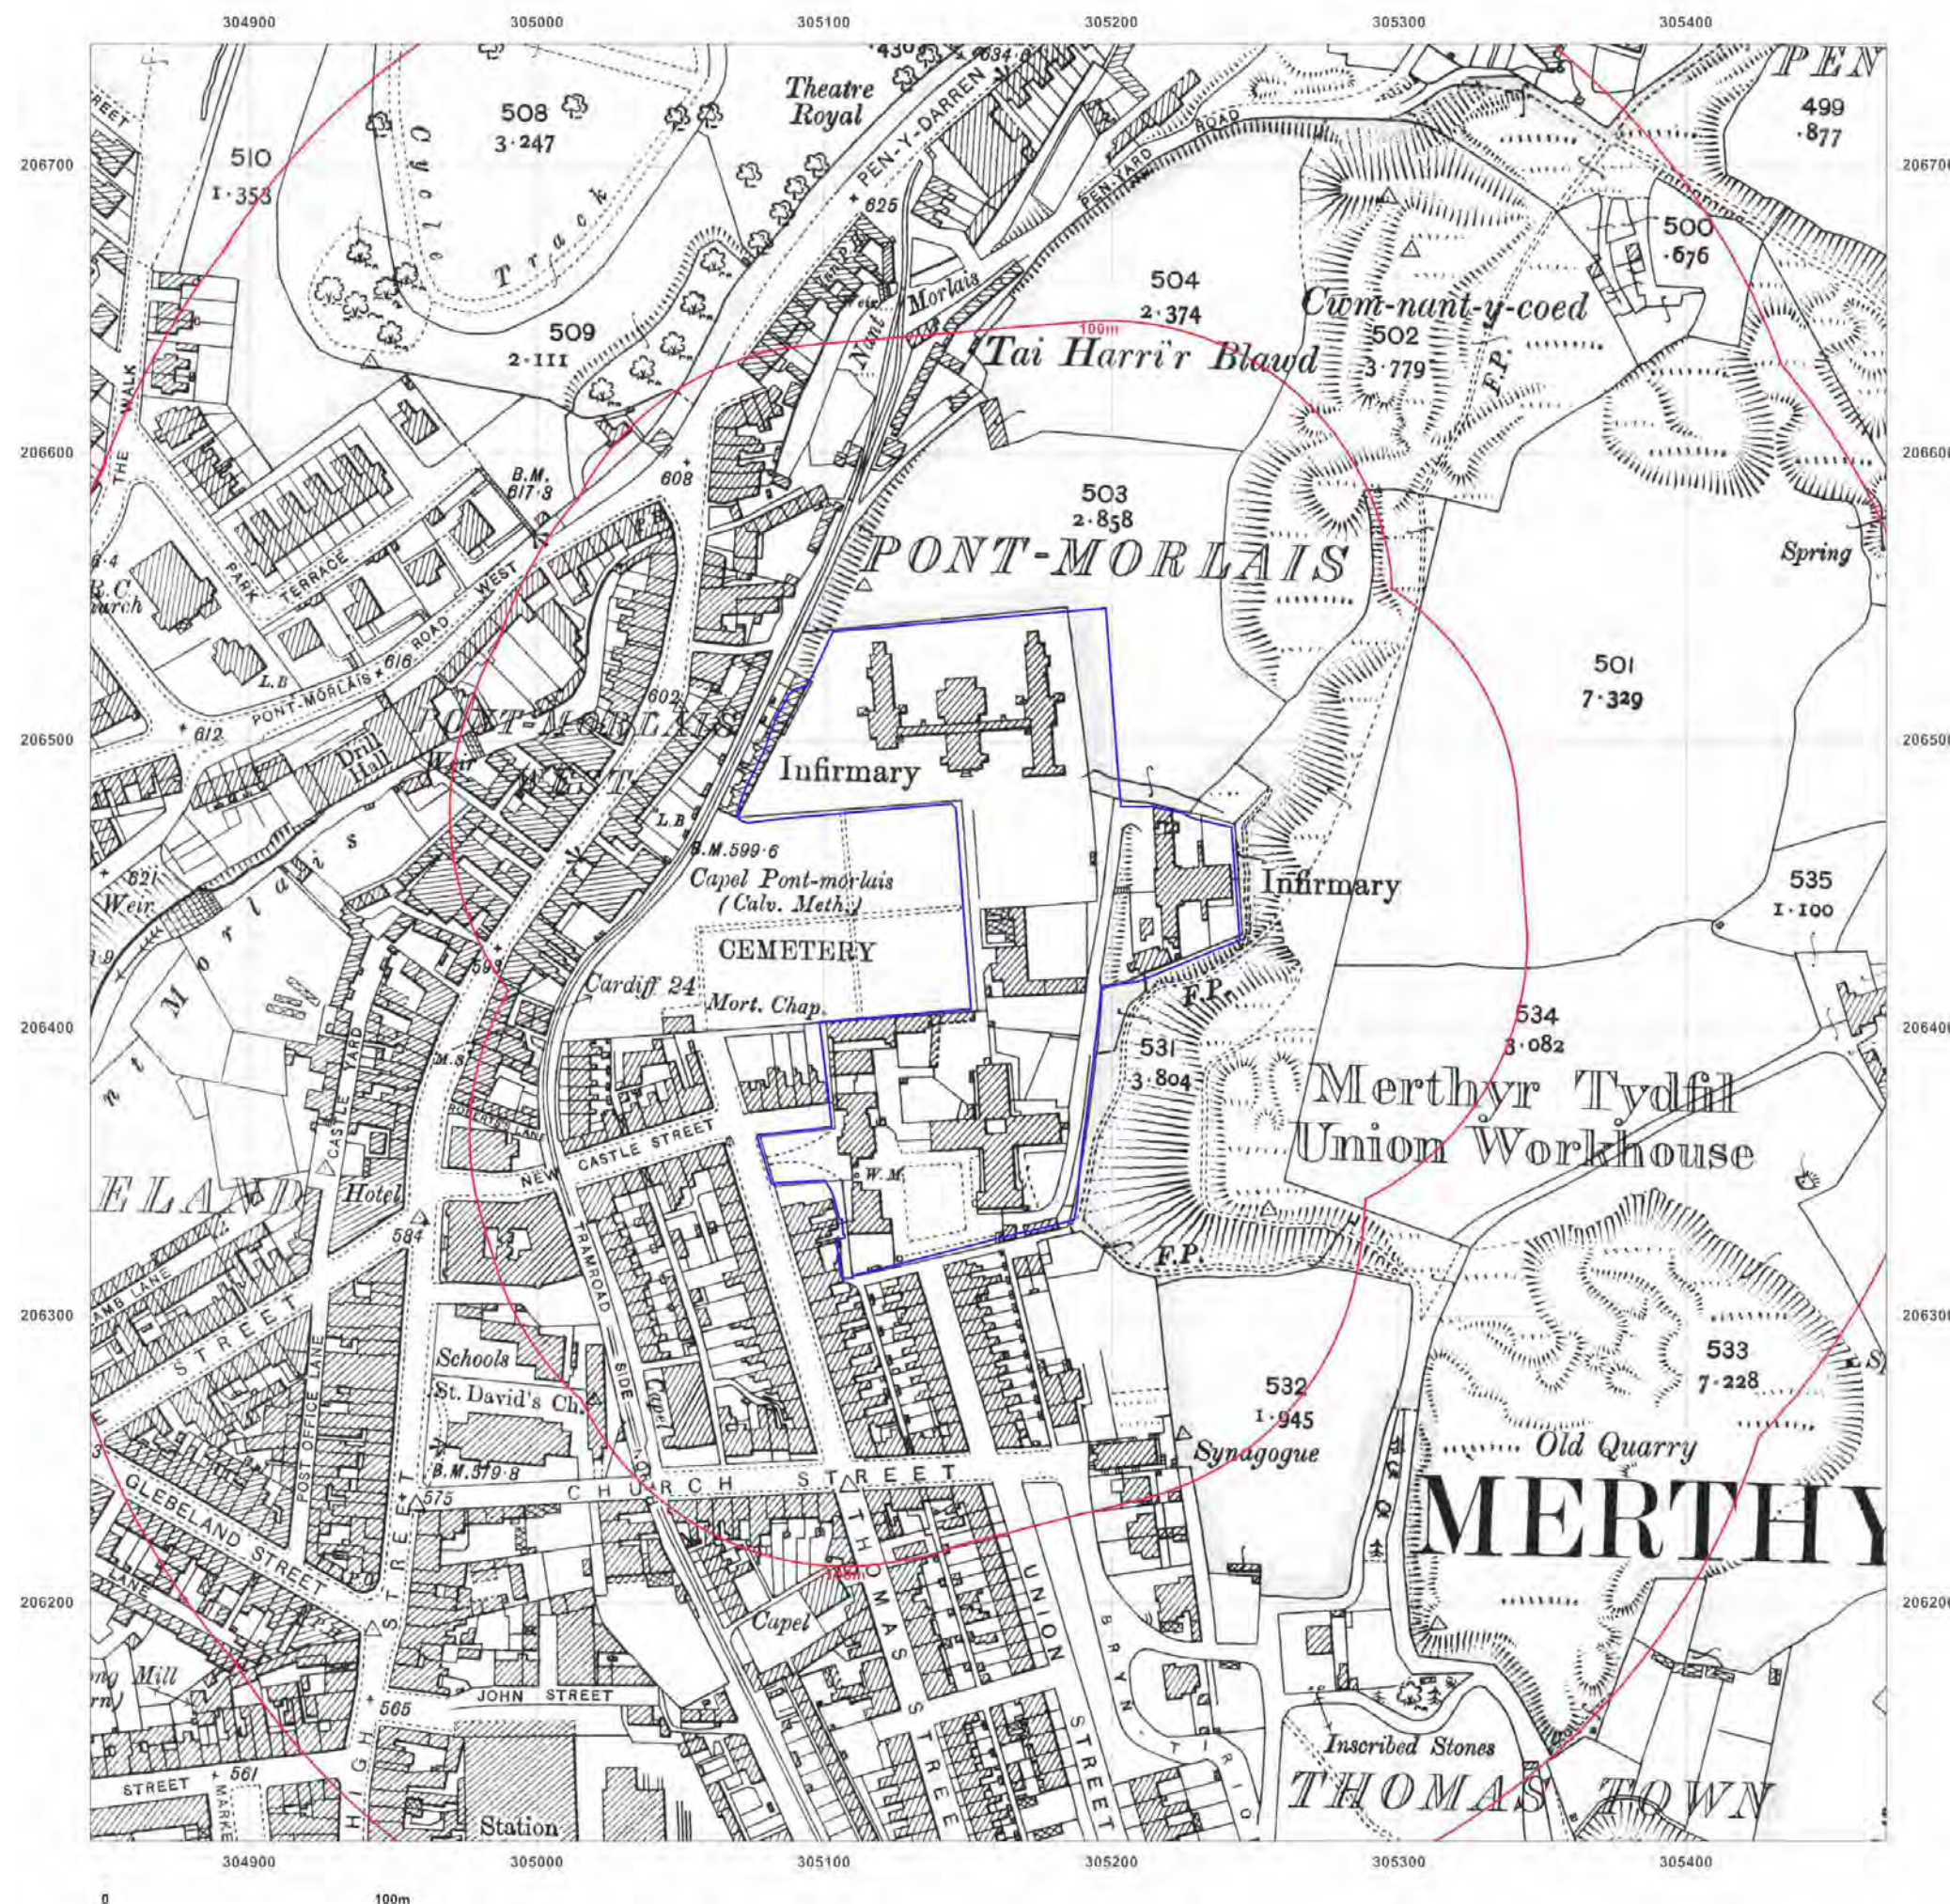

Site Details:

MERTHYR TYDFIL, CF47 0BL

Client Ref: 19-S715-TPC-21988

Report Ref: HMD-154-6127015

Grid Ref: 305157, 206430

Map Name: County Series


Map date: 1919

Scale: 1:2,500

Printed at: 1:2,500



Surveyed 1919
Revised 1919
Edition N/A
Copyright N/A
Levelled N/A

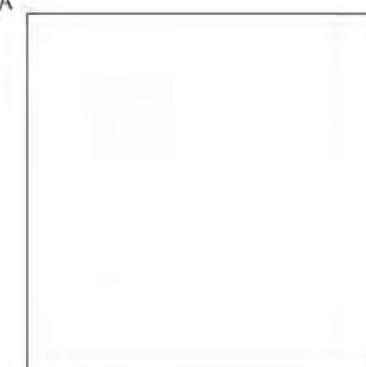


Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 26 June 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

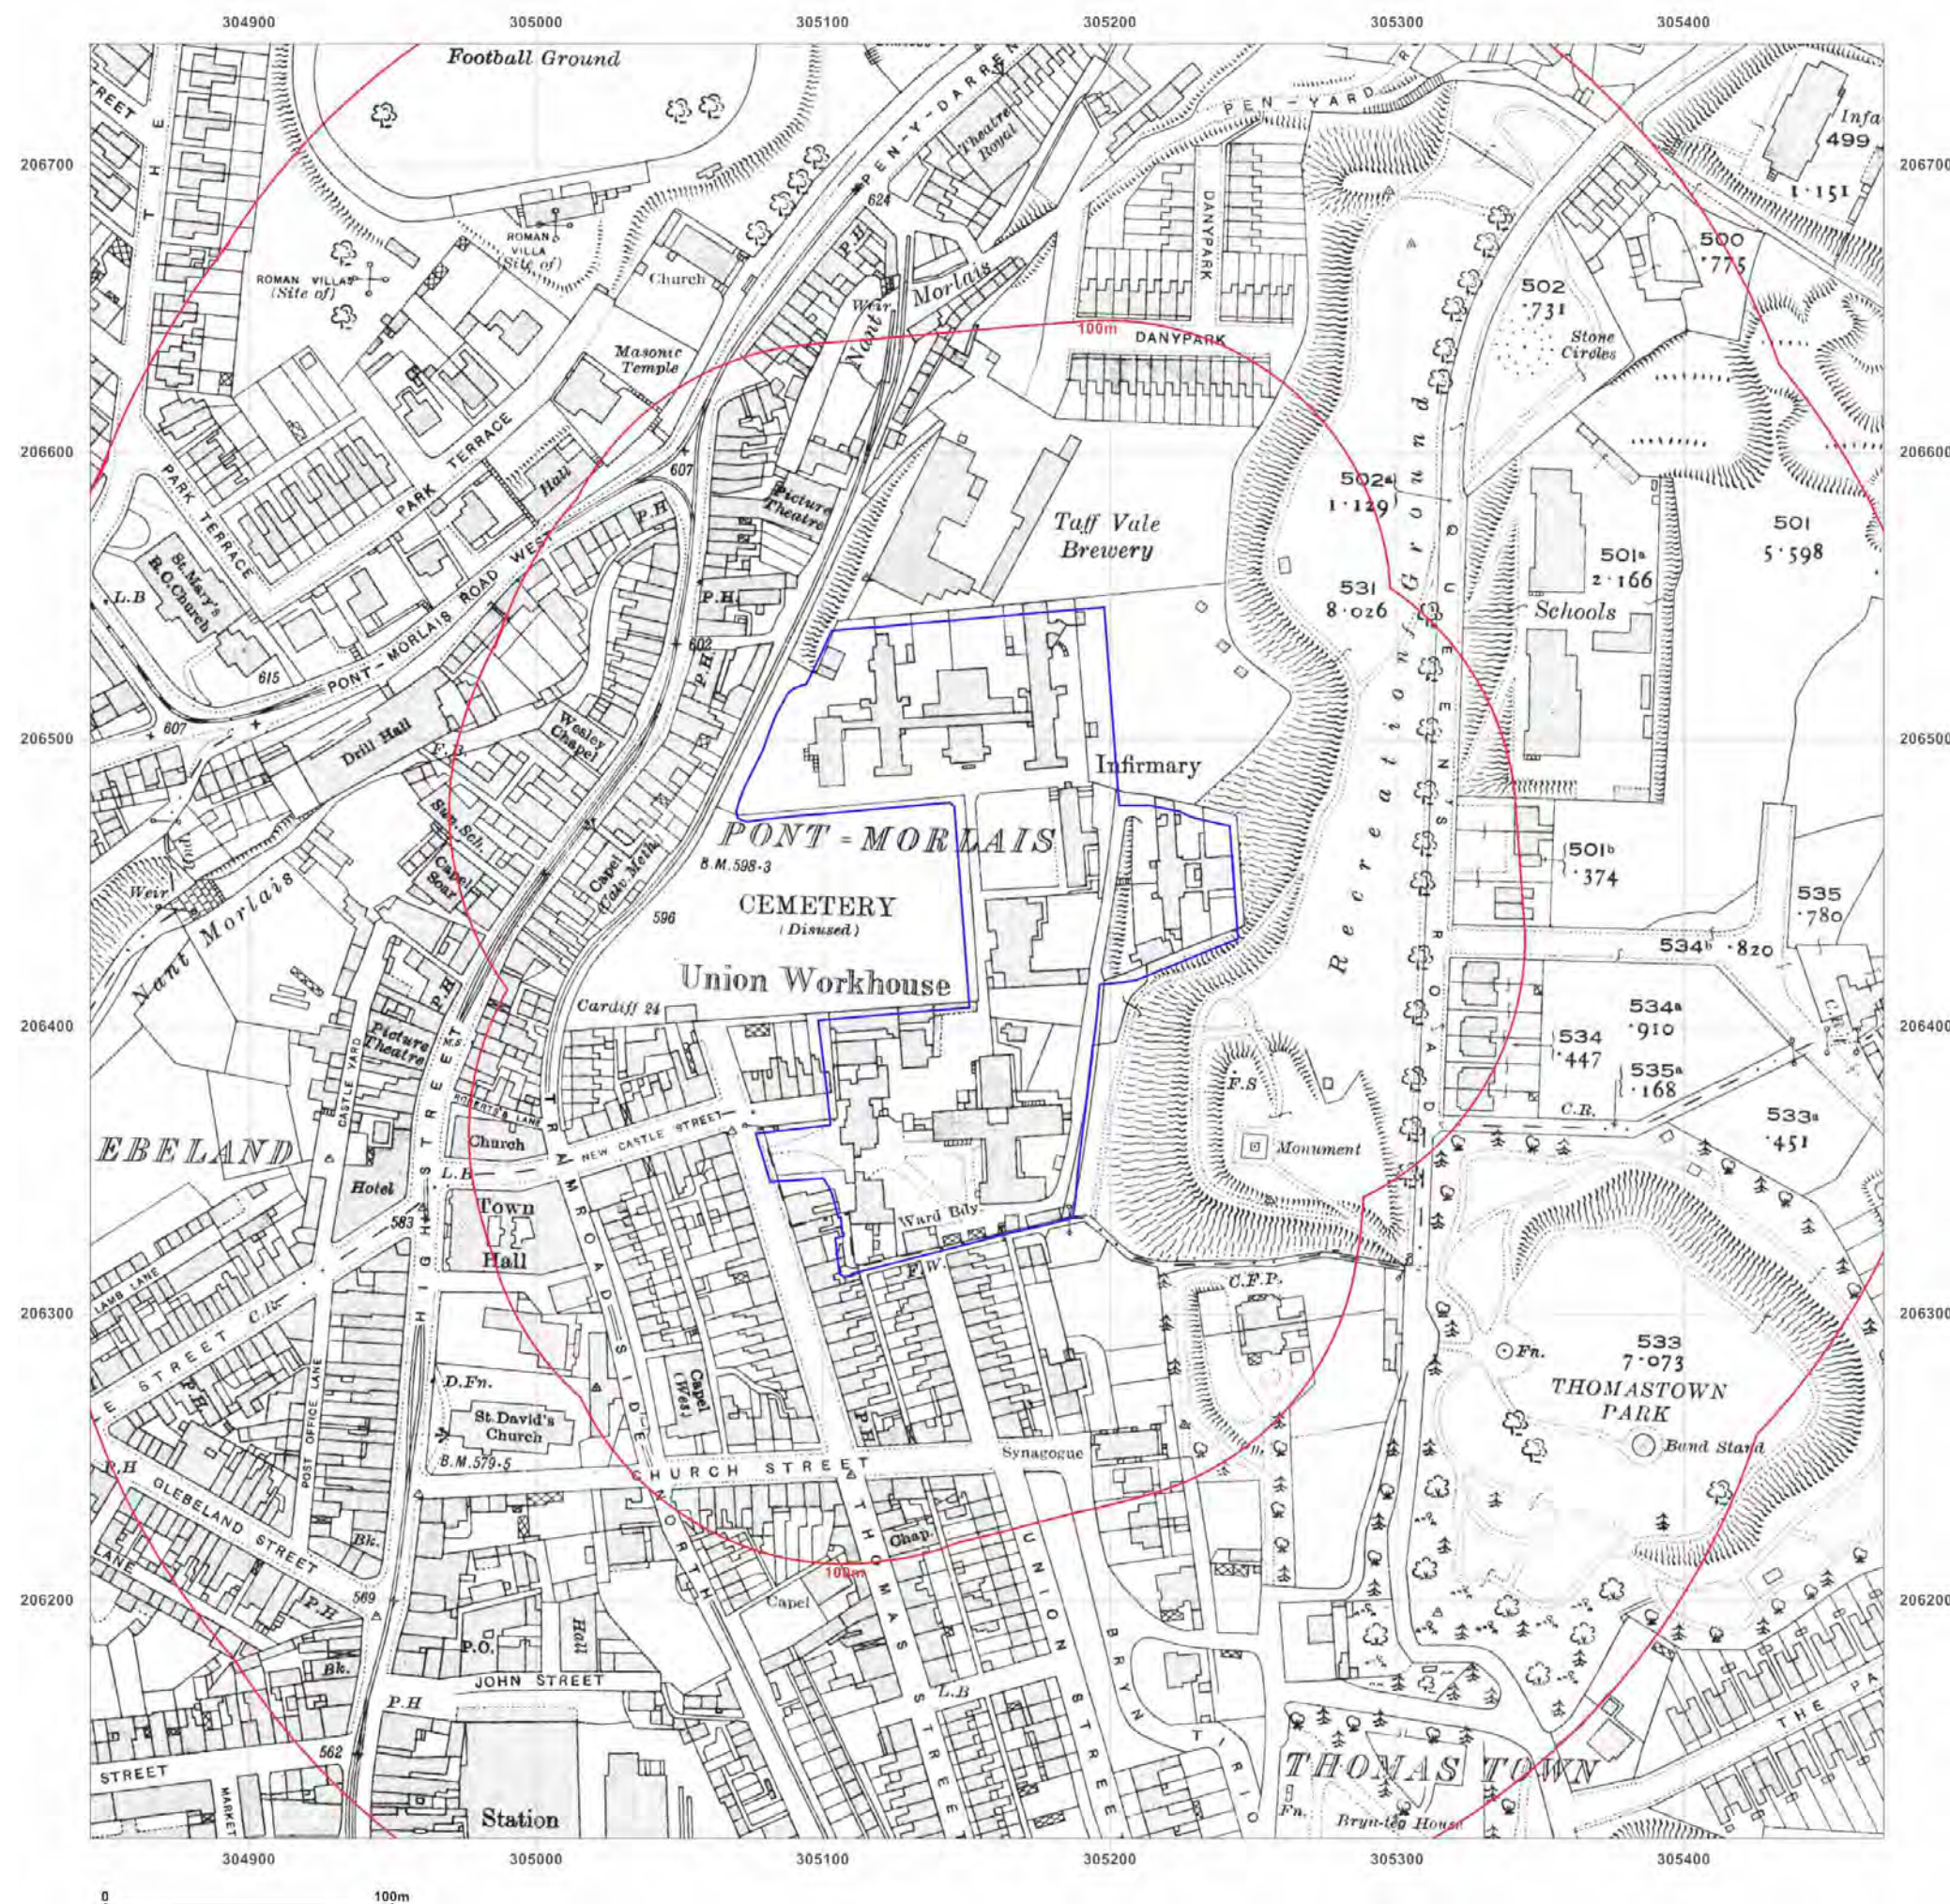

Site Details:

MERTHYR TYDFIL, CF47 0BL

Client Ref: 19-S715-TPC-21988

Report Ref: HMD-154-6127015

Grid Ref: 305157, 206430

Map Name: National Grid

Map date: 1957

Scale: 1:1,250

Printed at: 1:2,000



Surveyed 1957
Revised 1957
Edition N/A
Copyright N/A
Levelled 1950

Surveyed 1957
Revised 1957
Edition N/A
Copyright N/A
Levelled 1950

Surveyed 1957
Revised 1957
Edition N/A
Copyright N/A
Levelled 1950

Surveyed 1957
Revised 1957
Edition N/A
Copyright N/A
Levelled 1950




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 26 June 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

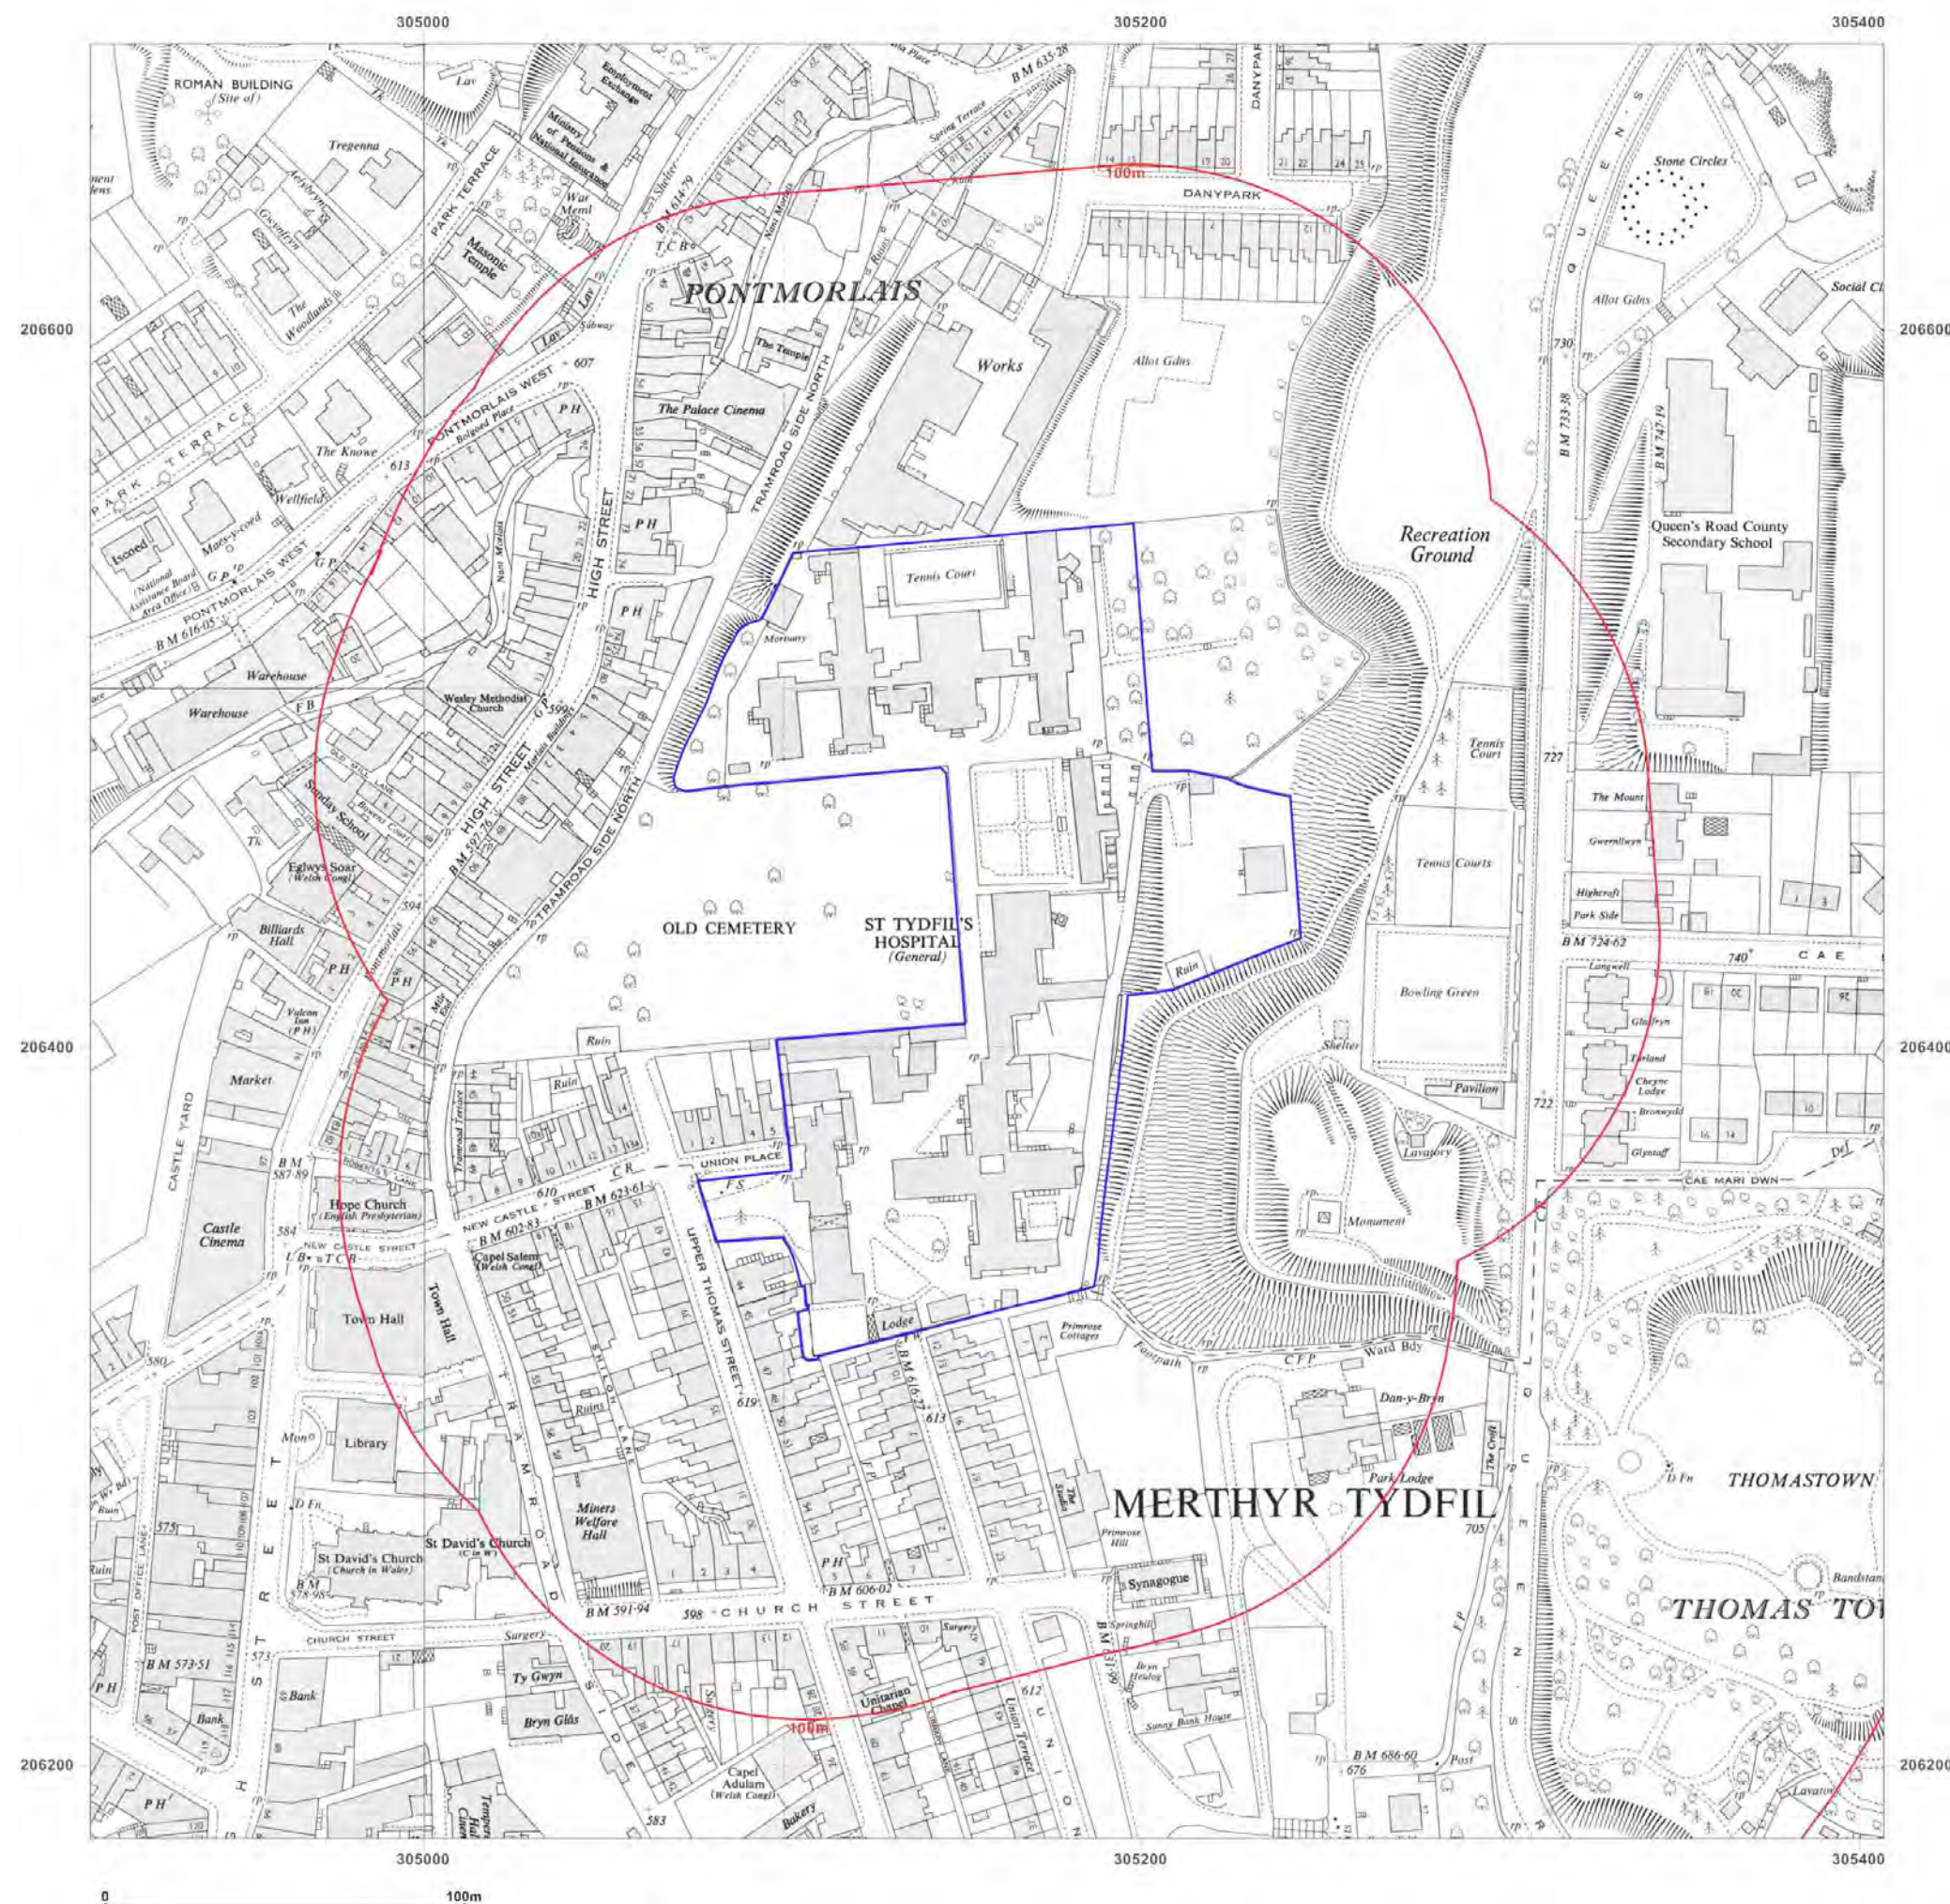

Site Details:

MERTHYR TYDFIL, CF47 0BL

Client Ref: 19-S715-TPC-21988
Report Ref: HMD-154-6127015
Grid Ref: 305157, 206430

Map Name: National Grid

Map date: 1957-1958

Scale: 1:2,500

Printed at: 1:2,500



Surveyed 1957
Revised 1957
Edition 1958
Copyright N/A
Levelled 1950

Surveyed N/A
Revised N/A
Edition N/A
Copyright N/A
Levelled N/A



Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 26 June 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf



Site Details:

MERTHYR TYDFIL, CF47 0BL

Client Ref: 19-S715-TPC-21988
Report Ref: HMD-154-6127015
Grid Ref: 305157, 206430

Map Name: National Grid

Map date: 1957-1958

Scale: 1:2,500

Printed at: 1:2,500



Surveyed N/A
Revised N/A
Edition N/A
Copyright N/A
Levelled N/A

Surveyed 1957
Revised 1957
Edition 1958
Copyright N/A
Levelled 1950




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 26 June 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

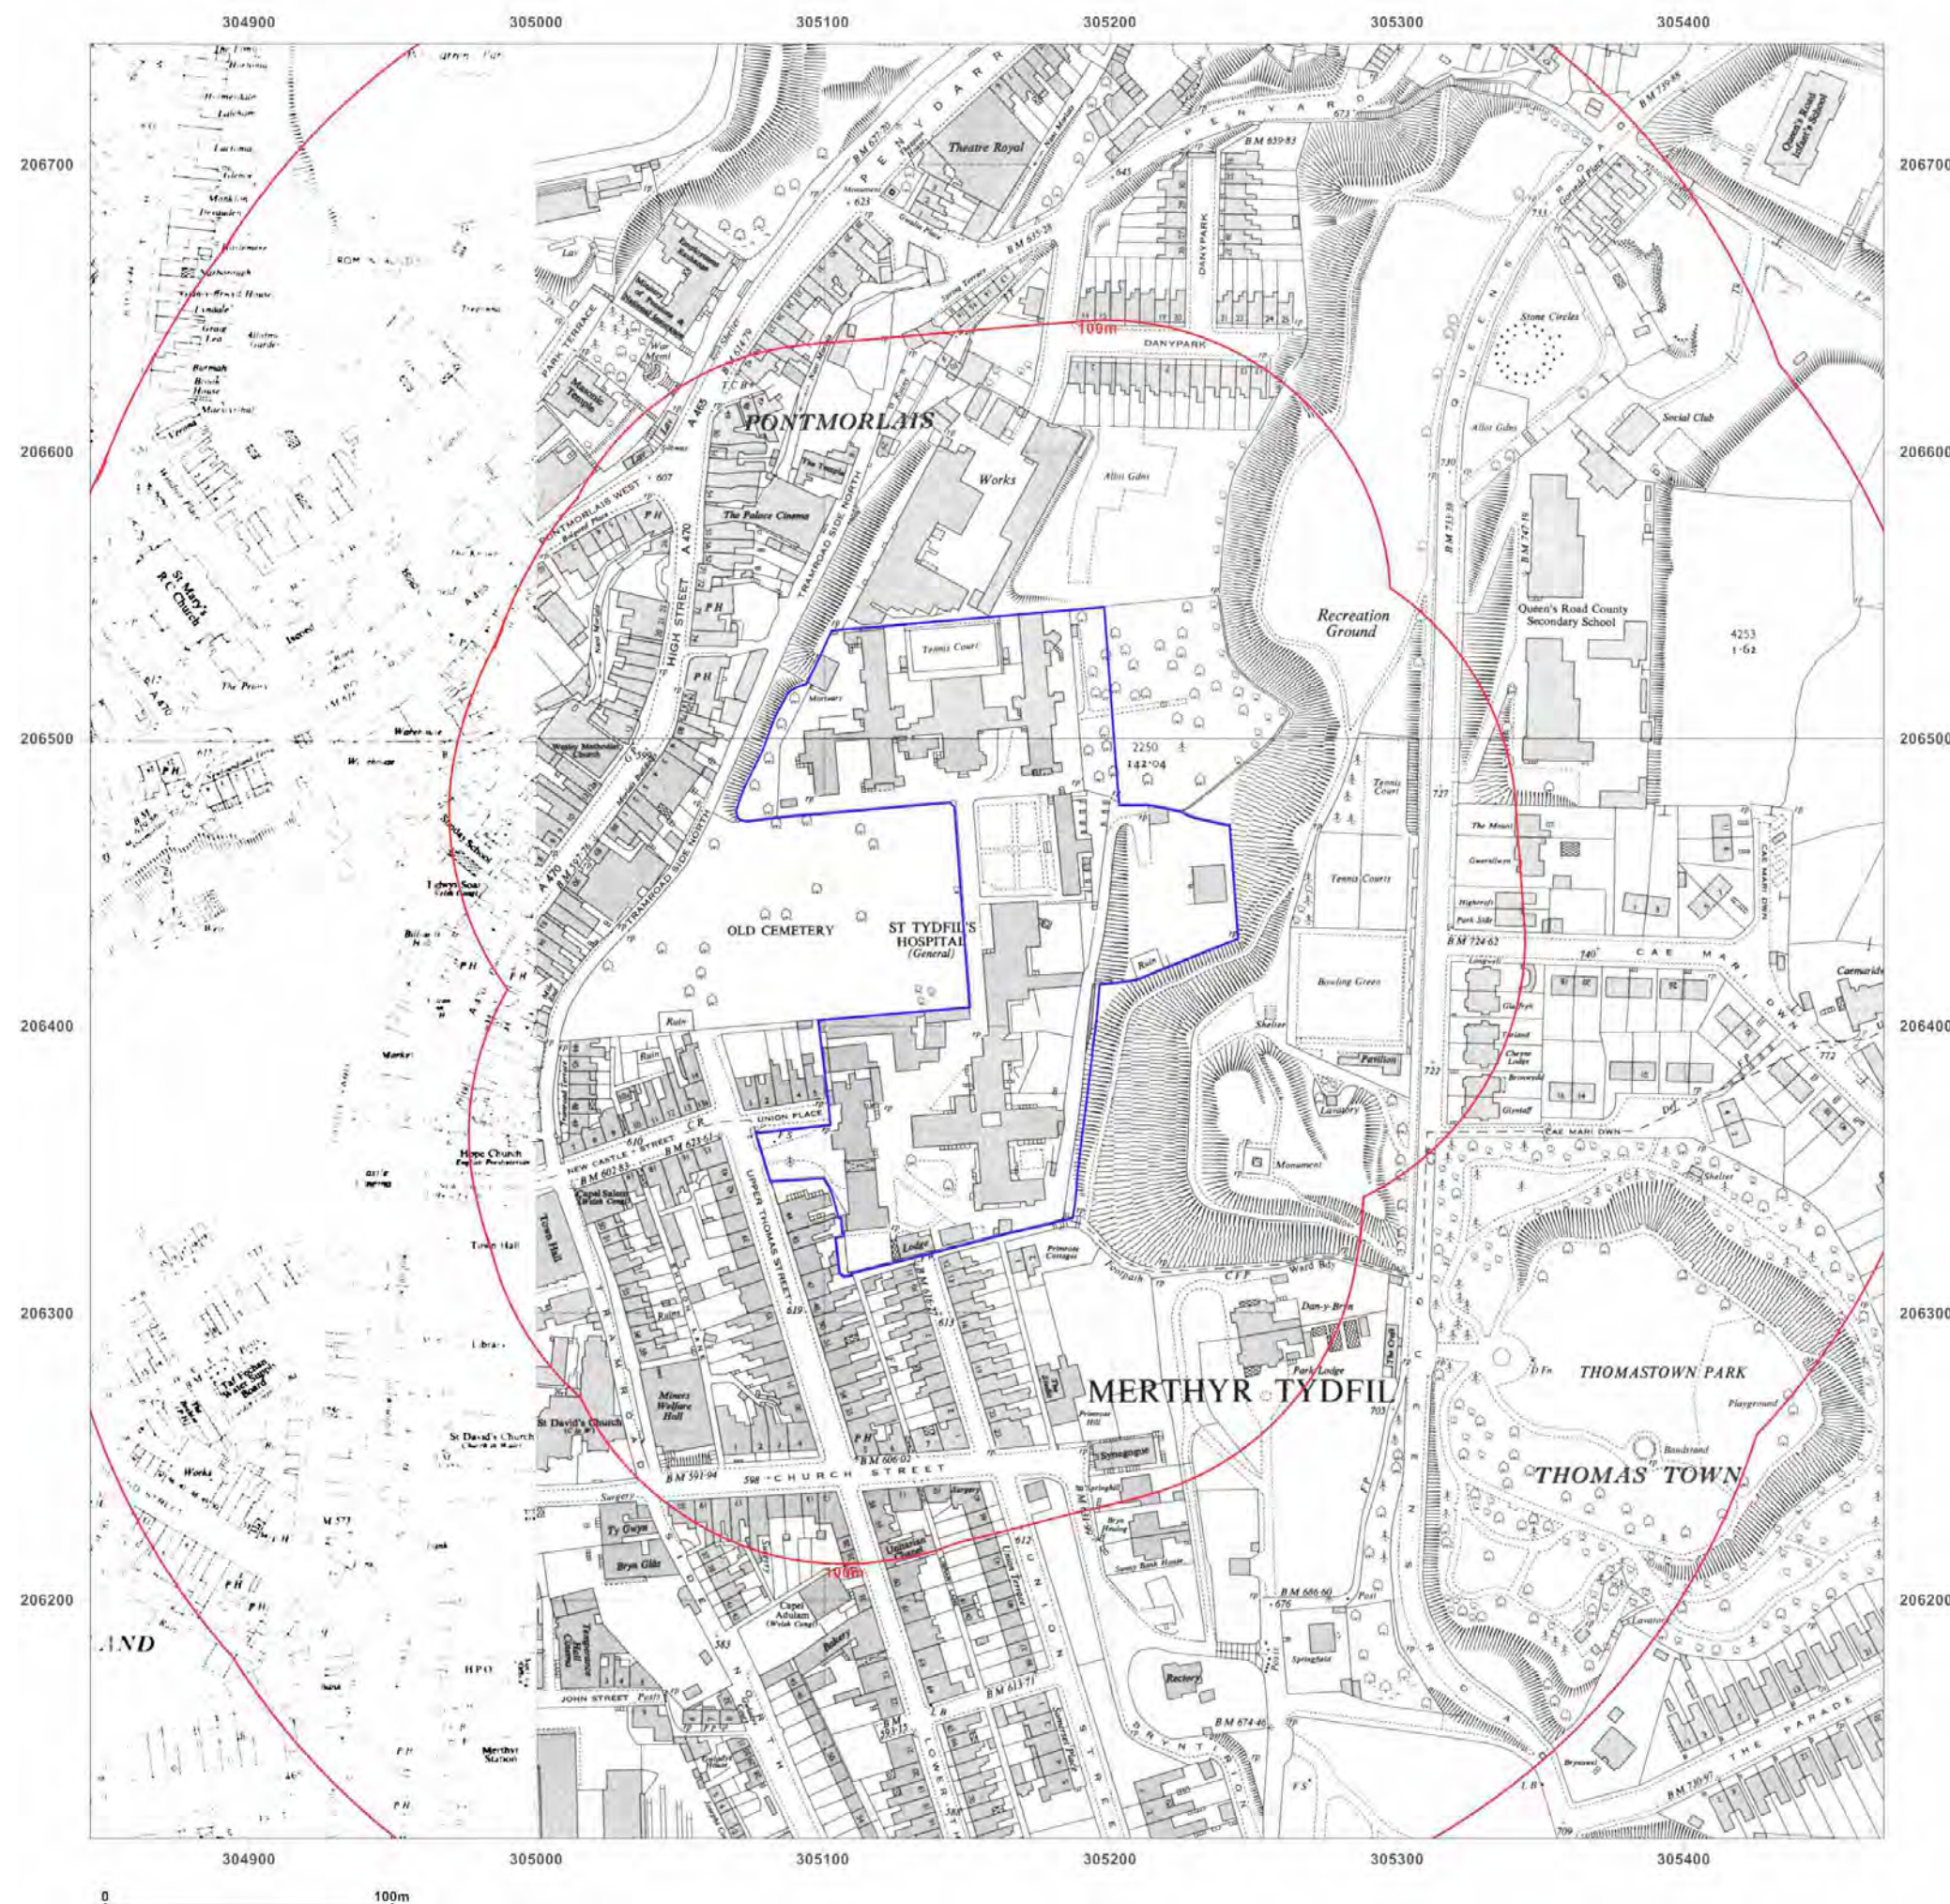

Site Details:

MERTHYR TYDFIL, CF47 0BL

Client Ref: 19-S715-TPC-21988

Report Ref: HMD-154-6127015

Grid Ref: 305157, 206430

Map Name: National Grid

Map date: 1975

Scale: 1:1,250

Printed at: 1:2,000



Surveyed N/A
Revised N/A
Edition N/A
Copyright N/A
Levelled N/A

Surveyed N/A
Revised N/A
Edition N/A
Copyright N/A
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 26 June 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

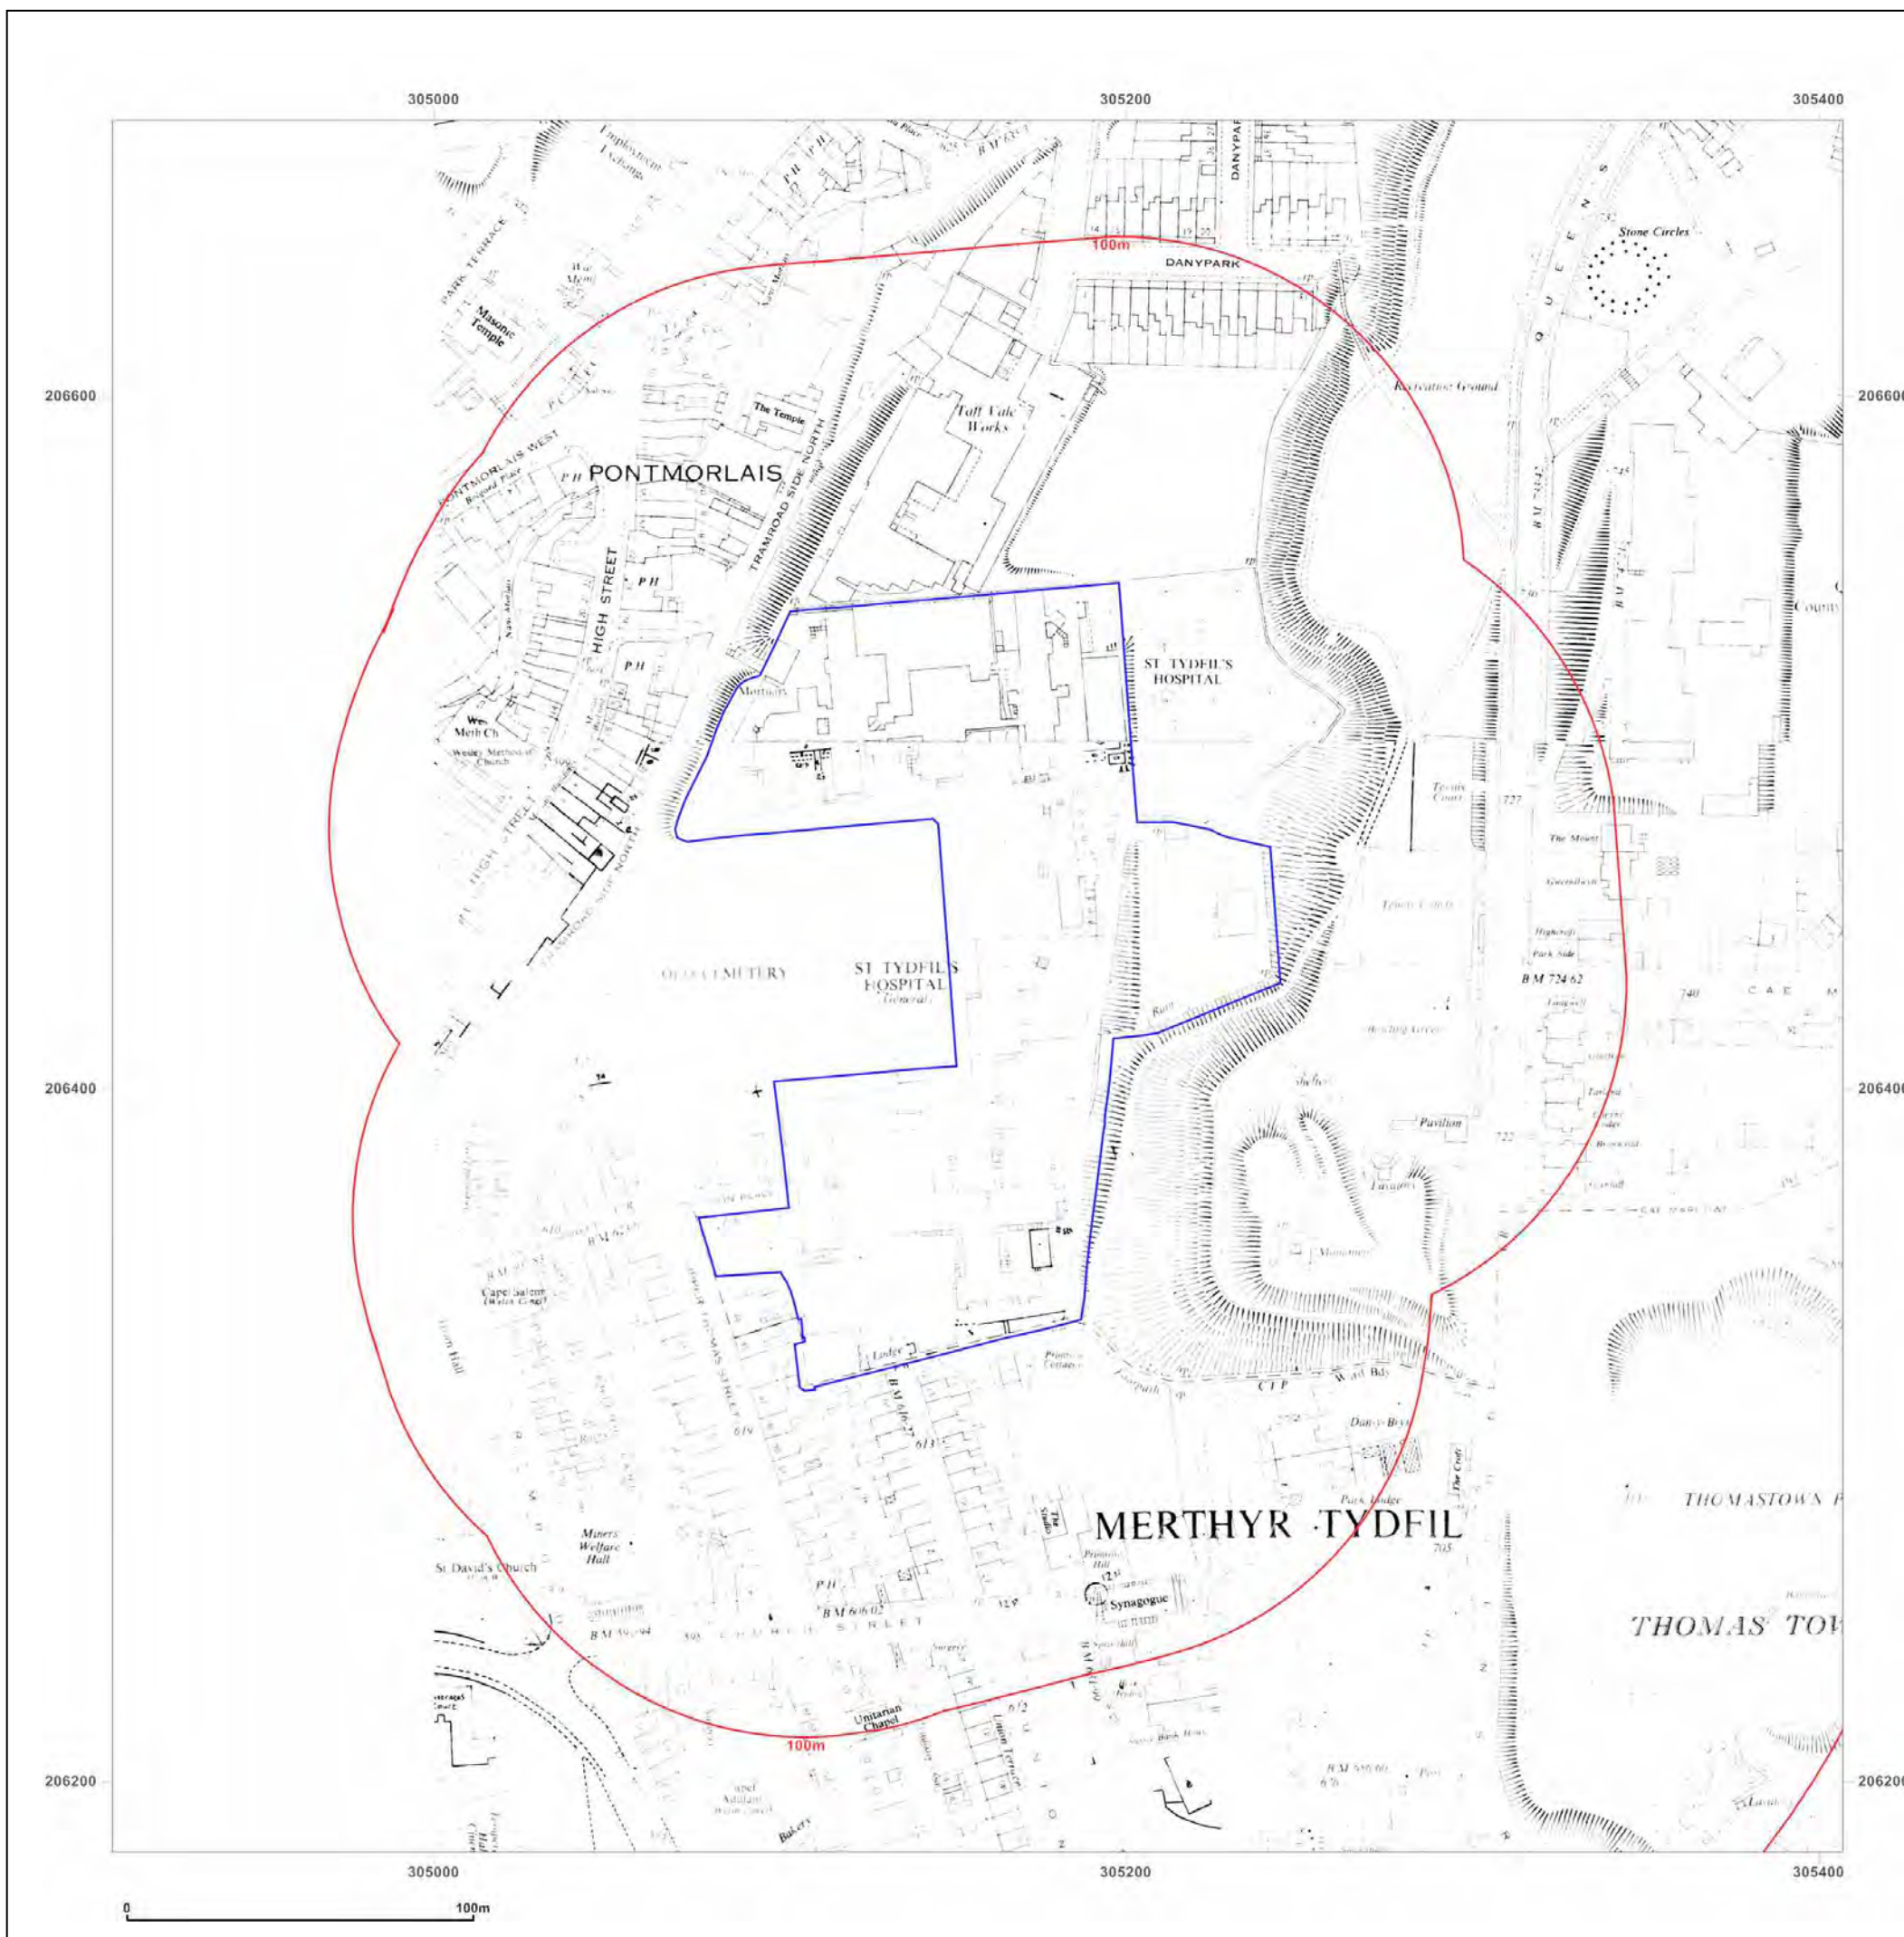

Site Details:

MERTHYR TYDFIL, CF47 0BL

Client Ref: 19-S715-TPC-21988
Report Ref: HMD-154-6127015
Grid Ref: 305157, 206430

Map Name: National Grid

Map date: 1977-1982

Scale: 1:1,250

Printed at: 1:2,000



Surveyed N/A
Revised N/A
Edition N/A
Copyright 1982
Levelled 1958

Surveyed 1957
Revised 1976
Edition N/A
Copyright 1977
Levelled 1959




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 26 June 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

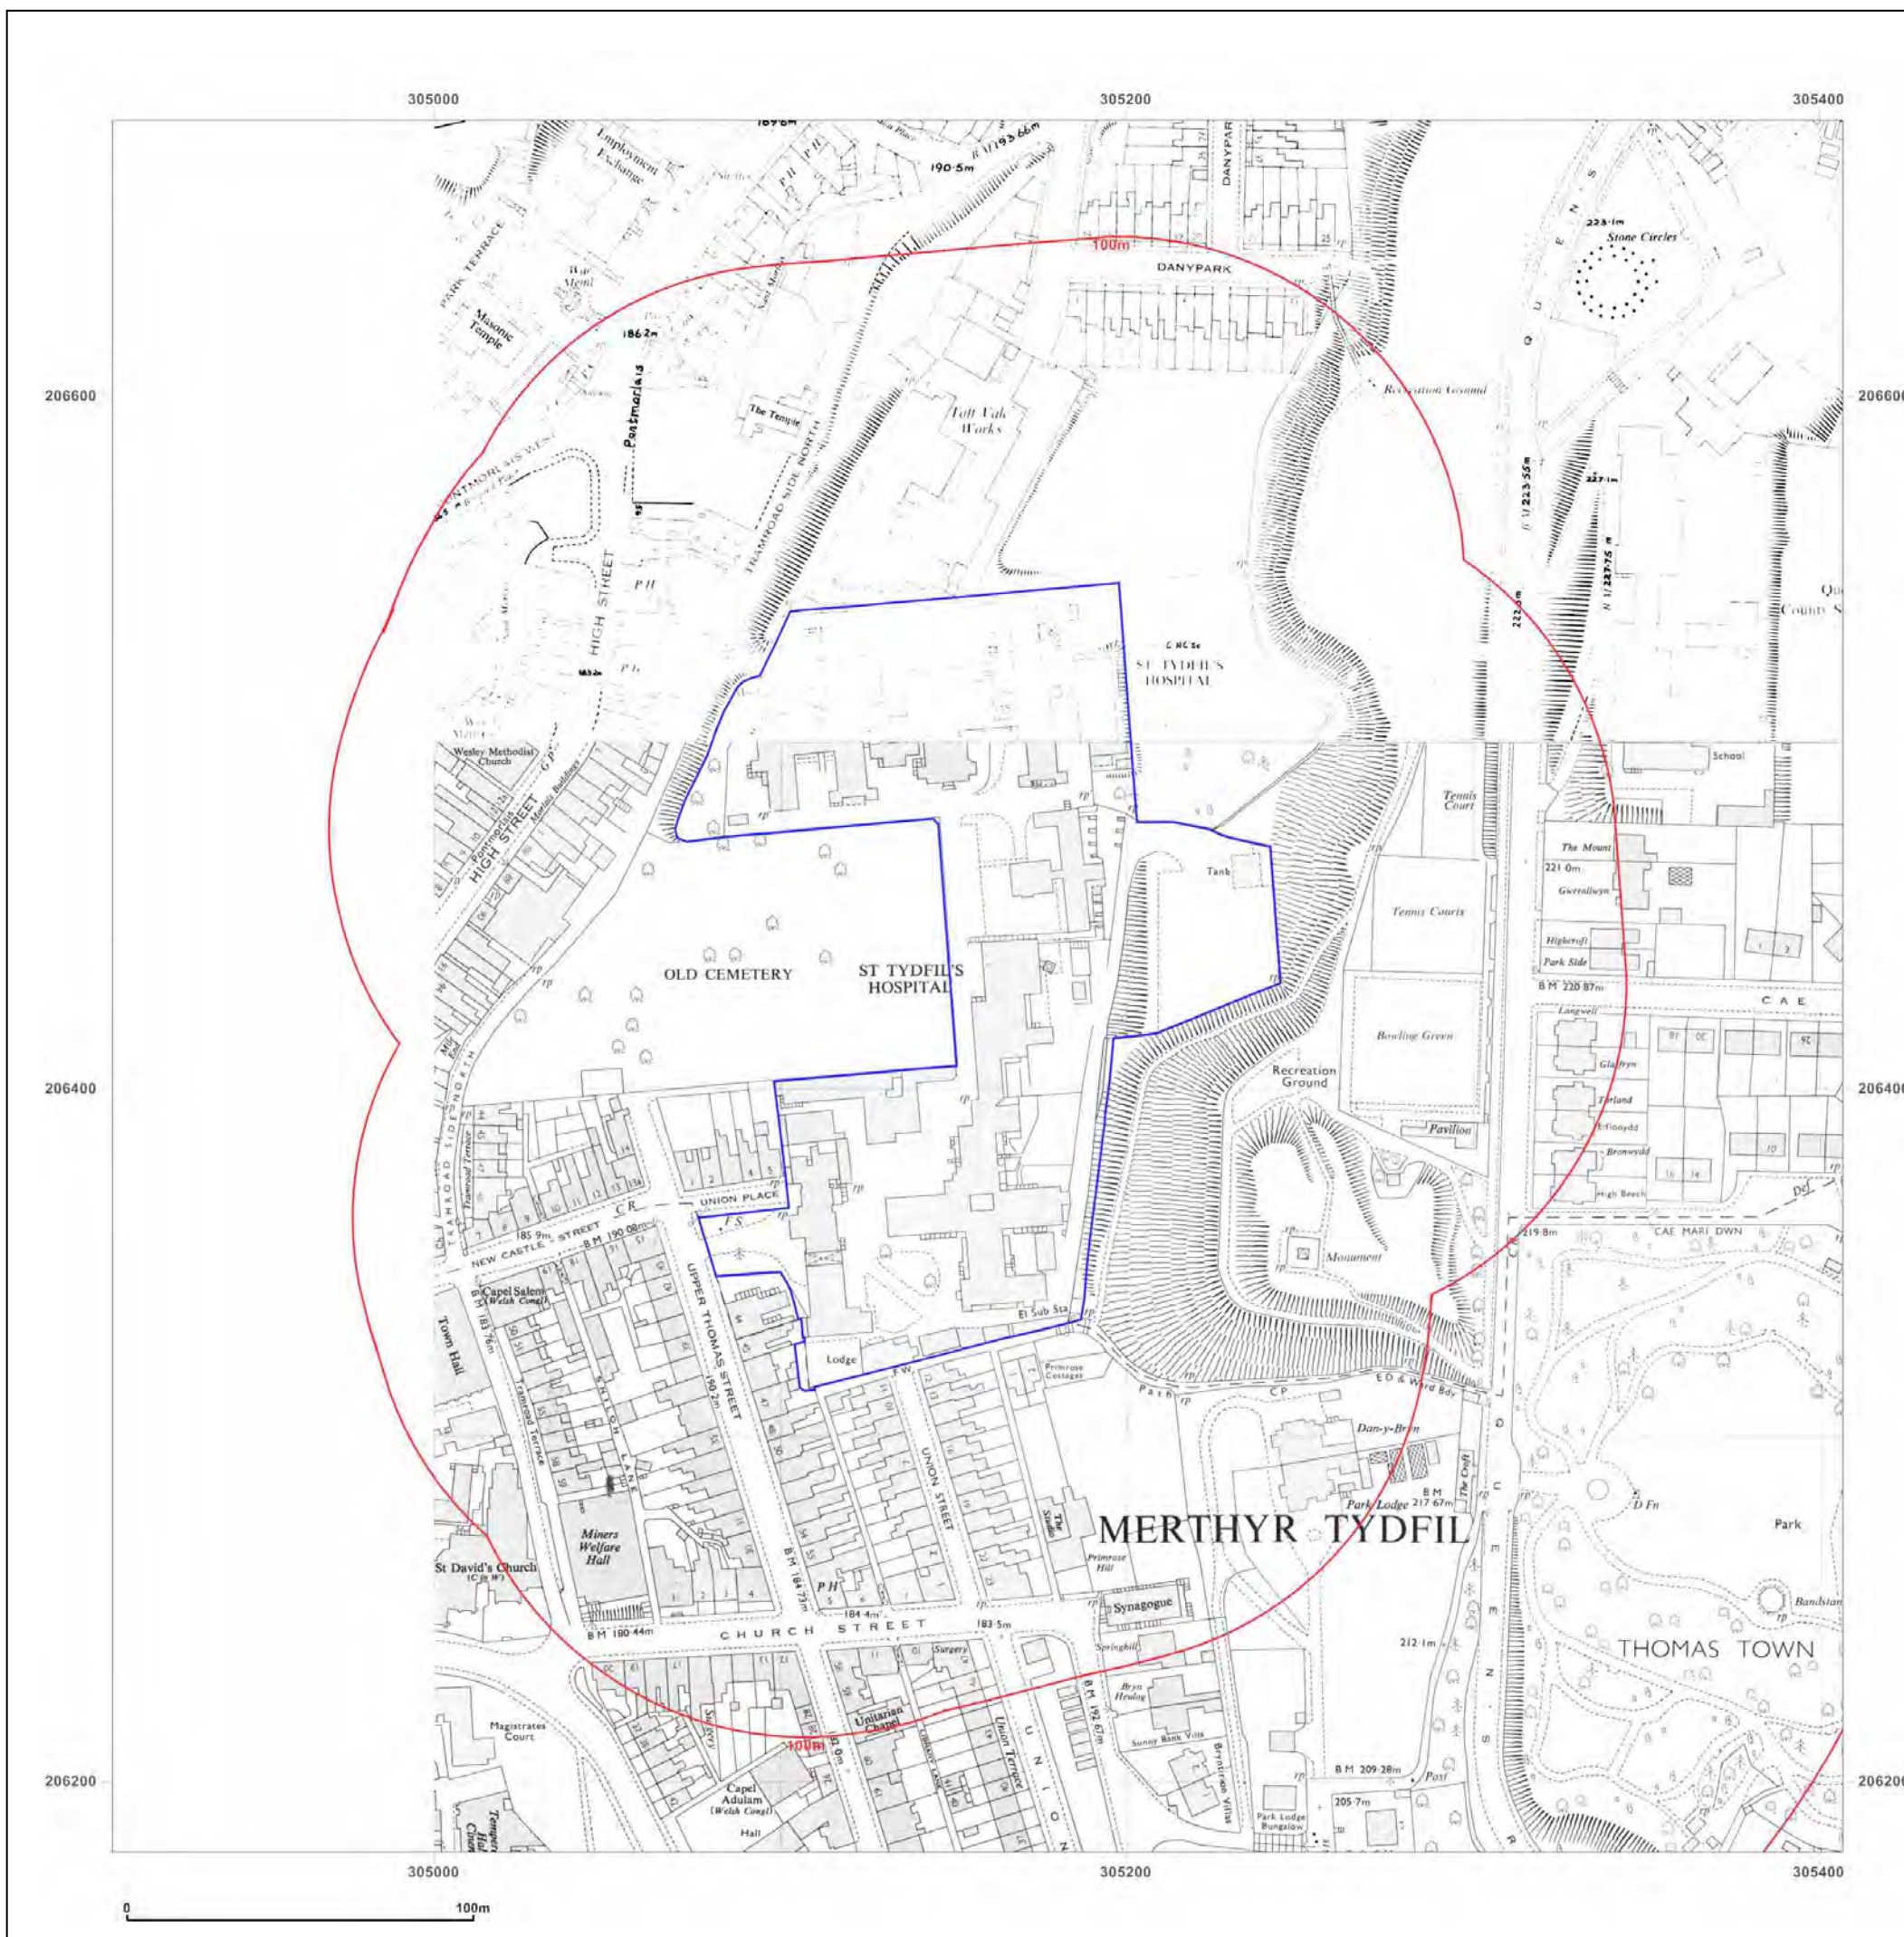

Site Details:

MERTHYR TYDFIL, CF47 0BL

Client Ref: 19-S715-TPC-21988
Report Ref: HMD-154-6127015
Grid Ref: 305157, 206430

Map Name: National Grid

Map date: 1984-1989

Scale: 1:1,250

Printed at: 1:2,000



Surveyed N/A
 Revised N/A
 Edition N/A
 Copyright 1988
 Levelled 1969

Surveyed 1958
 Revised 1987
 Edition N/A
 Copyright 1987
 Levelled 1958

Surveyed 1964
 Revised 1984
 Edition N/A
 Copyright 1984
 Levelled 1964

Surveyed 1959
 Revised 1989
 Edition N/A
 Copyright 1989
 Levelled 1959




Produced by
 Groundsure Insights
 T: 08444 159000
 E: info@groundsure.com
 W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 26 June 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

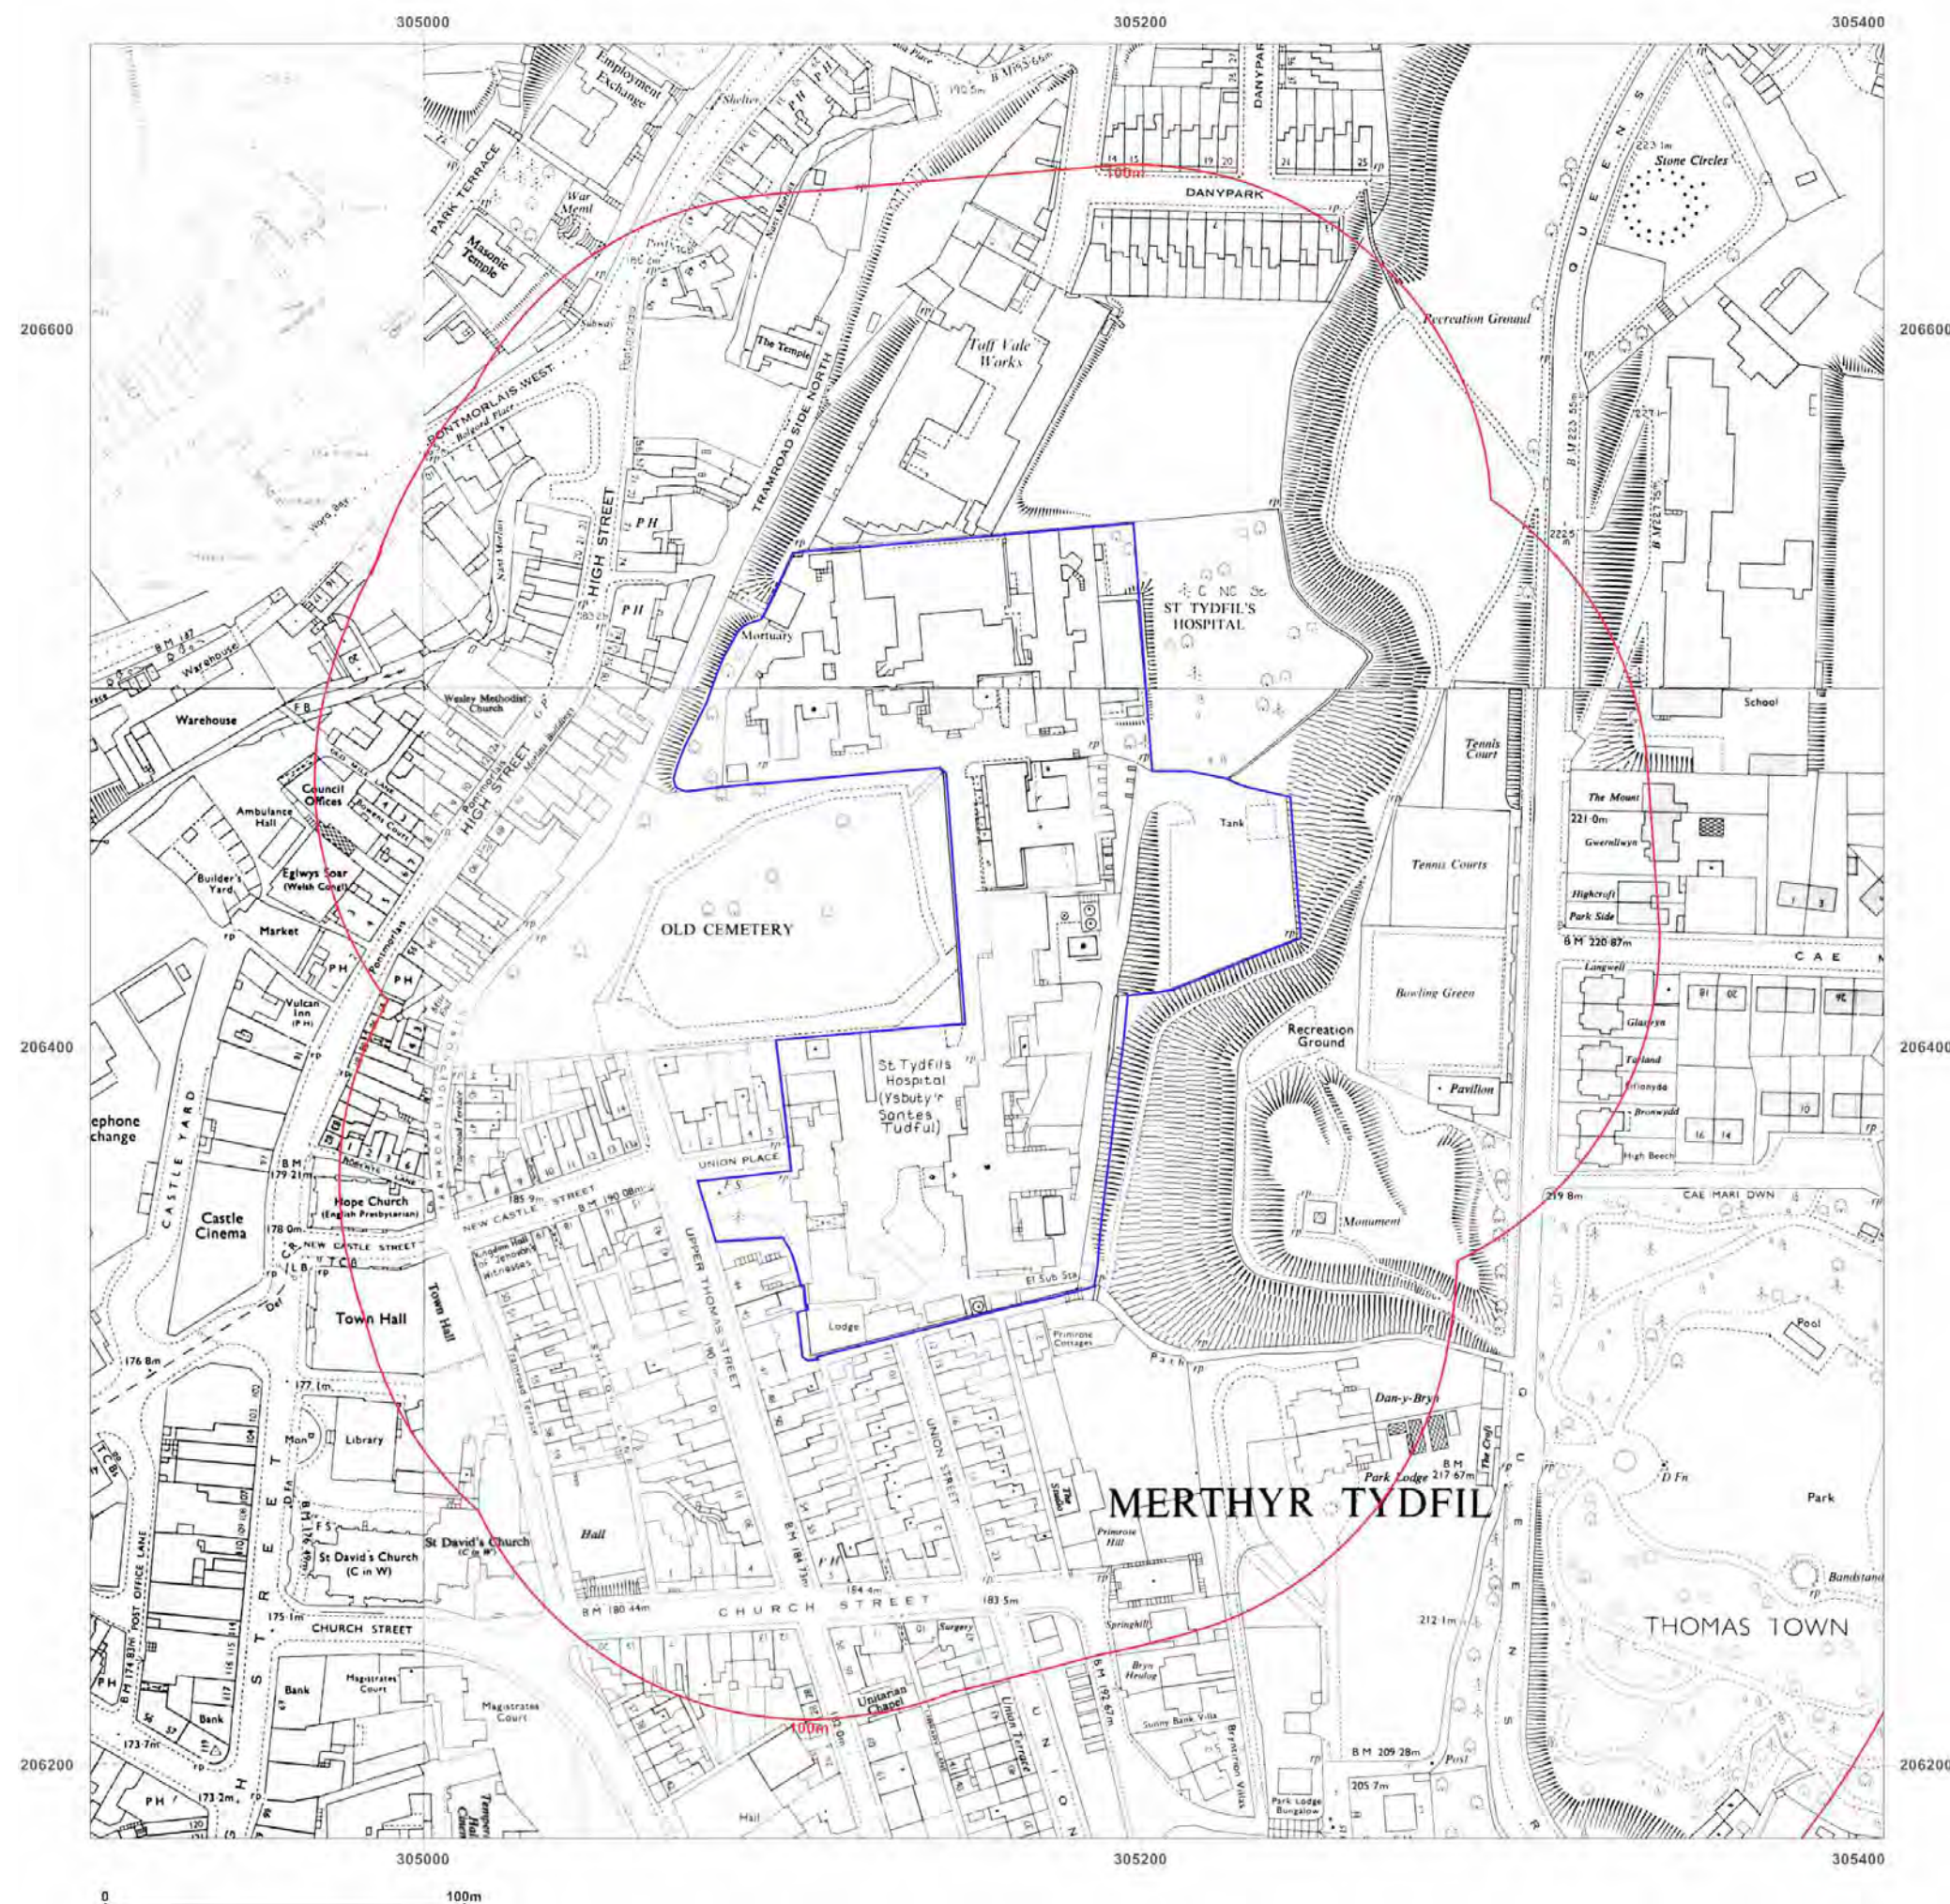

Site Details:

MERTHYR TYDFIL, CF47 0BL

Client Ref: 19-S715-TPC-21988
Report Ref: HMD-154-6127015
Grid Ref: 305157, 206430

Map Name: National Grid

Map date: 1989-1990

Scale: 1:1,250

Printed at: 1:2,000



Surveyed 1964
Revised 1990
Edition N/A
Copyright 1990
Levelled 1964

Surveyed N/A
Revised 1989
Edition N/A
Copyright 1989
Levelled N/A

Surveyed 1964
Revised 1989
Edition N/A
Copyright 1989
Levelled 1964

Surveyed N/A
Revised N/A
Edition N/A
Copyright N/A
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 26 June 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

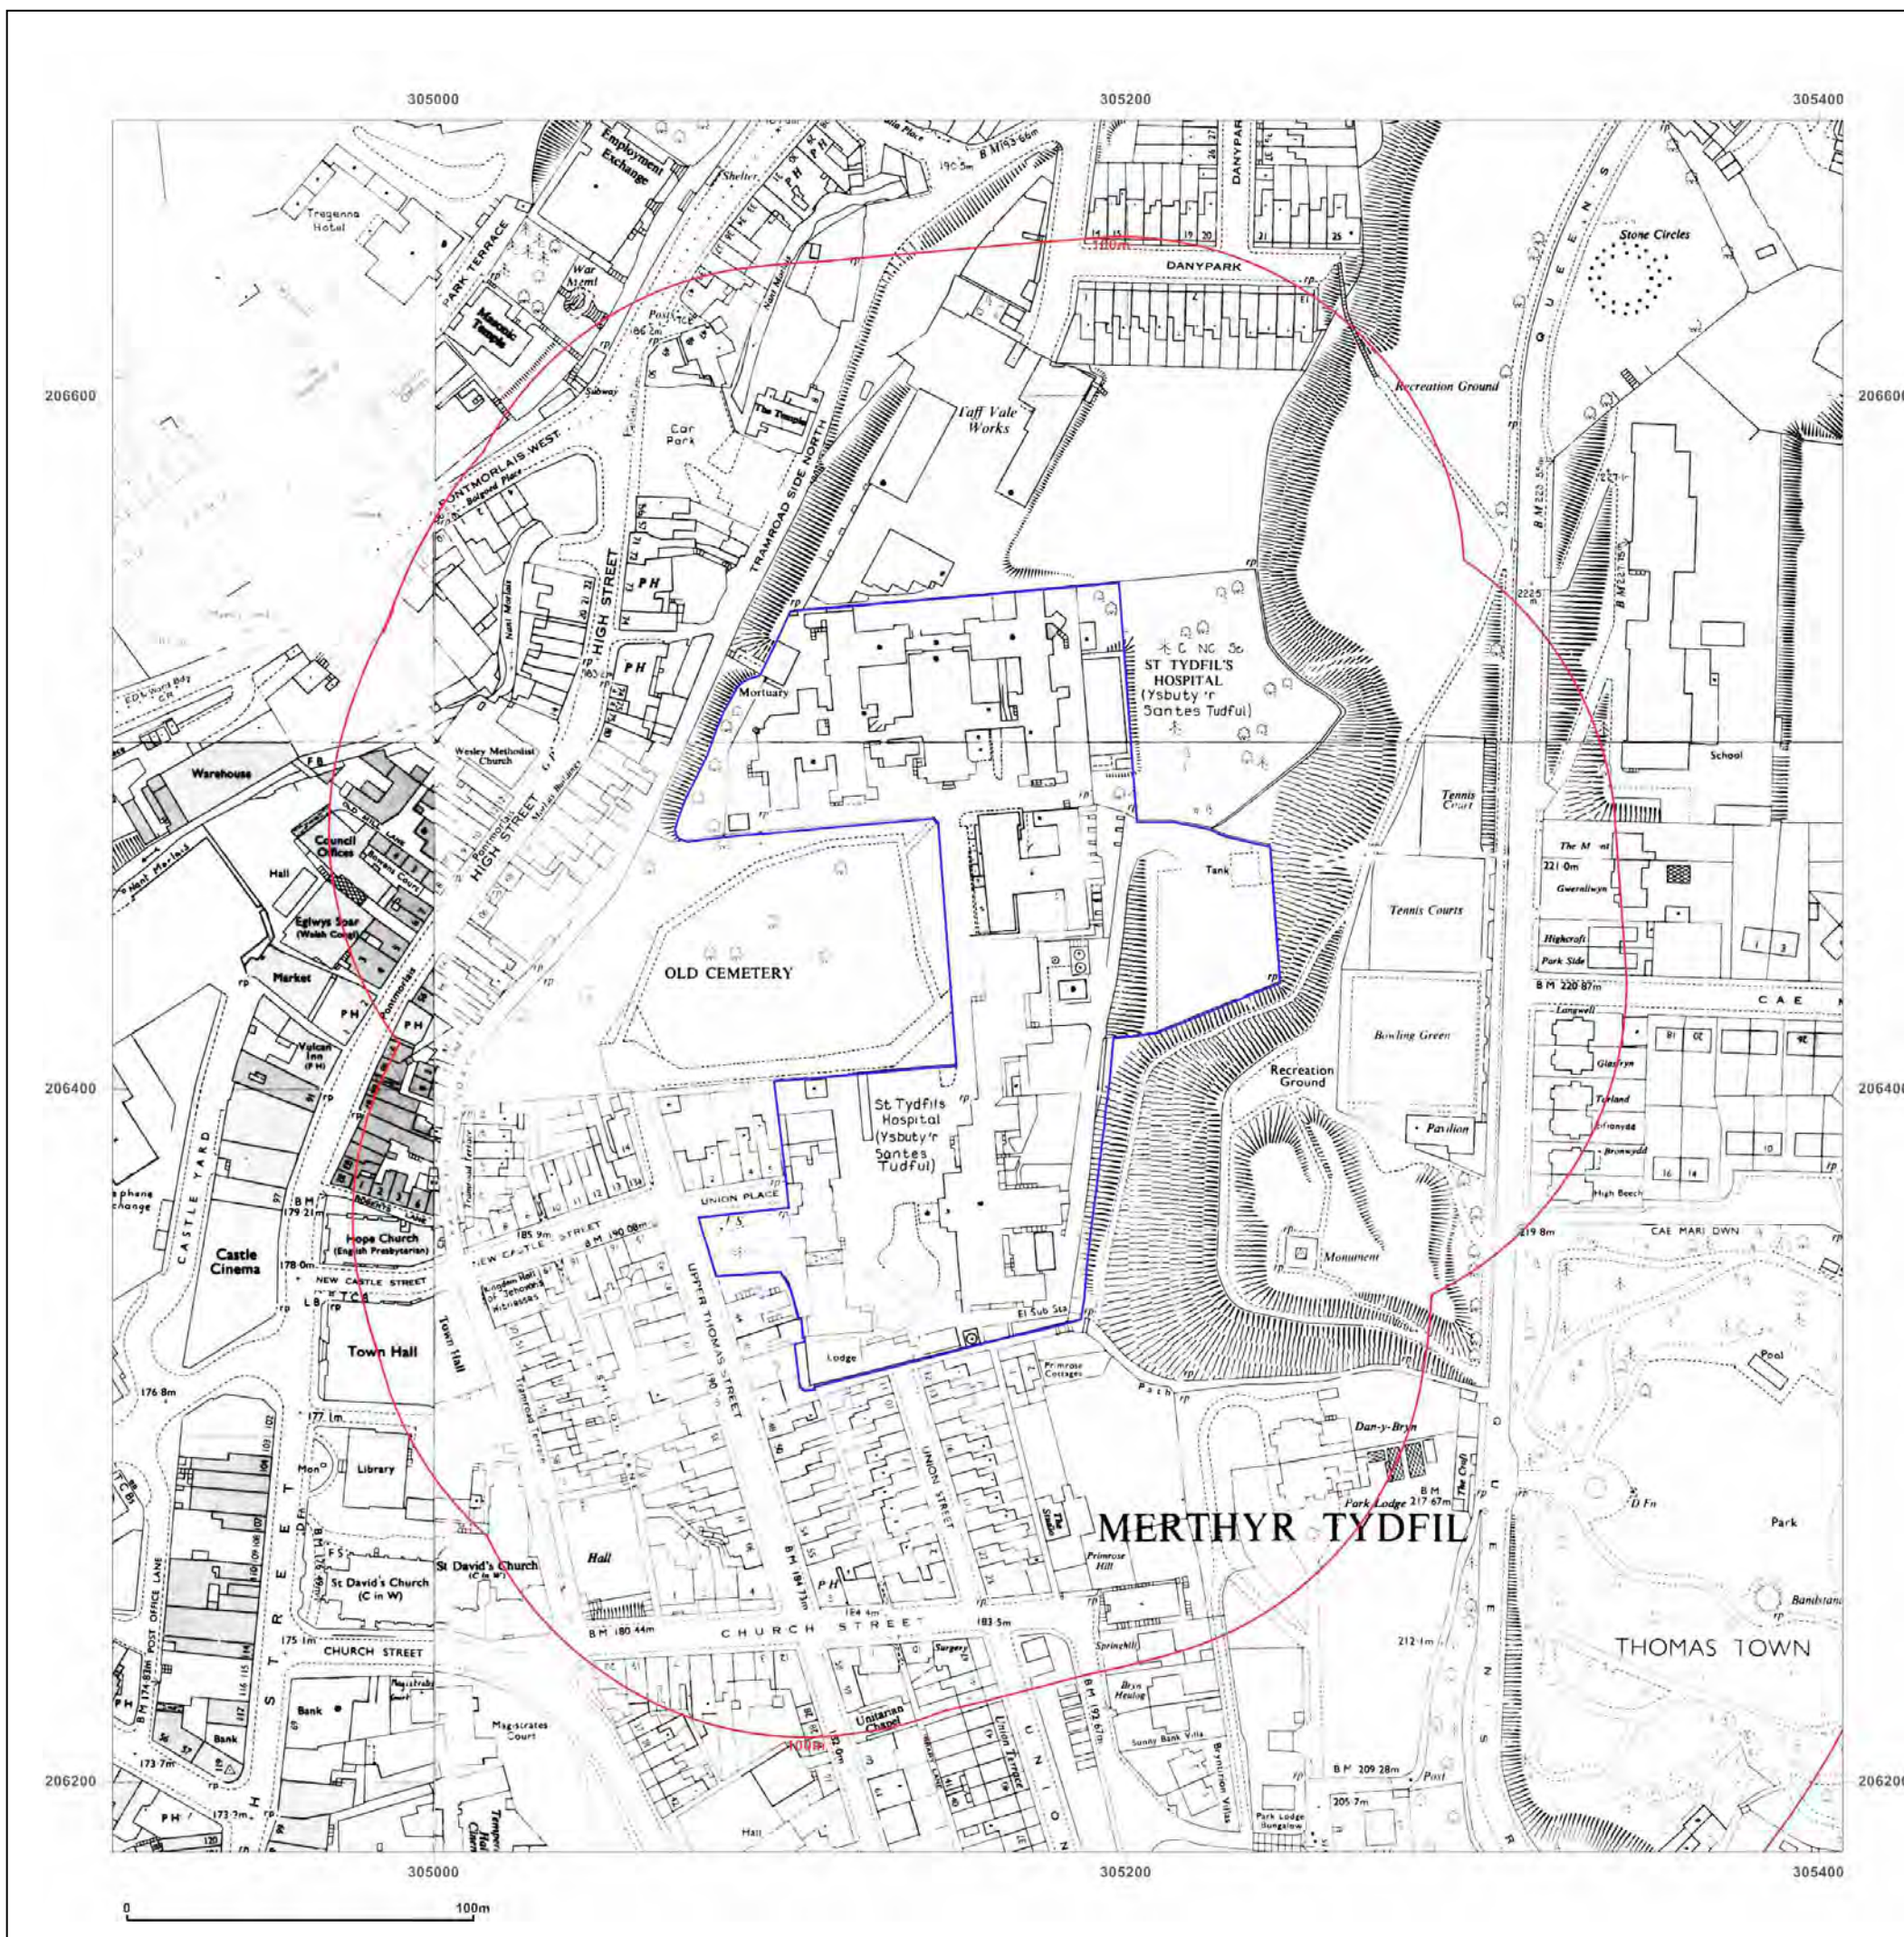

Site Details:

MERTHYR TYDFIL, CF47 0BL

Client Ref: 19-S715-TPC-21988
Report Ref: HMD-154-6127015
Grid Ref: 305157, 206430

Map Name: National Grid

Map date: 1989-1993

Scale: 1:1,250

Printed at: 1:2,000



Surveyed 1954
Revised 1990
Edition N/A
Copyright 1990
Levelled 1954

Surveyed 1958
Revised 1989
Edition N/A
Copyright 1989
Levelled 1958

Surveyed 1964
Revised 1989
Edition N/A
Copyright 1989
Levelled 1964

Surveyed N/A
Revised N/A
Edition N/A
Copyright 1993
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 26 June 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

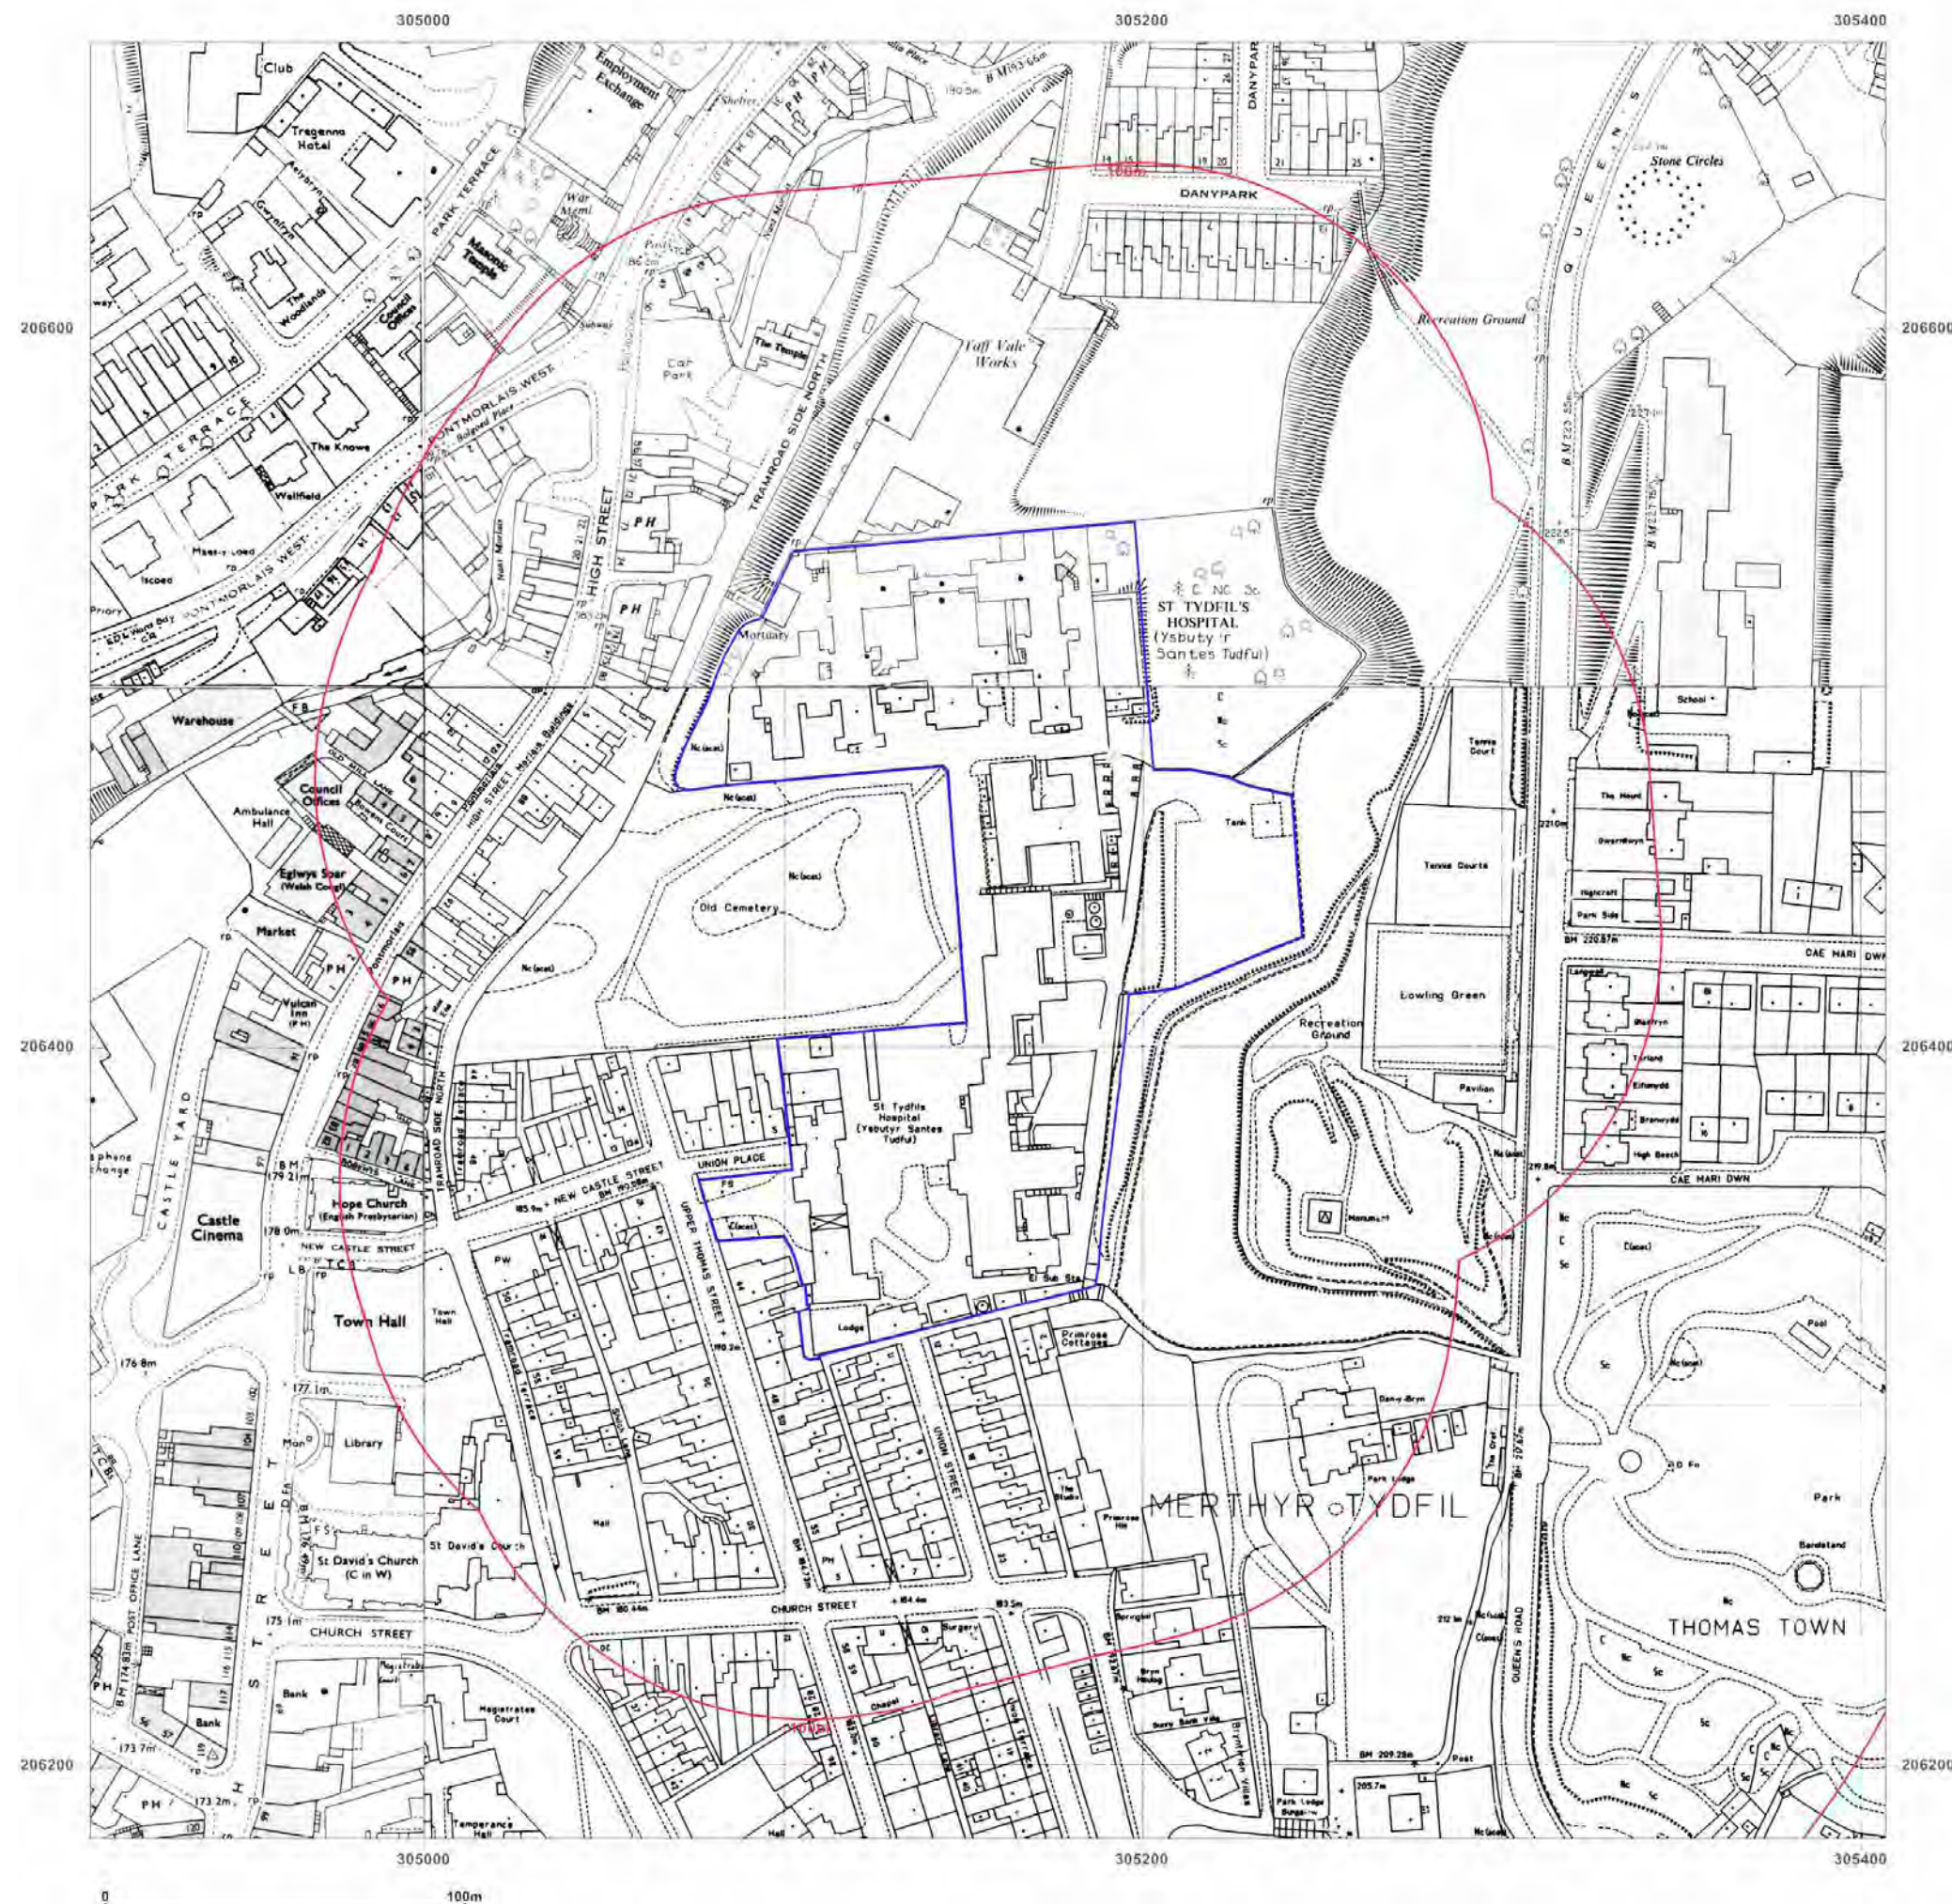

Site Details:

MERTHYR TYDFIL, CF47 0BL

Client Ref: 19-S715-TPC-21988
Report Ref: HMD-154-6127015
Grid Ref: 305157, 206430

Map Name: National Grid

Map date: 1989-1993

Scale: 1:1,250

Printed at: 1:2,000



Surveyed N/A
 Revised N/A
 Edition N/A
 Copyright 1993
 Levelled N/A

Surveyed N/A
 Revised N/A
 Edition N/A
 Copyright 1993
 Levelled N/A

Surveyed 1964
 Revised 1989
 Edition N/A
 Copyright 1989
 Levelled 1964



Produced by
 Groundsure Insights
 T: 08444 159000
 E: info@groundsure.com
 W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 26 June 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf



Site Details:

MERTHYR TYDFIL, CF47 0BL

Client Ref: 19-S715-TPC-21988

Report Ref: HMD-154-6127015

Grid Ref: 305157, 206430

Map Name: National Grid

Map date: 1993-1995

Scale: 1:1,250

Printed at: 1:2,000



Surveyed 1995
Revised 1995
Edition N/A
Copyright 1995
Levelled N/A

Surveyed N/A
Revised N/A
Edition N/A
Copyright 1993
Levelled N/A



Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 26 June 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf



Site Details:

MERTHYR TYDFIL, CF47 0BL

Client Ref: 19-S715-TPC-21988
Report Ref: HMD-154-6127015
Grid Ref: 305157, 206430

Map Name: County Series

Map date: 1875

Scale: 1:10,560

Printed at: 1:10,560



Surveyed 1875
Revised 1875
Edition N/A
Copyright N/A
Levelled N/A

Surveyed 1875
Revised 1875
Edition N/A
Copyright N/A
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 26 June 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

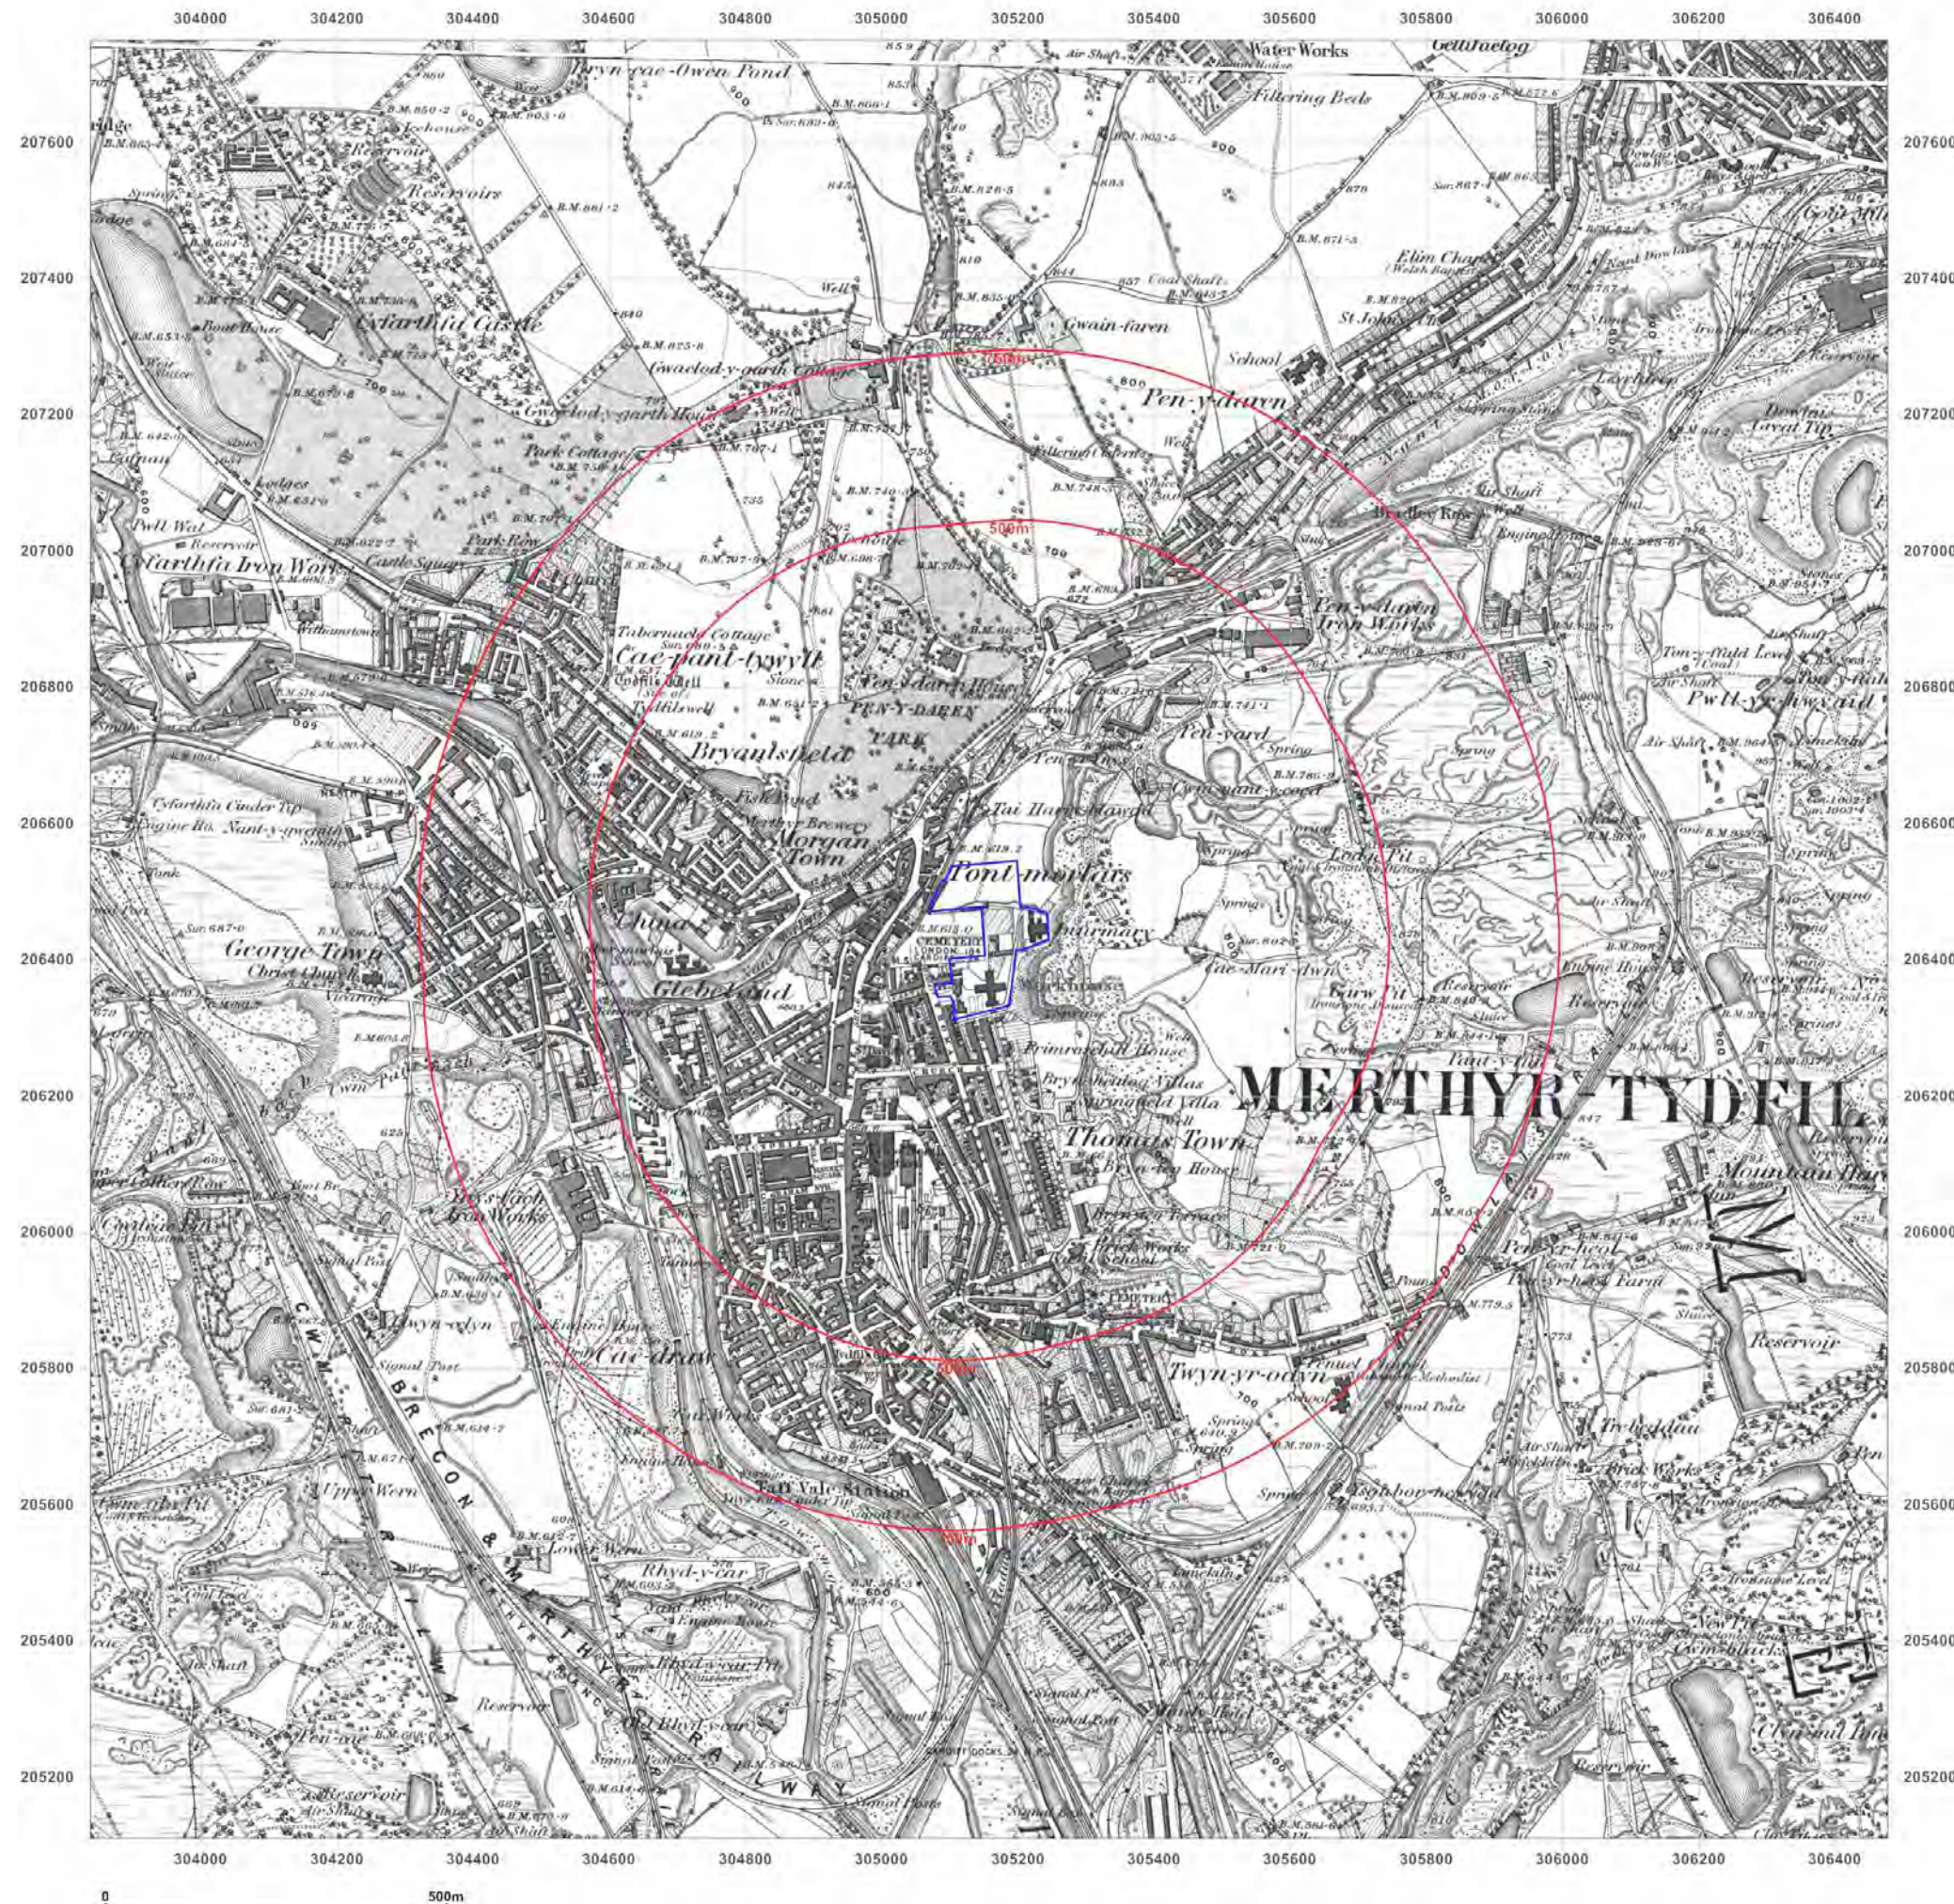

Site Details:

MERTHYR TYDFIL, CF47 0BL

Client Ref: 19-S715-TPC-21988
Report Ref: HMD-154-6127015
Grid Ref: 305157, 206430

Map Name: County Series

Map date: 1901

Scale: 1:10,560

Printed at: 1:10,560



Surveyed 1885
Revised 1901
Edition N/A
Copyright N/A
Levelled N/A

Surveyed 1884
Revised 1901
Edition N/A
Copyright N/A
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 26 June 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

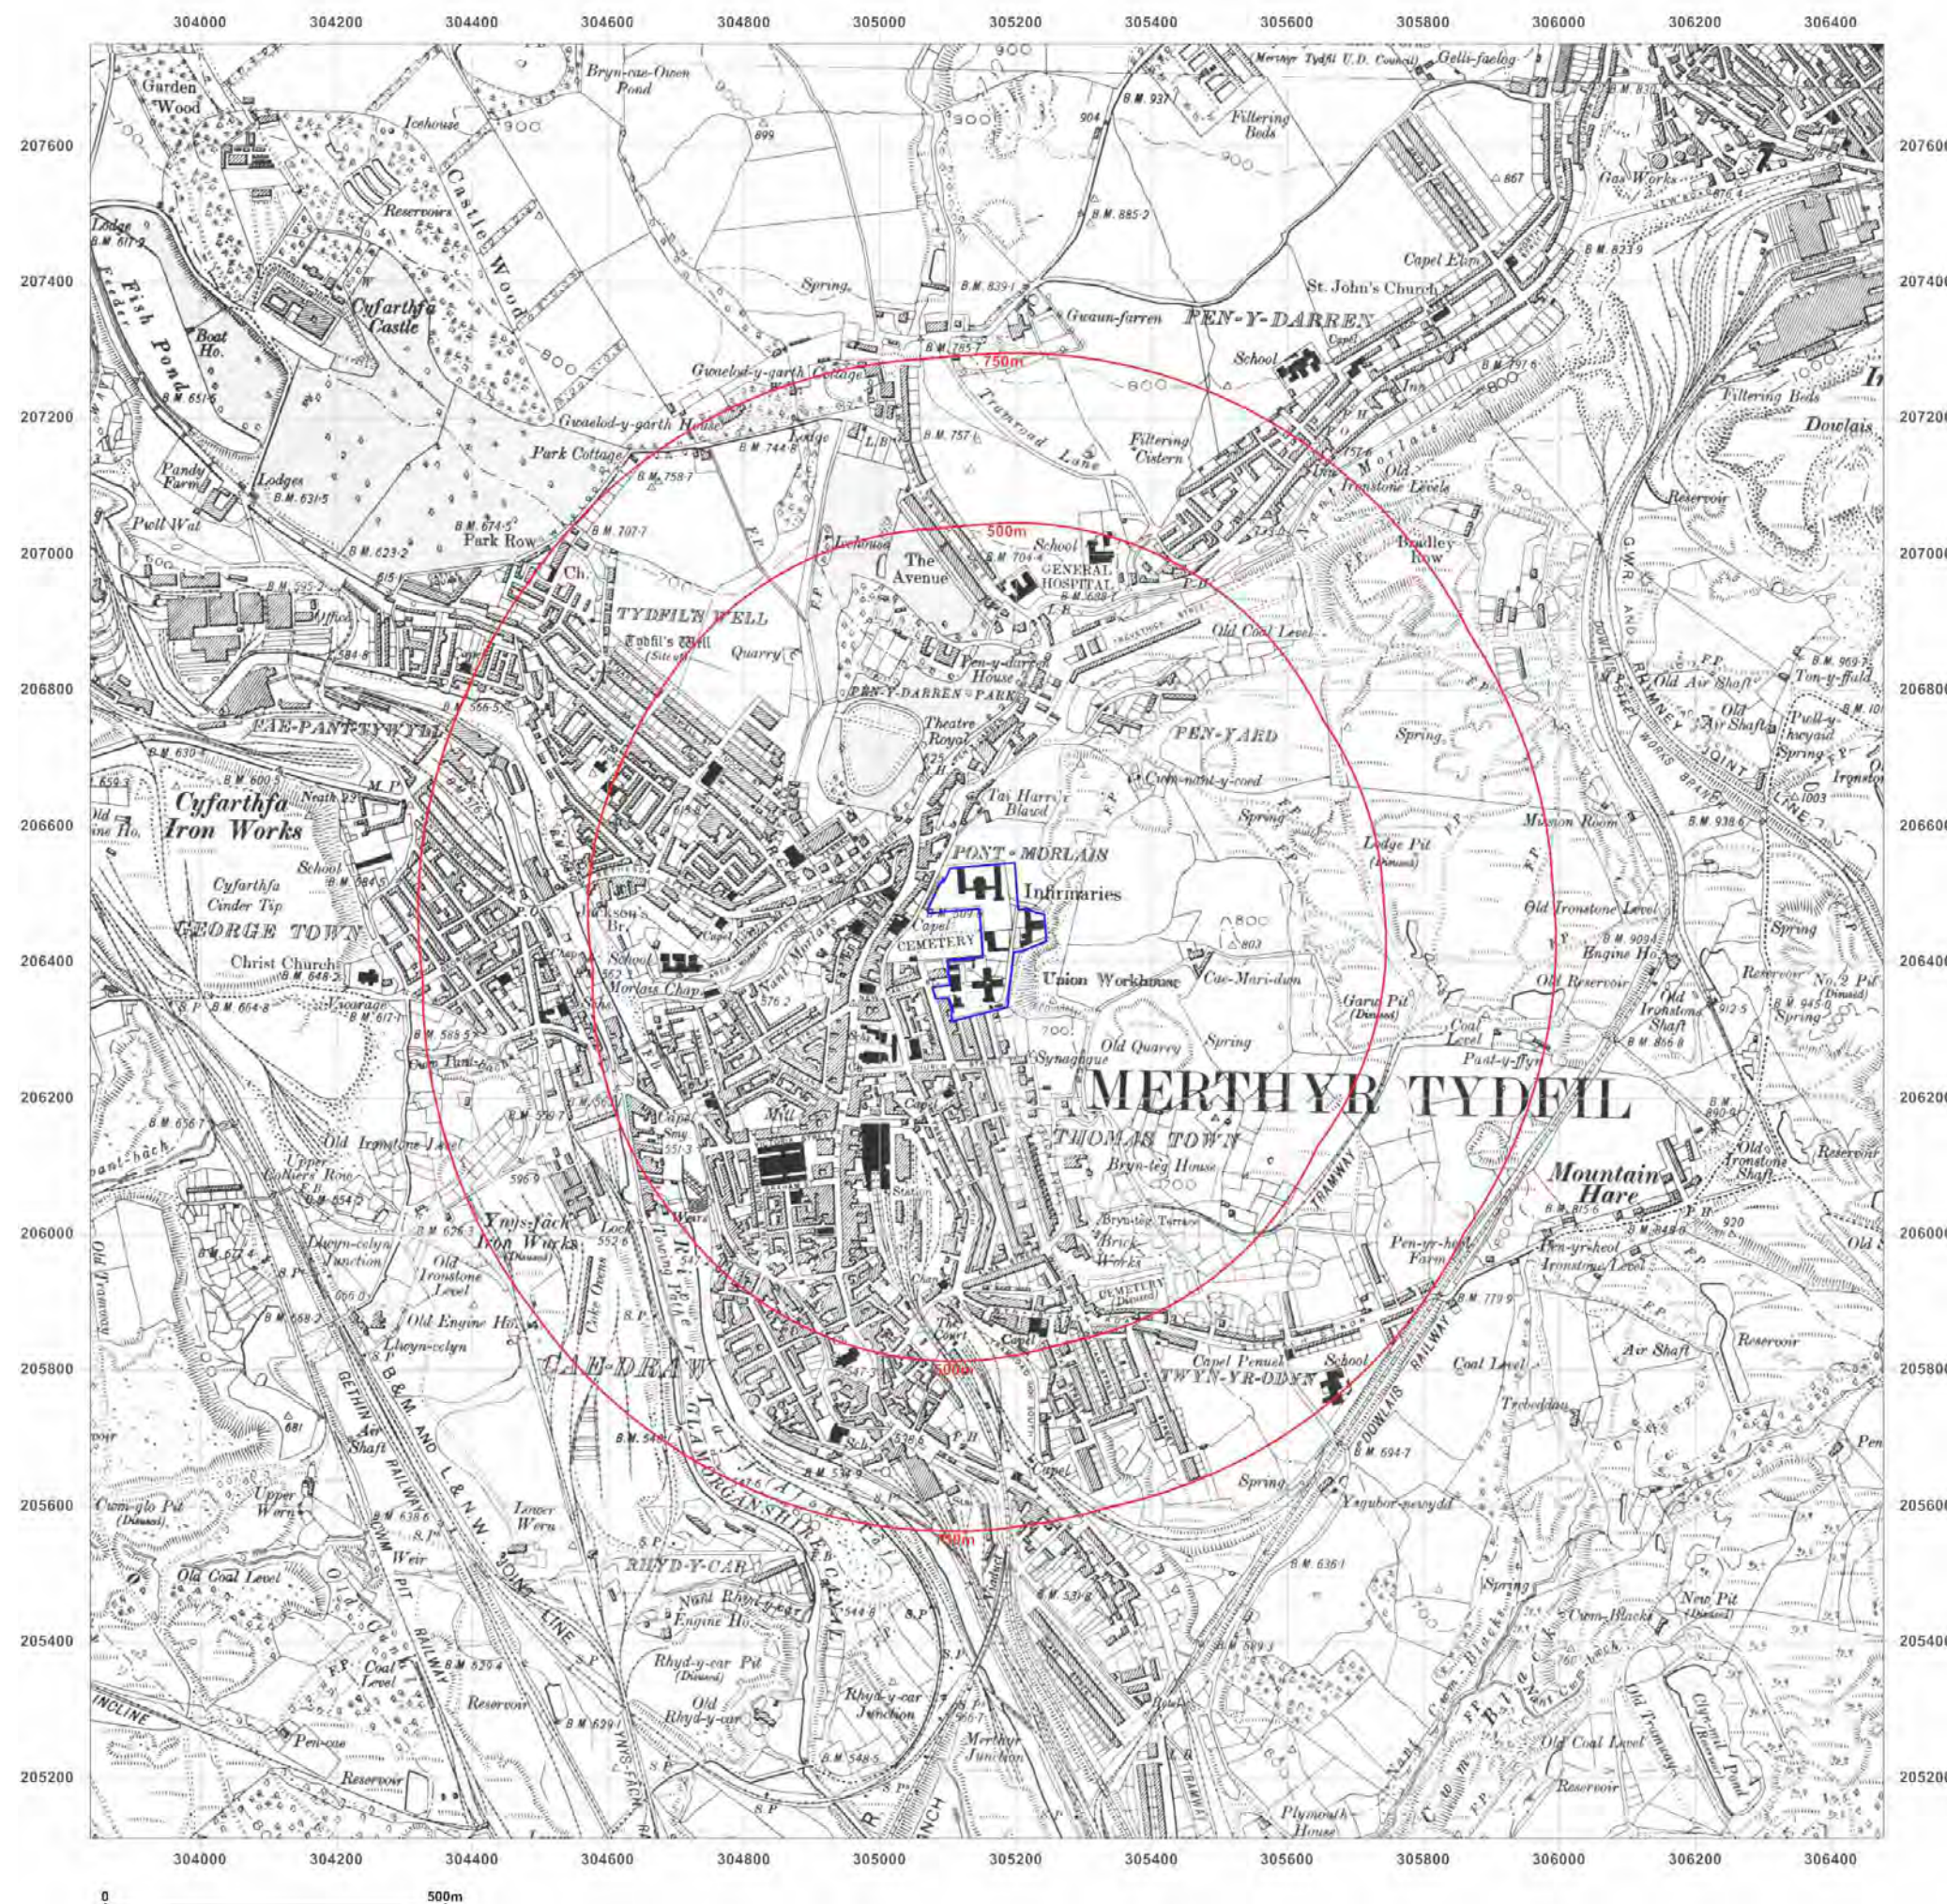

Site Details:

MERTHYR TYDFIL, CF47 0BL

Client Ref: 19-S715-TPC-21988

Report Ref: HMD-154-6127015

Grid Ref: 305157, 206430

Map Name: County Series

Map date: 1903

Scale: 1:10,560

Printed at: 1:10,560



Surveyed 1884
Revised 1903
Edition N/A
Copyright N/A
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 26 June 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

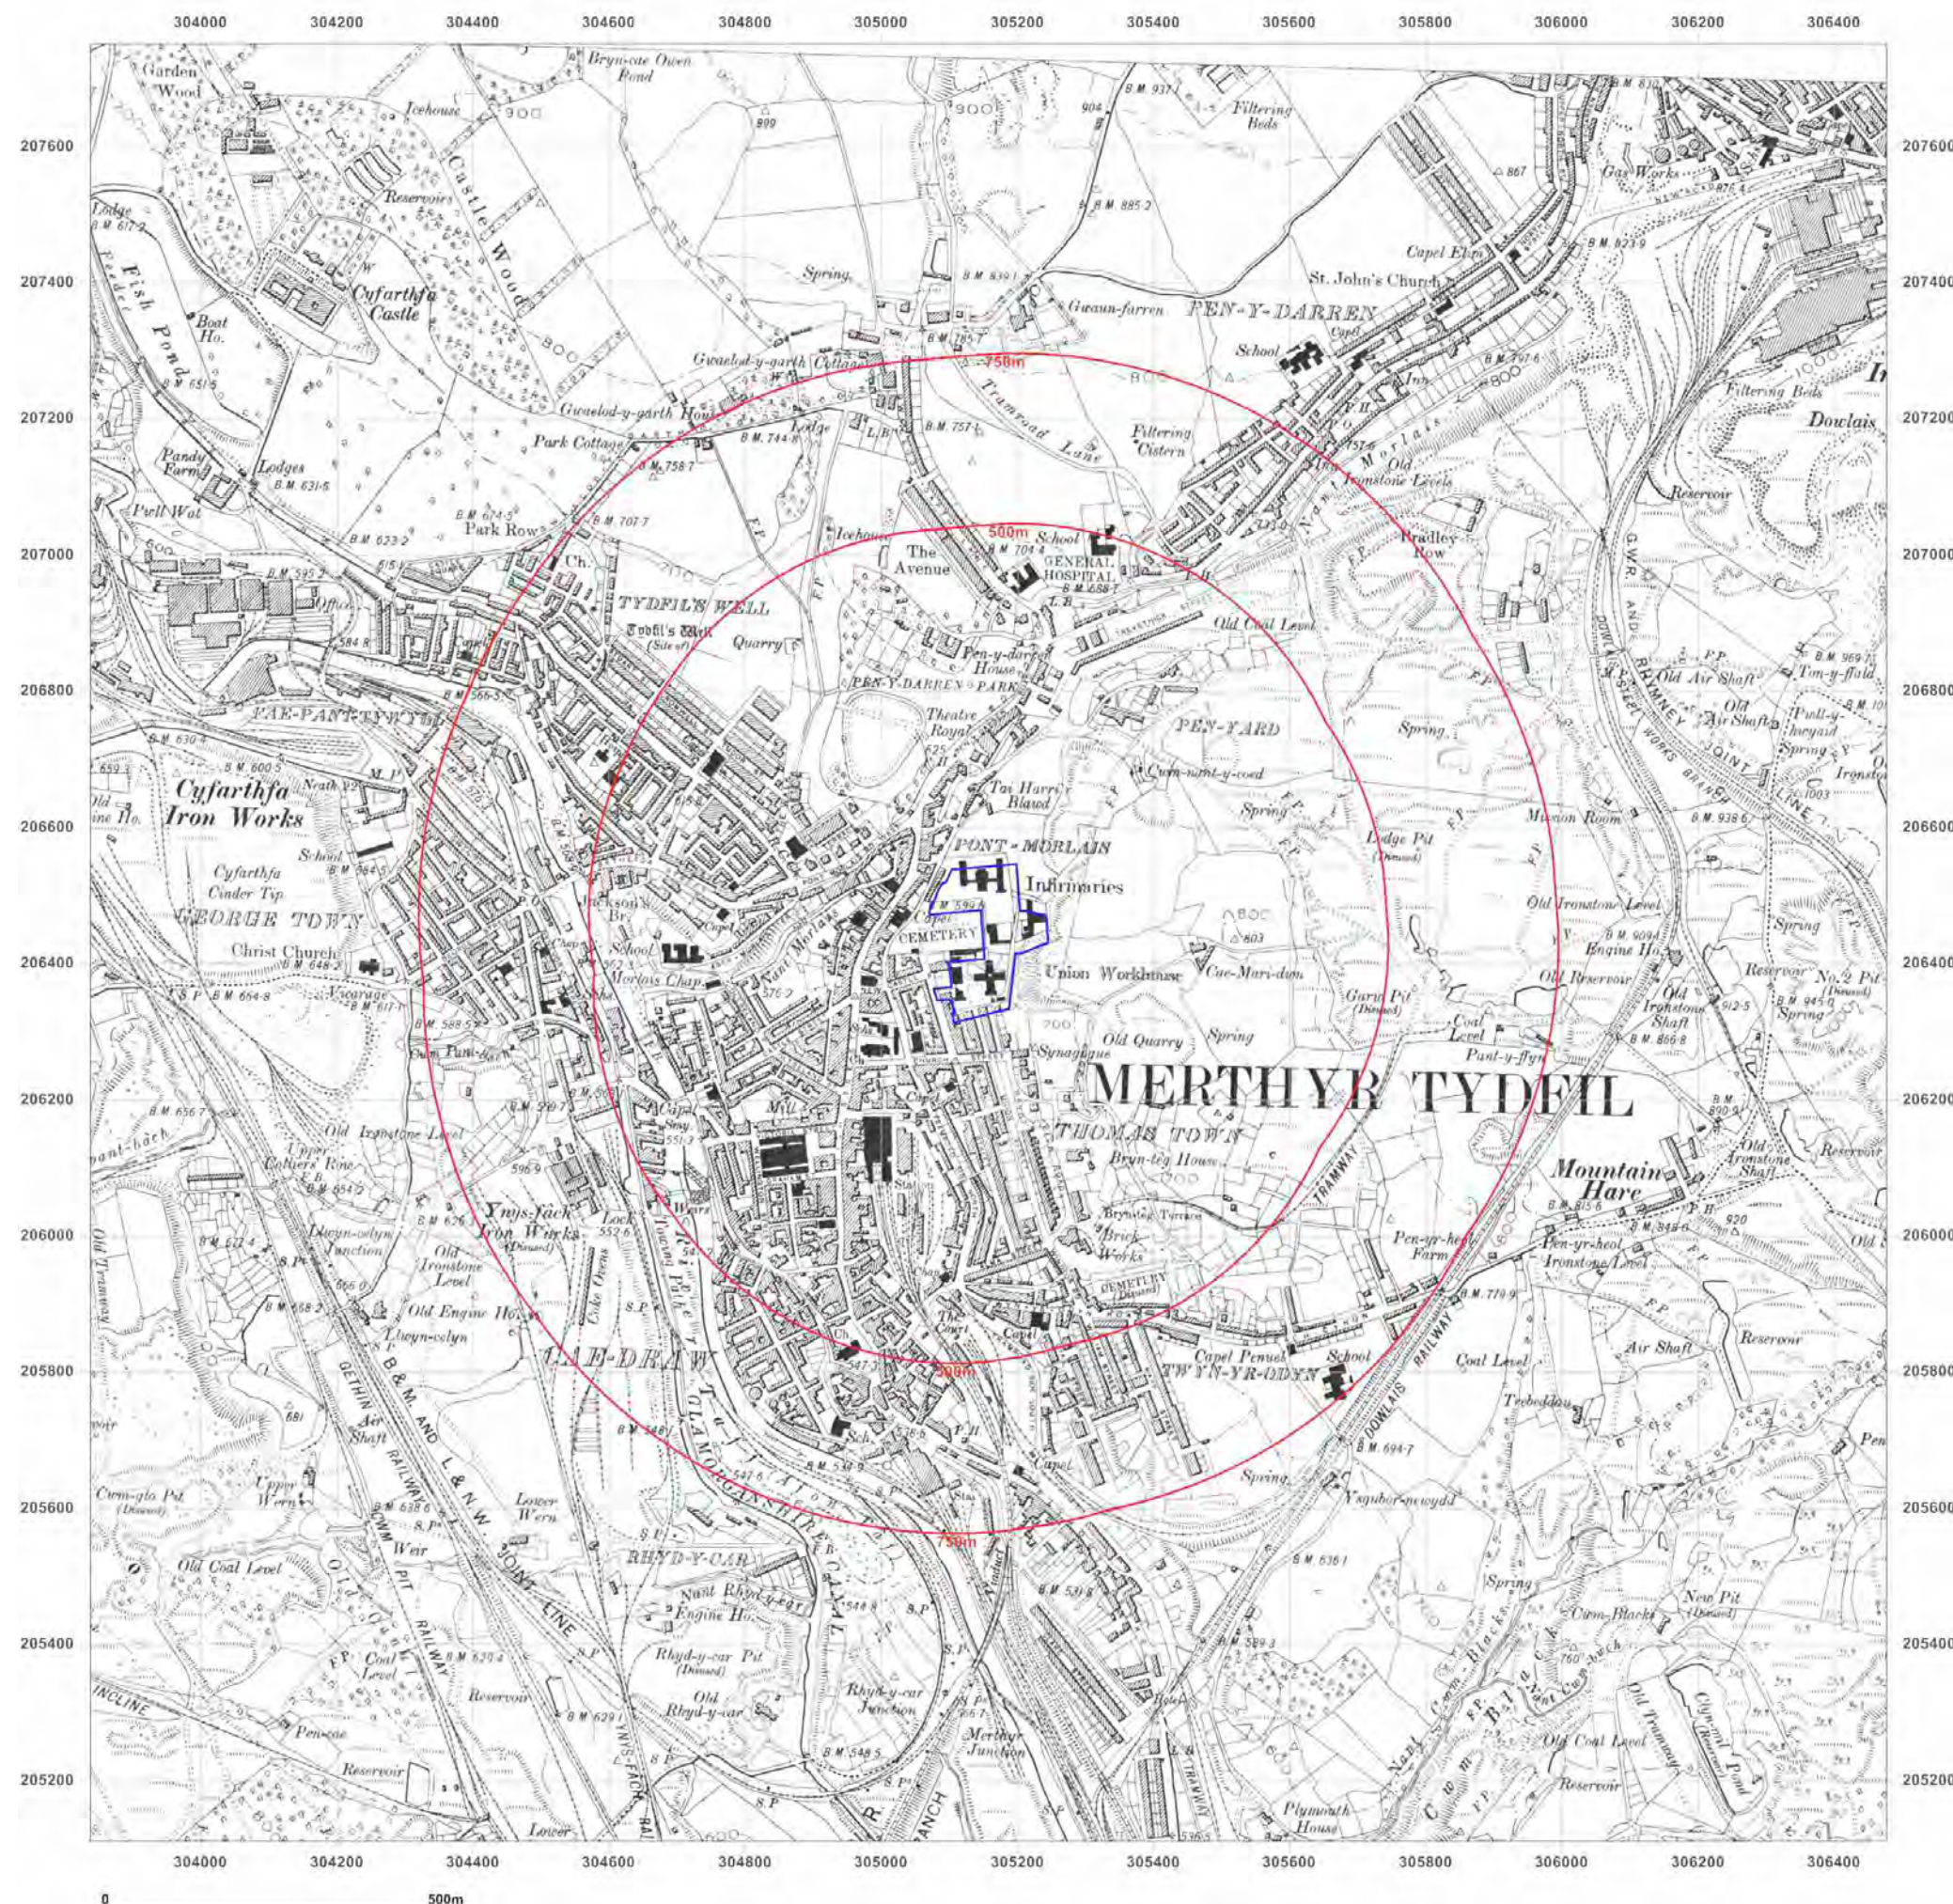

Site Details:

MERTHYR TYDFIL, CF47 0BL

Client Ref: 19-S715-TPC-21988

Report Ref: HMD-154-6127015

Grid Ref: 305157, 206430

Map Name: County Series

Map date: 1915

Scale: 1:10,560

Printed at: 1:10,560



Surveyed 1884
Revised 1915
Edition N/A
Copyright N/A
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 26 June 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

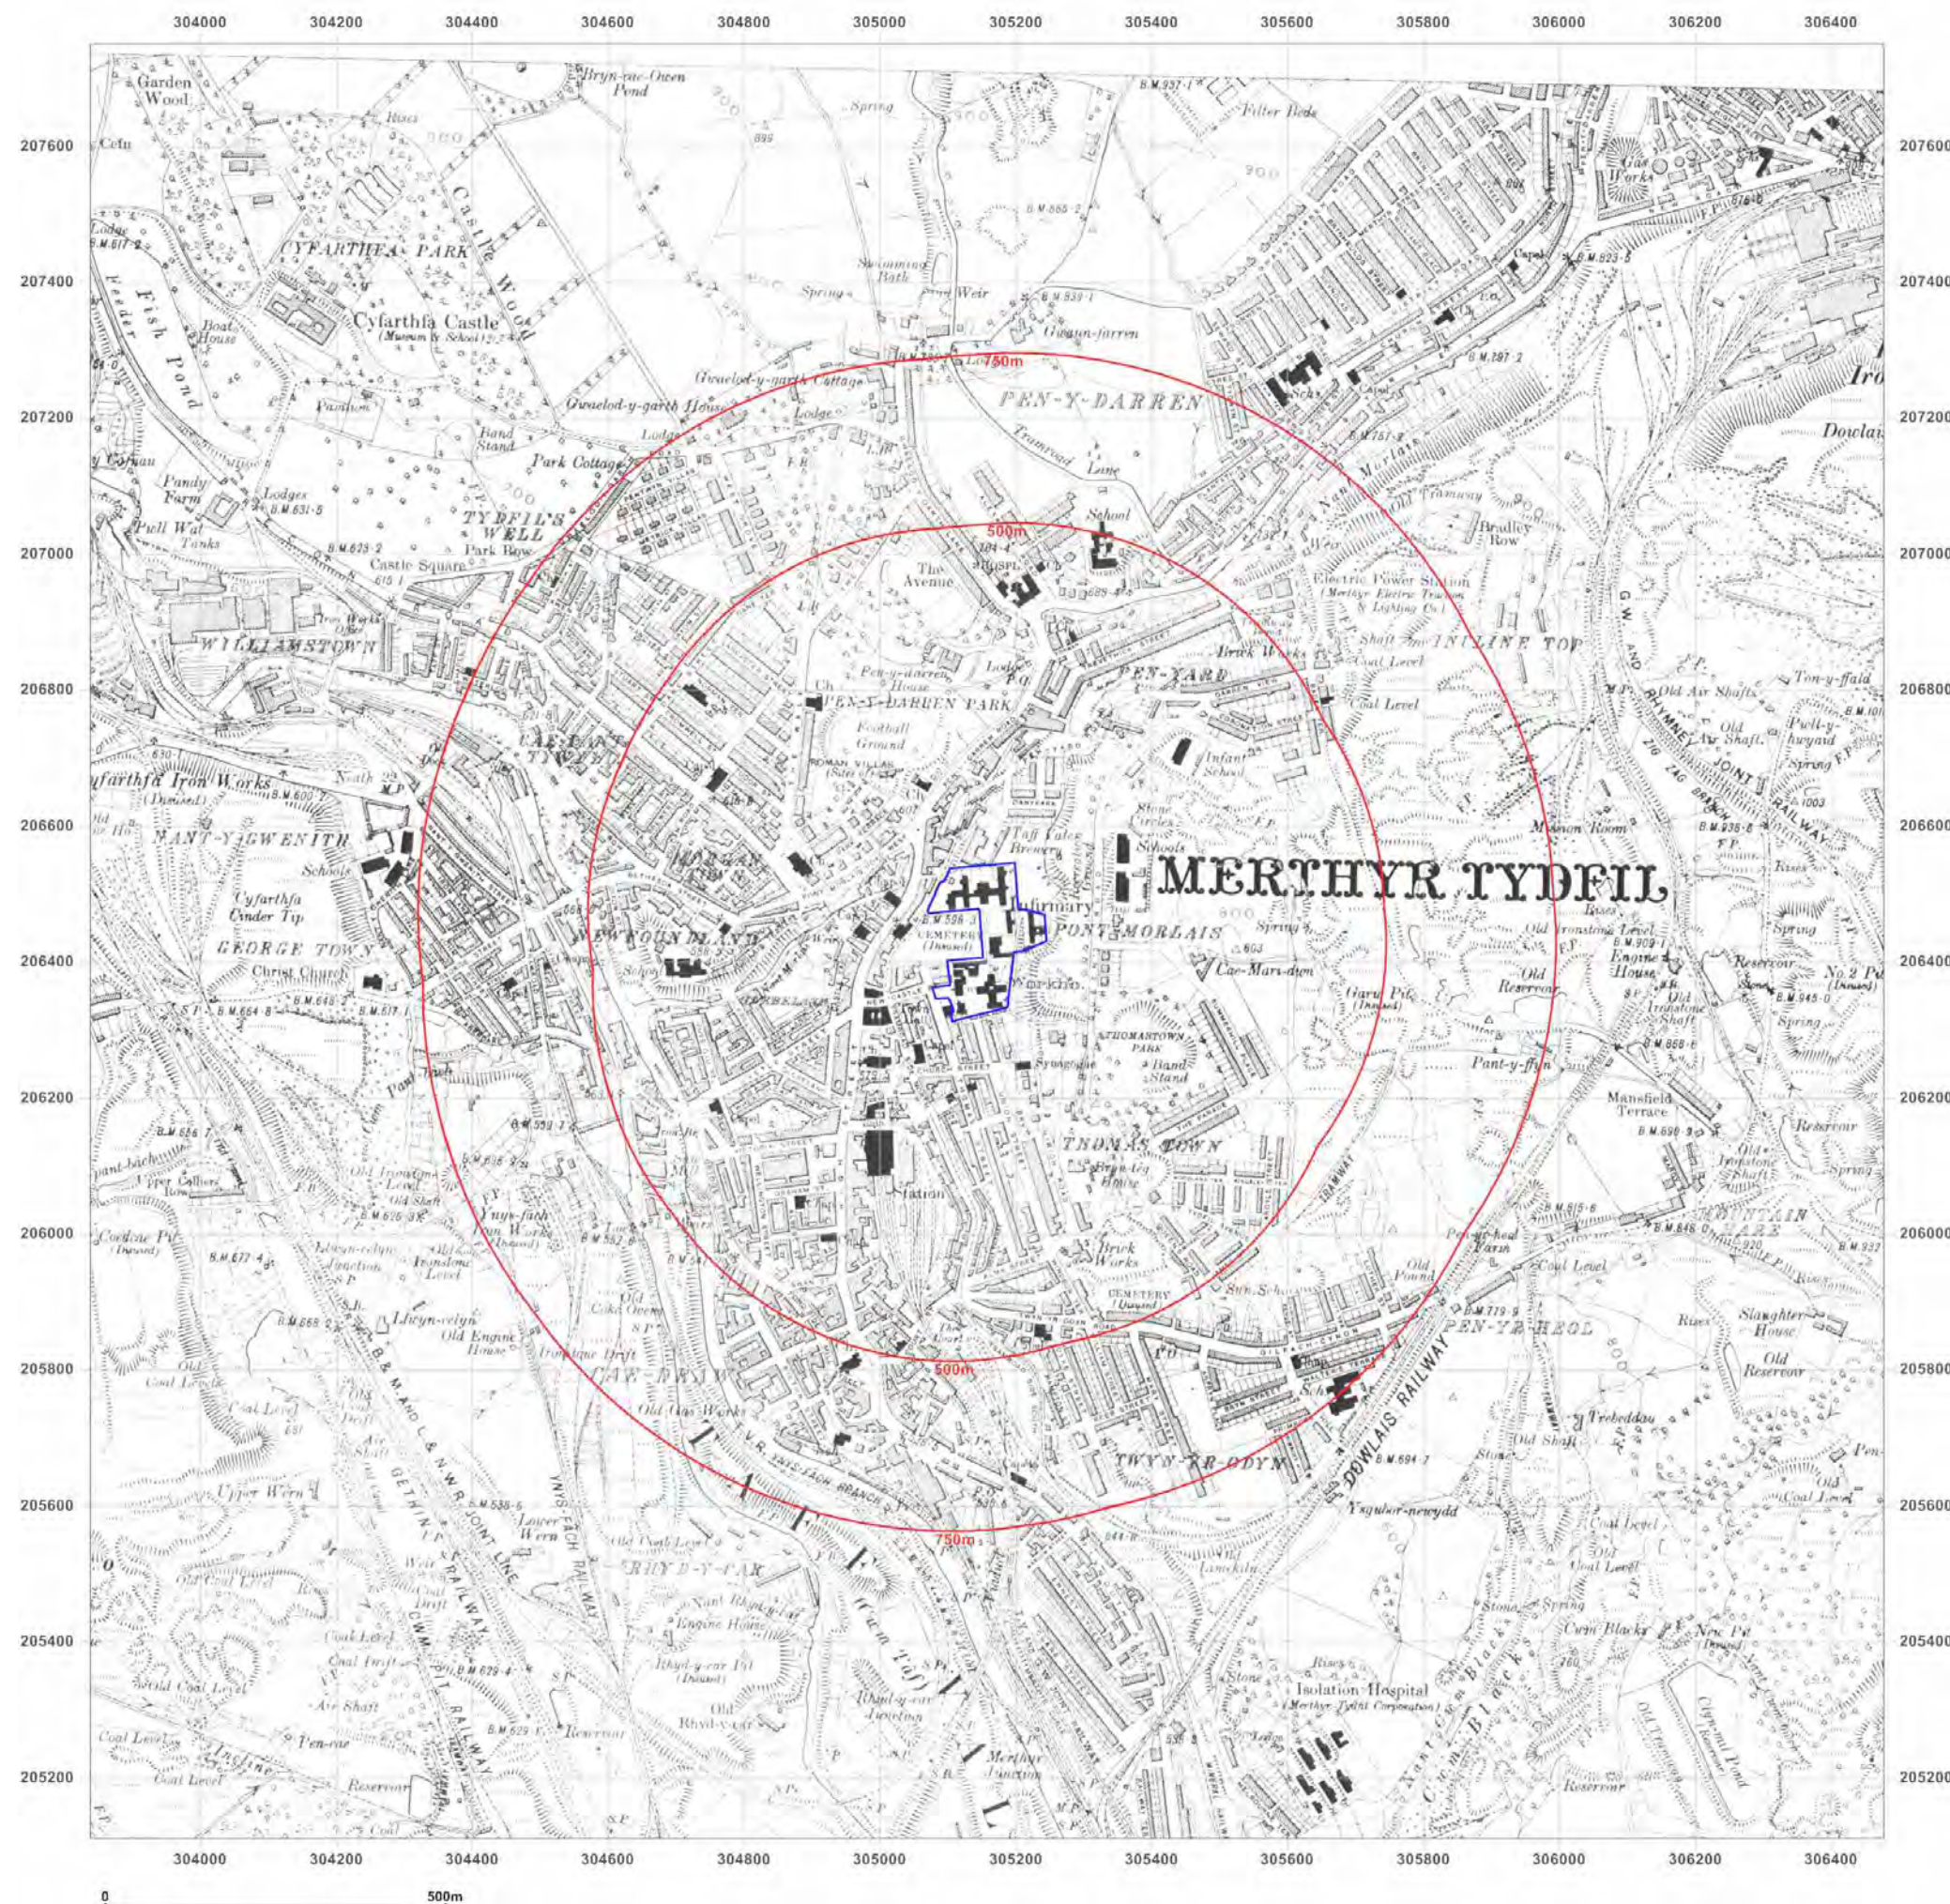

Site Details:

MERTHYR TYDFIL, CF47 0BL

Client Ref: 19-S715-TPC-21988
Report Ref: HMD-154-6127015
Grid Ref: 305157, 206430

Map Name: County Series

Map date: 1921

Scale: 1:10,560

Printed at: 1:10,560



Surveyed 1885
Revised 1915
Edition 1922
Copyright N/A
Levelled 1914

Surveyed 1884
Revised 1915
Edition 1922
Copyright N/A
Levelled 1915




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 26 June 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

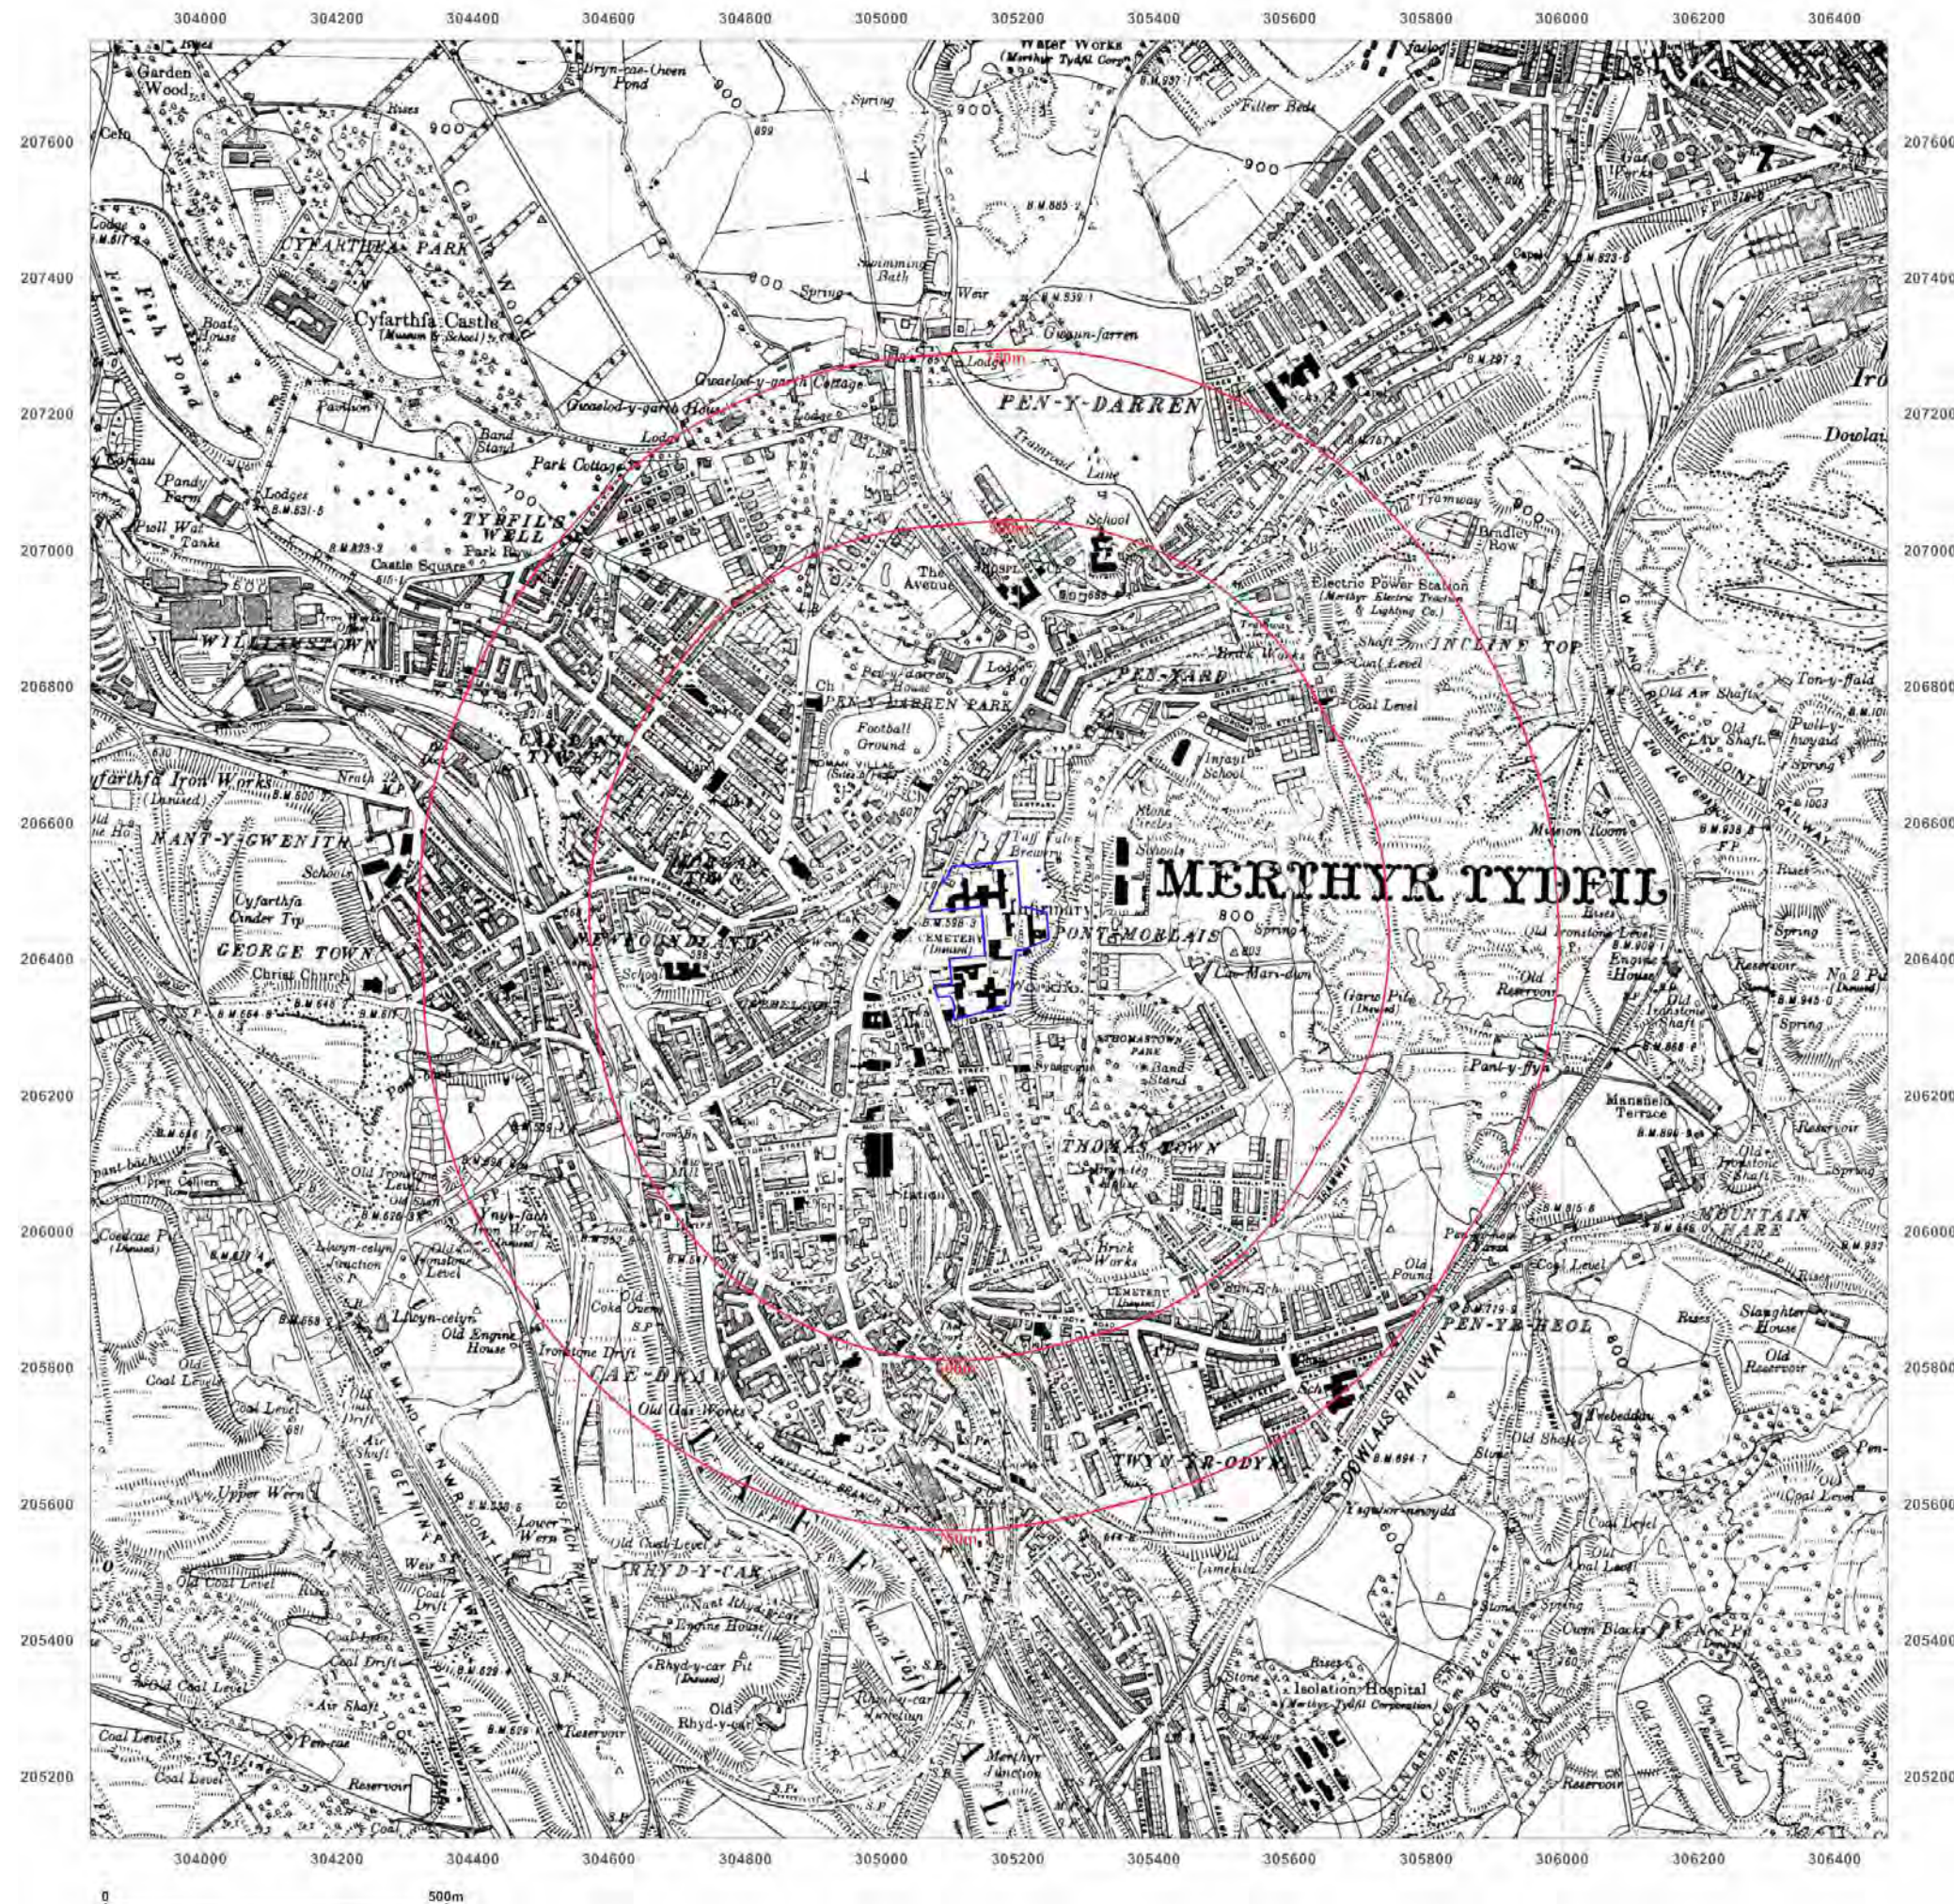

Site Details:

MERTHYR TYDFIL, CF47 0BL

Client Ref: 19-S715-TPC-21988
Report Ref: HMD-154-6127015
Grid Ref: 305157, 206430

Map Name: County Series

Map date: 1922

Scale: 1:10,560

Printed at: 1:10,560



Surveyed 1885
Revised 1922
Edition 1922
Copyright N/A
Levelled N/A

Surveyed 1922
Revised N/A
Edition N/A
Copyright N/A
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 26 June 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

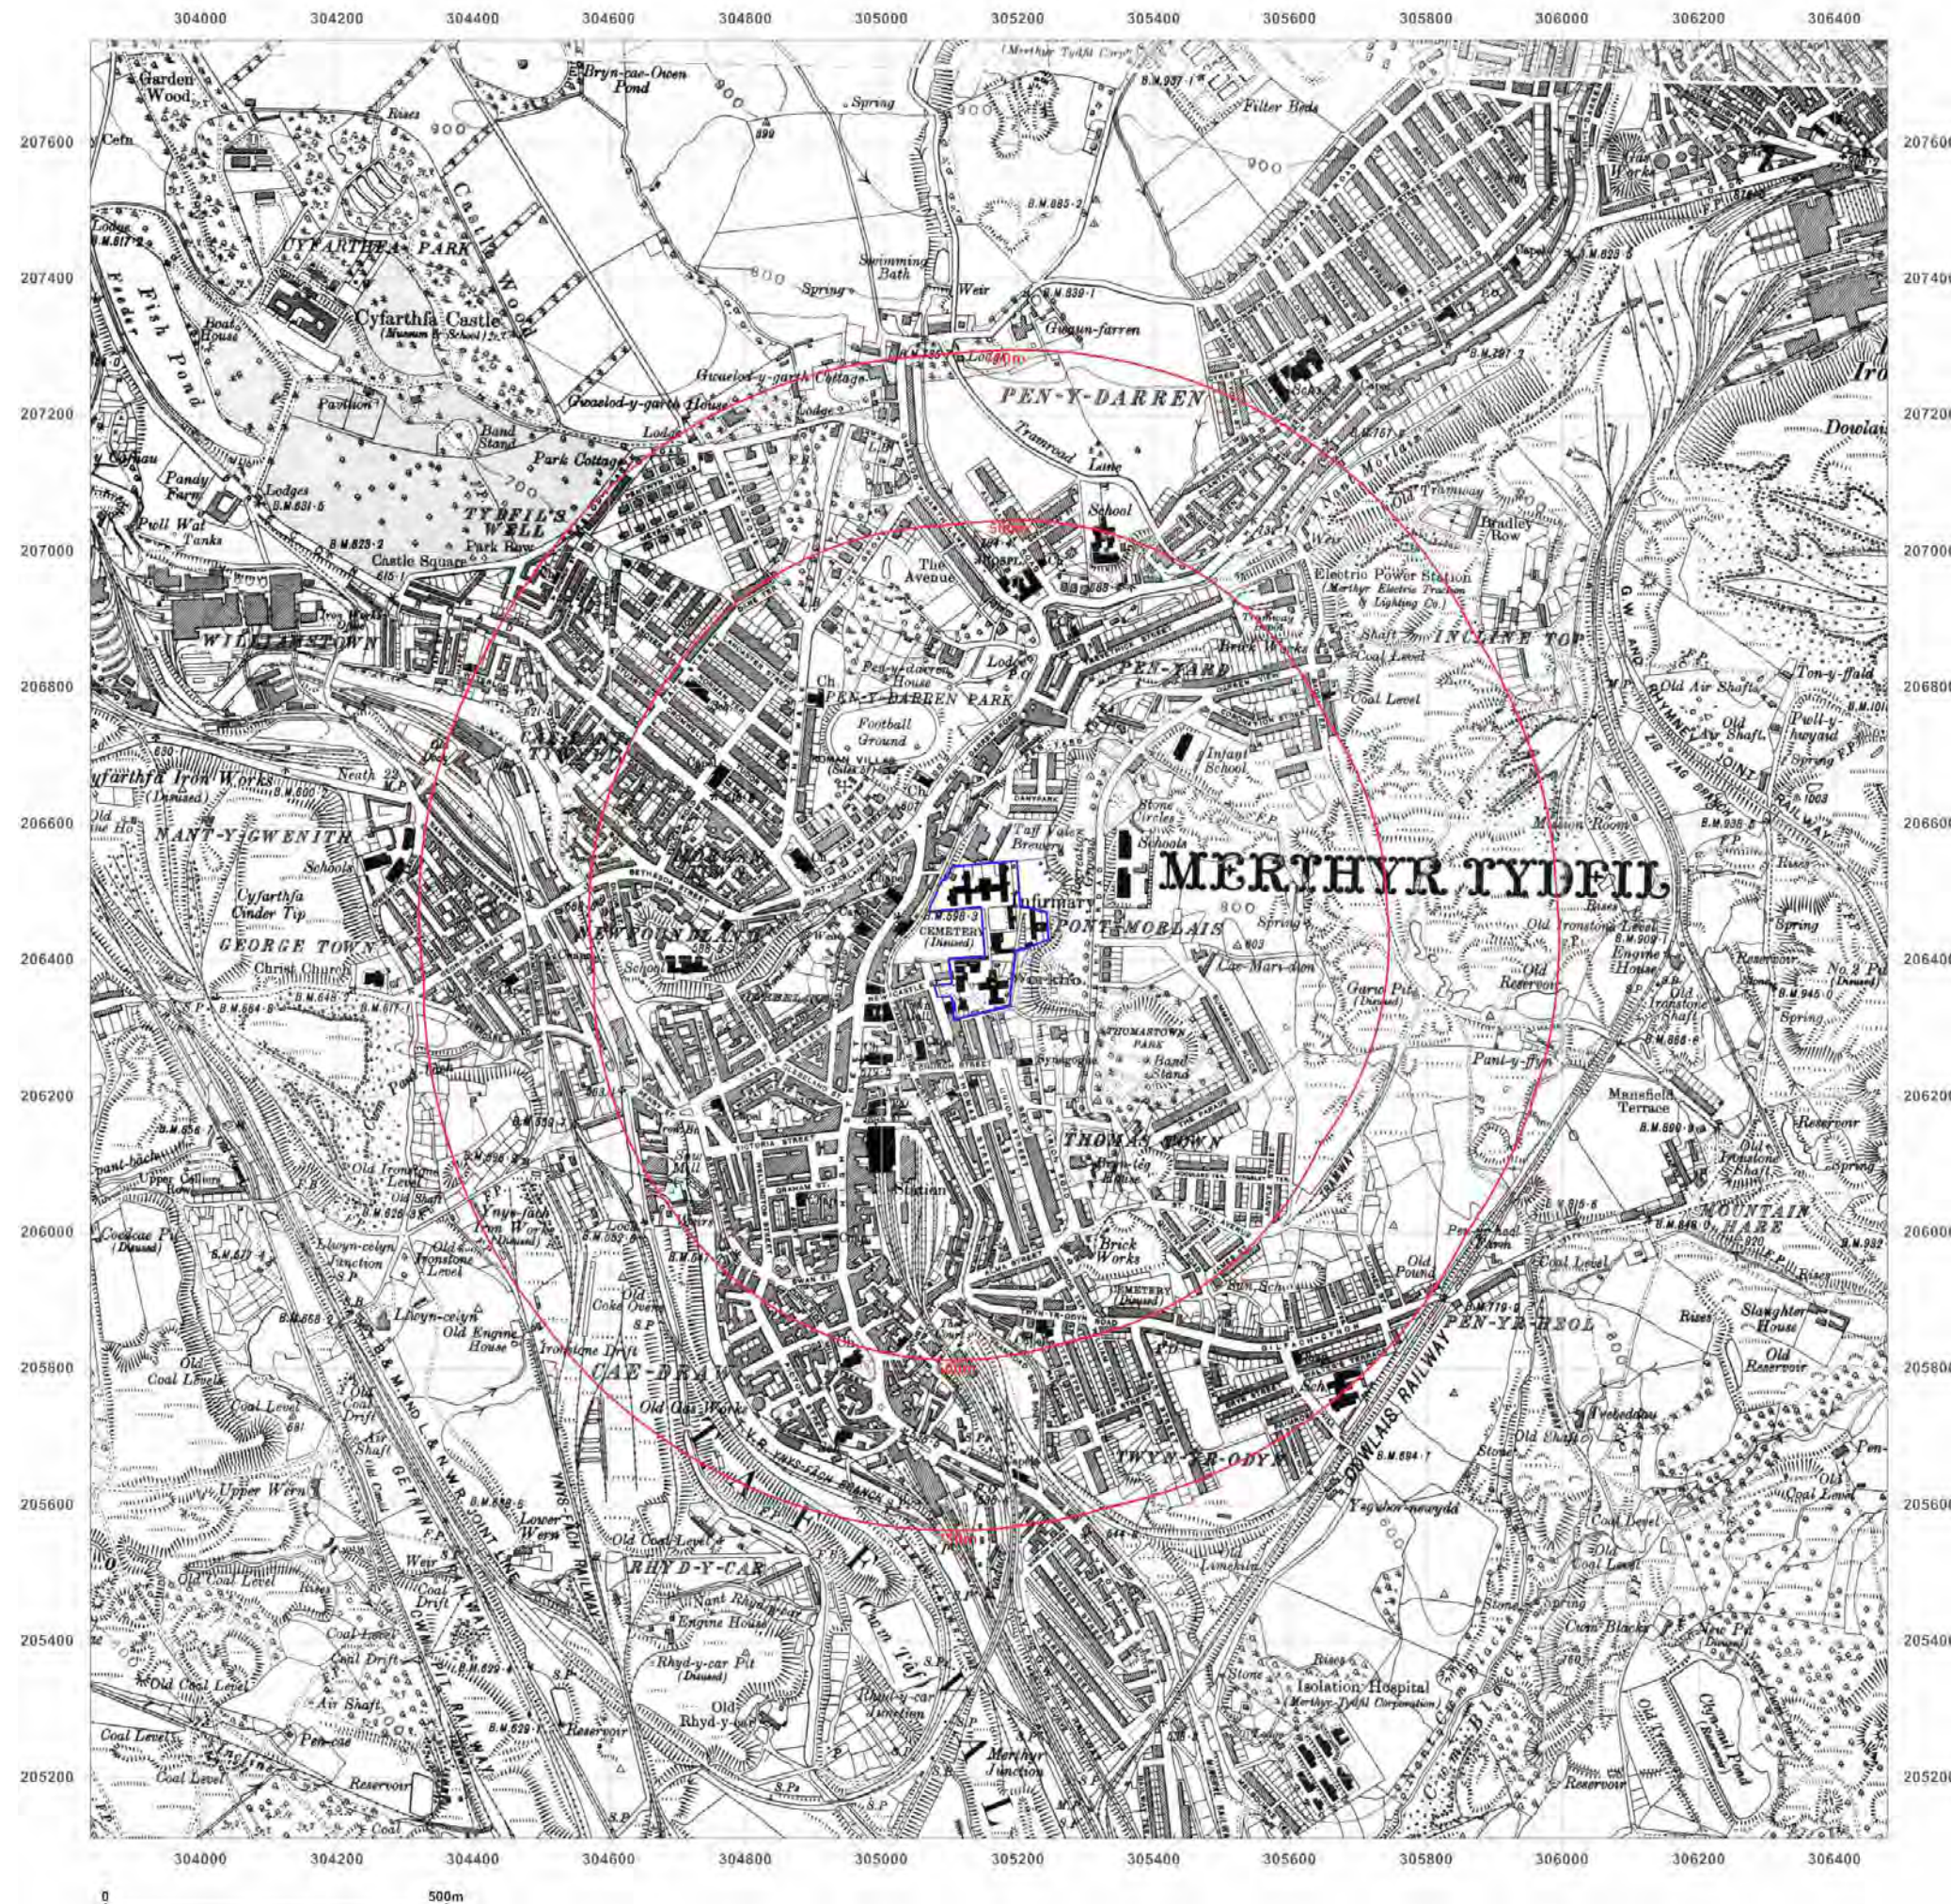

Site Details:

MERTHYR TYDFIL, CF47 0BL

Client Ref: 19-S715-TPC-21988

Report Ref: HMD-154-6127015

Grid Ref: 305157, 206430

Map Name: County Series

Map date: 1938

Scale: 1:10,560

Printed at: 1:10,560



Surveyed 1884
Revised 1938
Edition 1938
Copyright N/A
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 26 June 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

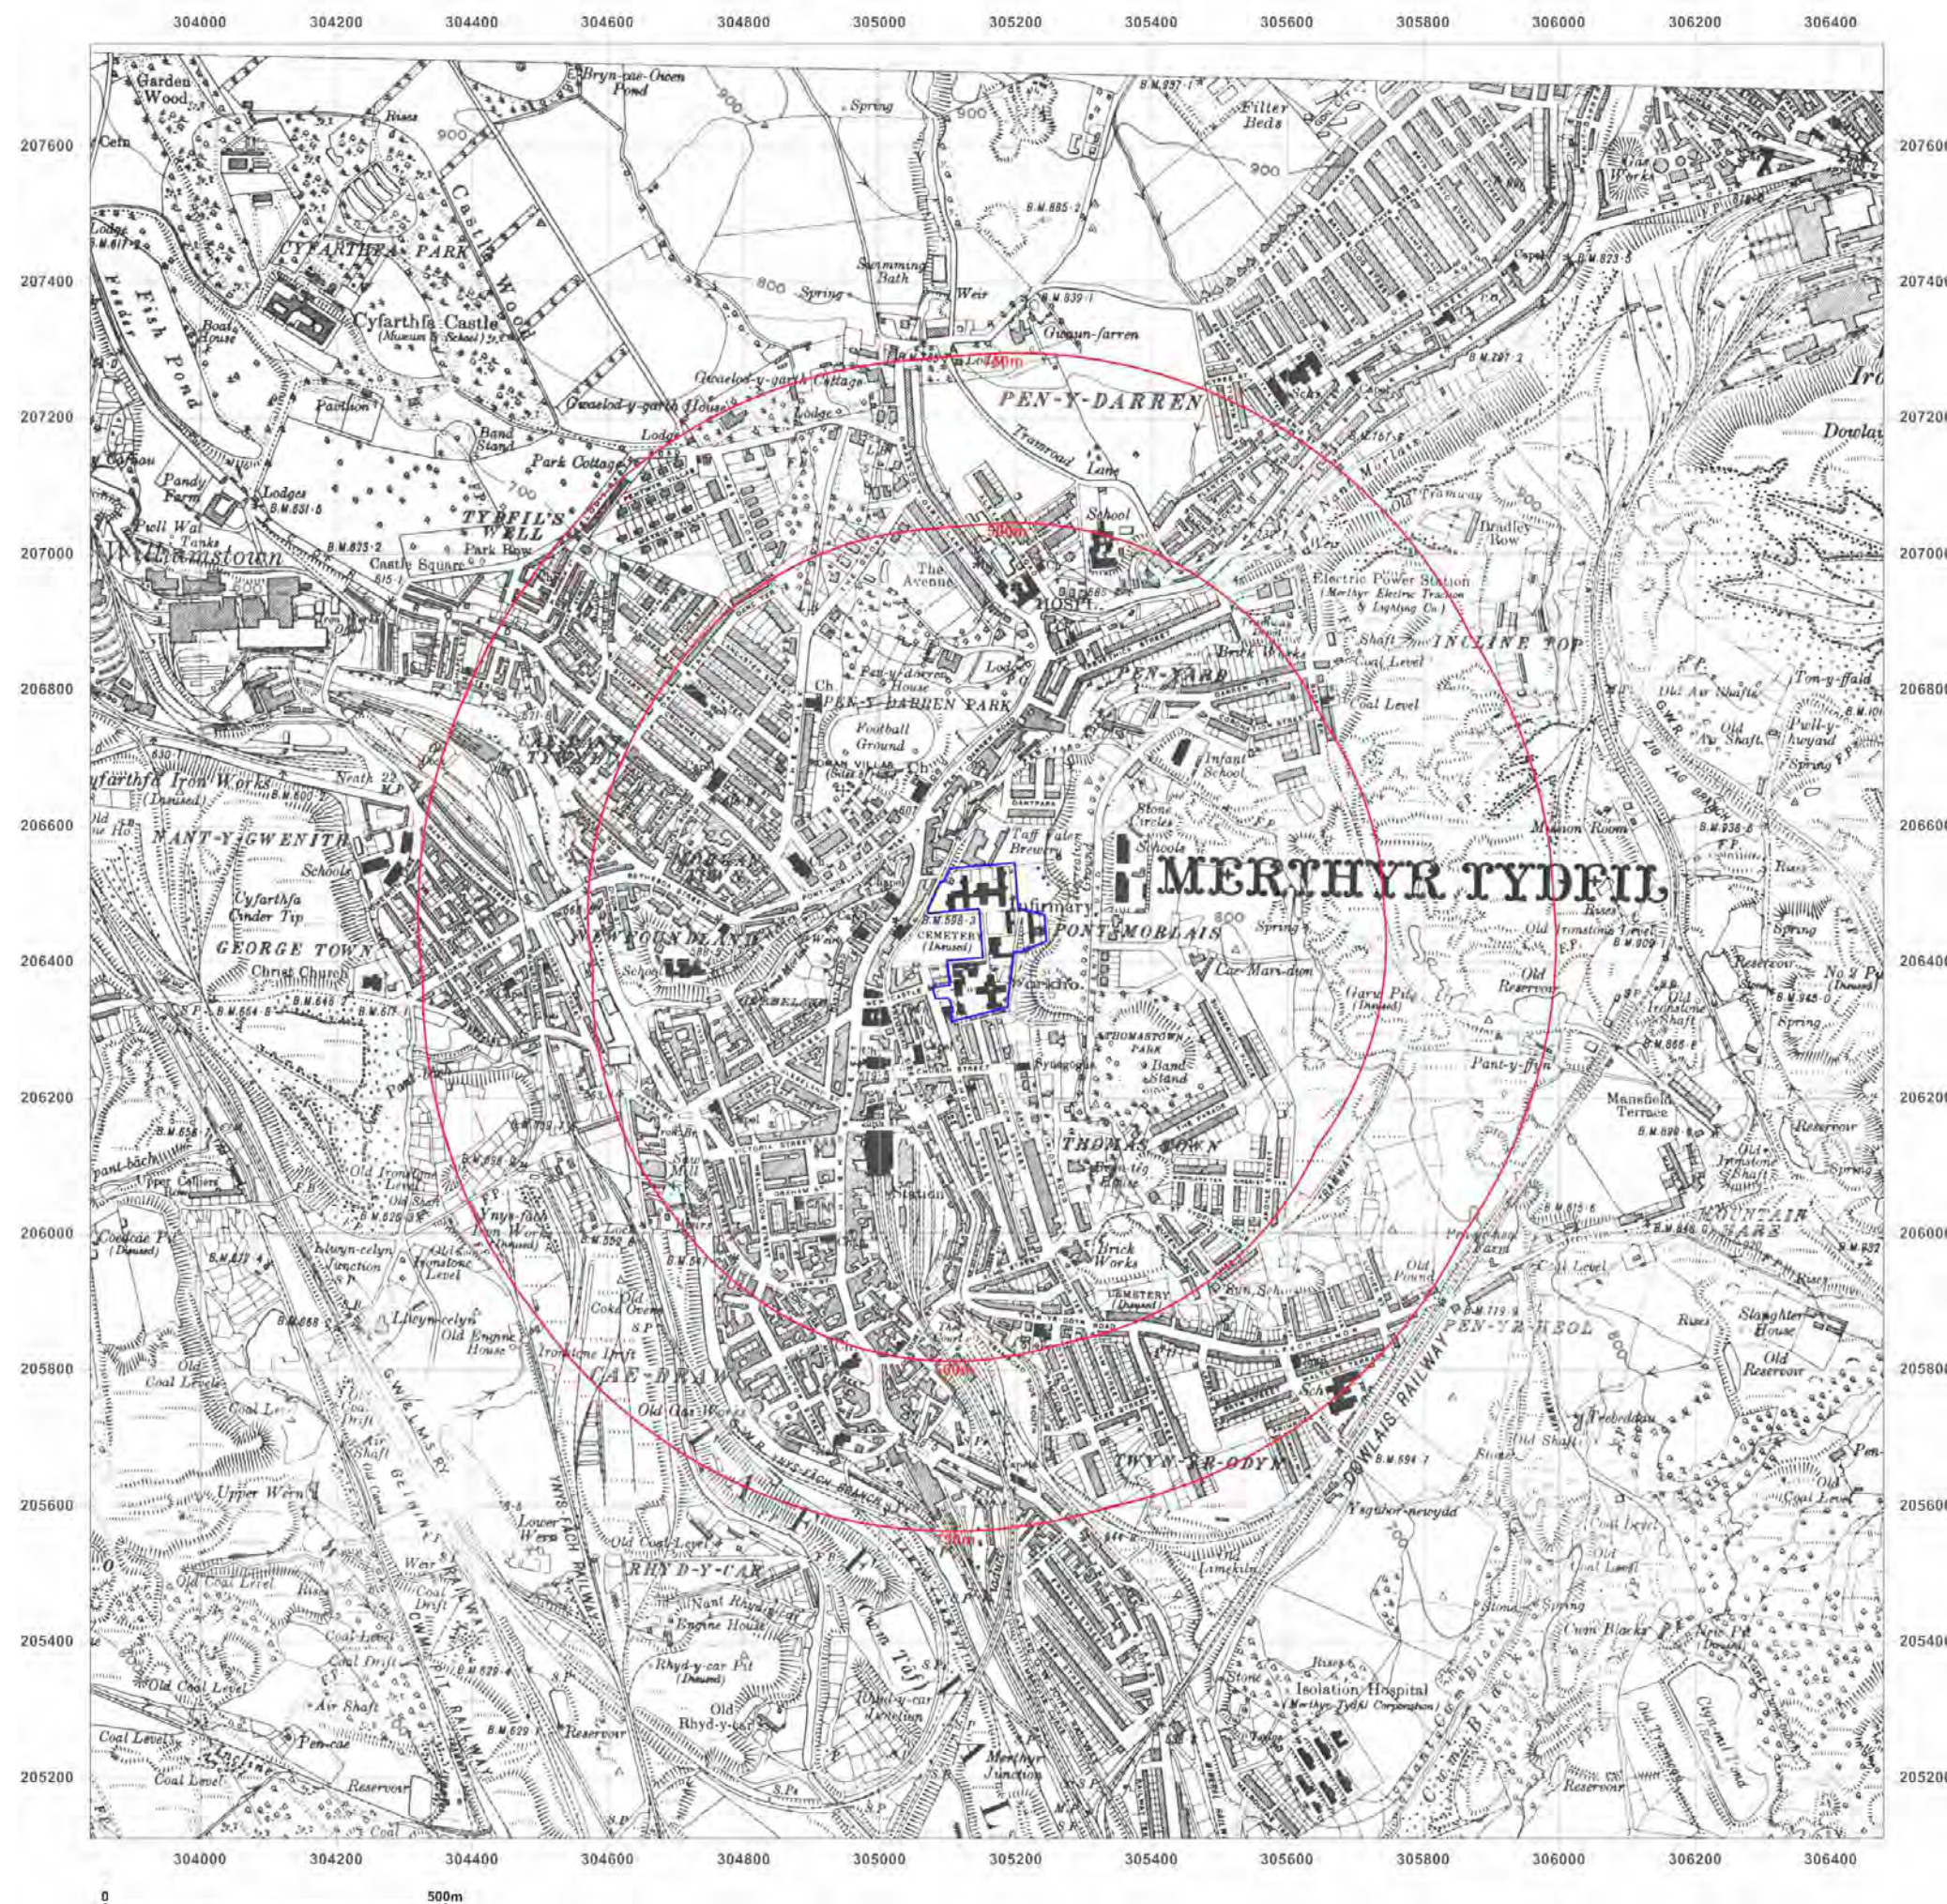

Site Details:

MERTHYR TYDFIL, CF47 0BL

Client Ref: 19-S715-TPC-21988
Report Ref: HMD-154-6127015
Grid Ref: 305157, 206430

Map Name: County Series

Map date: 1948

Scale: 1:10,560

Printed at: 1:10,560



Surveyed 1885
Revised 1948
Edition N/A
Copyright N/A
Levelled N/A

Surveyed 1884
Revised 1948
Edition N/A
Copyright N/A
Levelled N/A




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 26 June 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

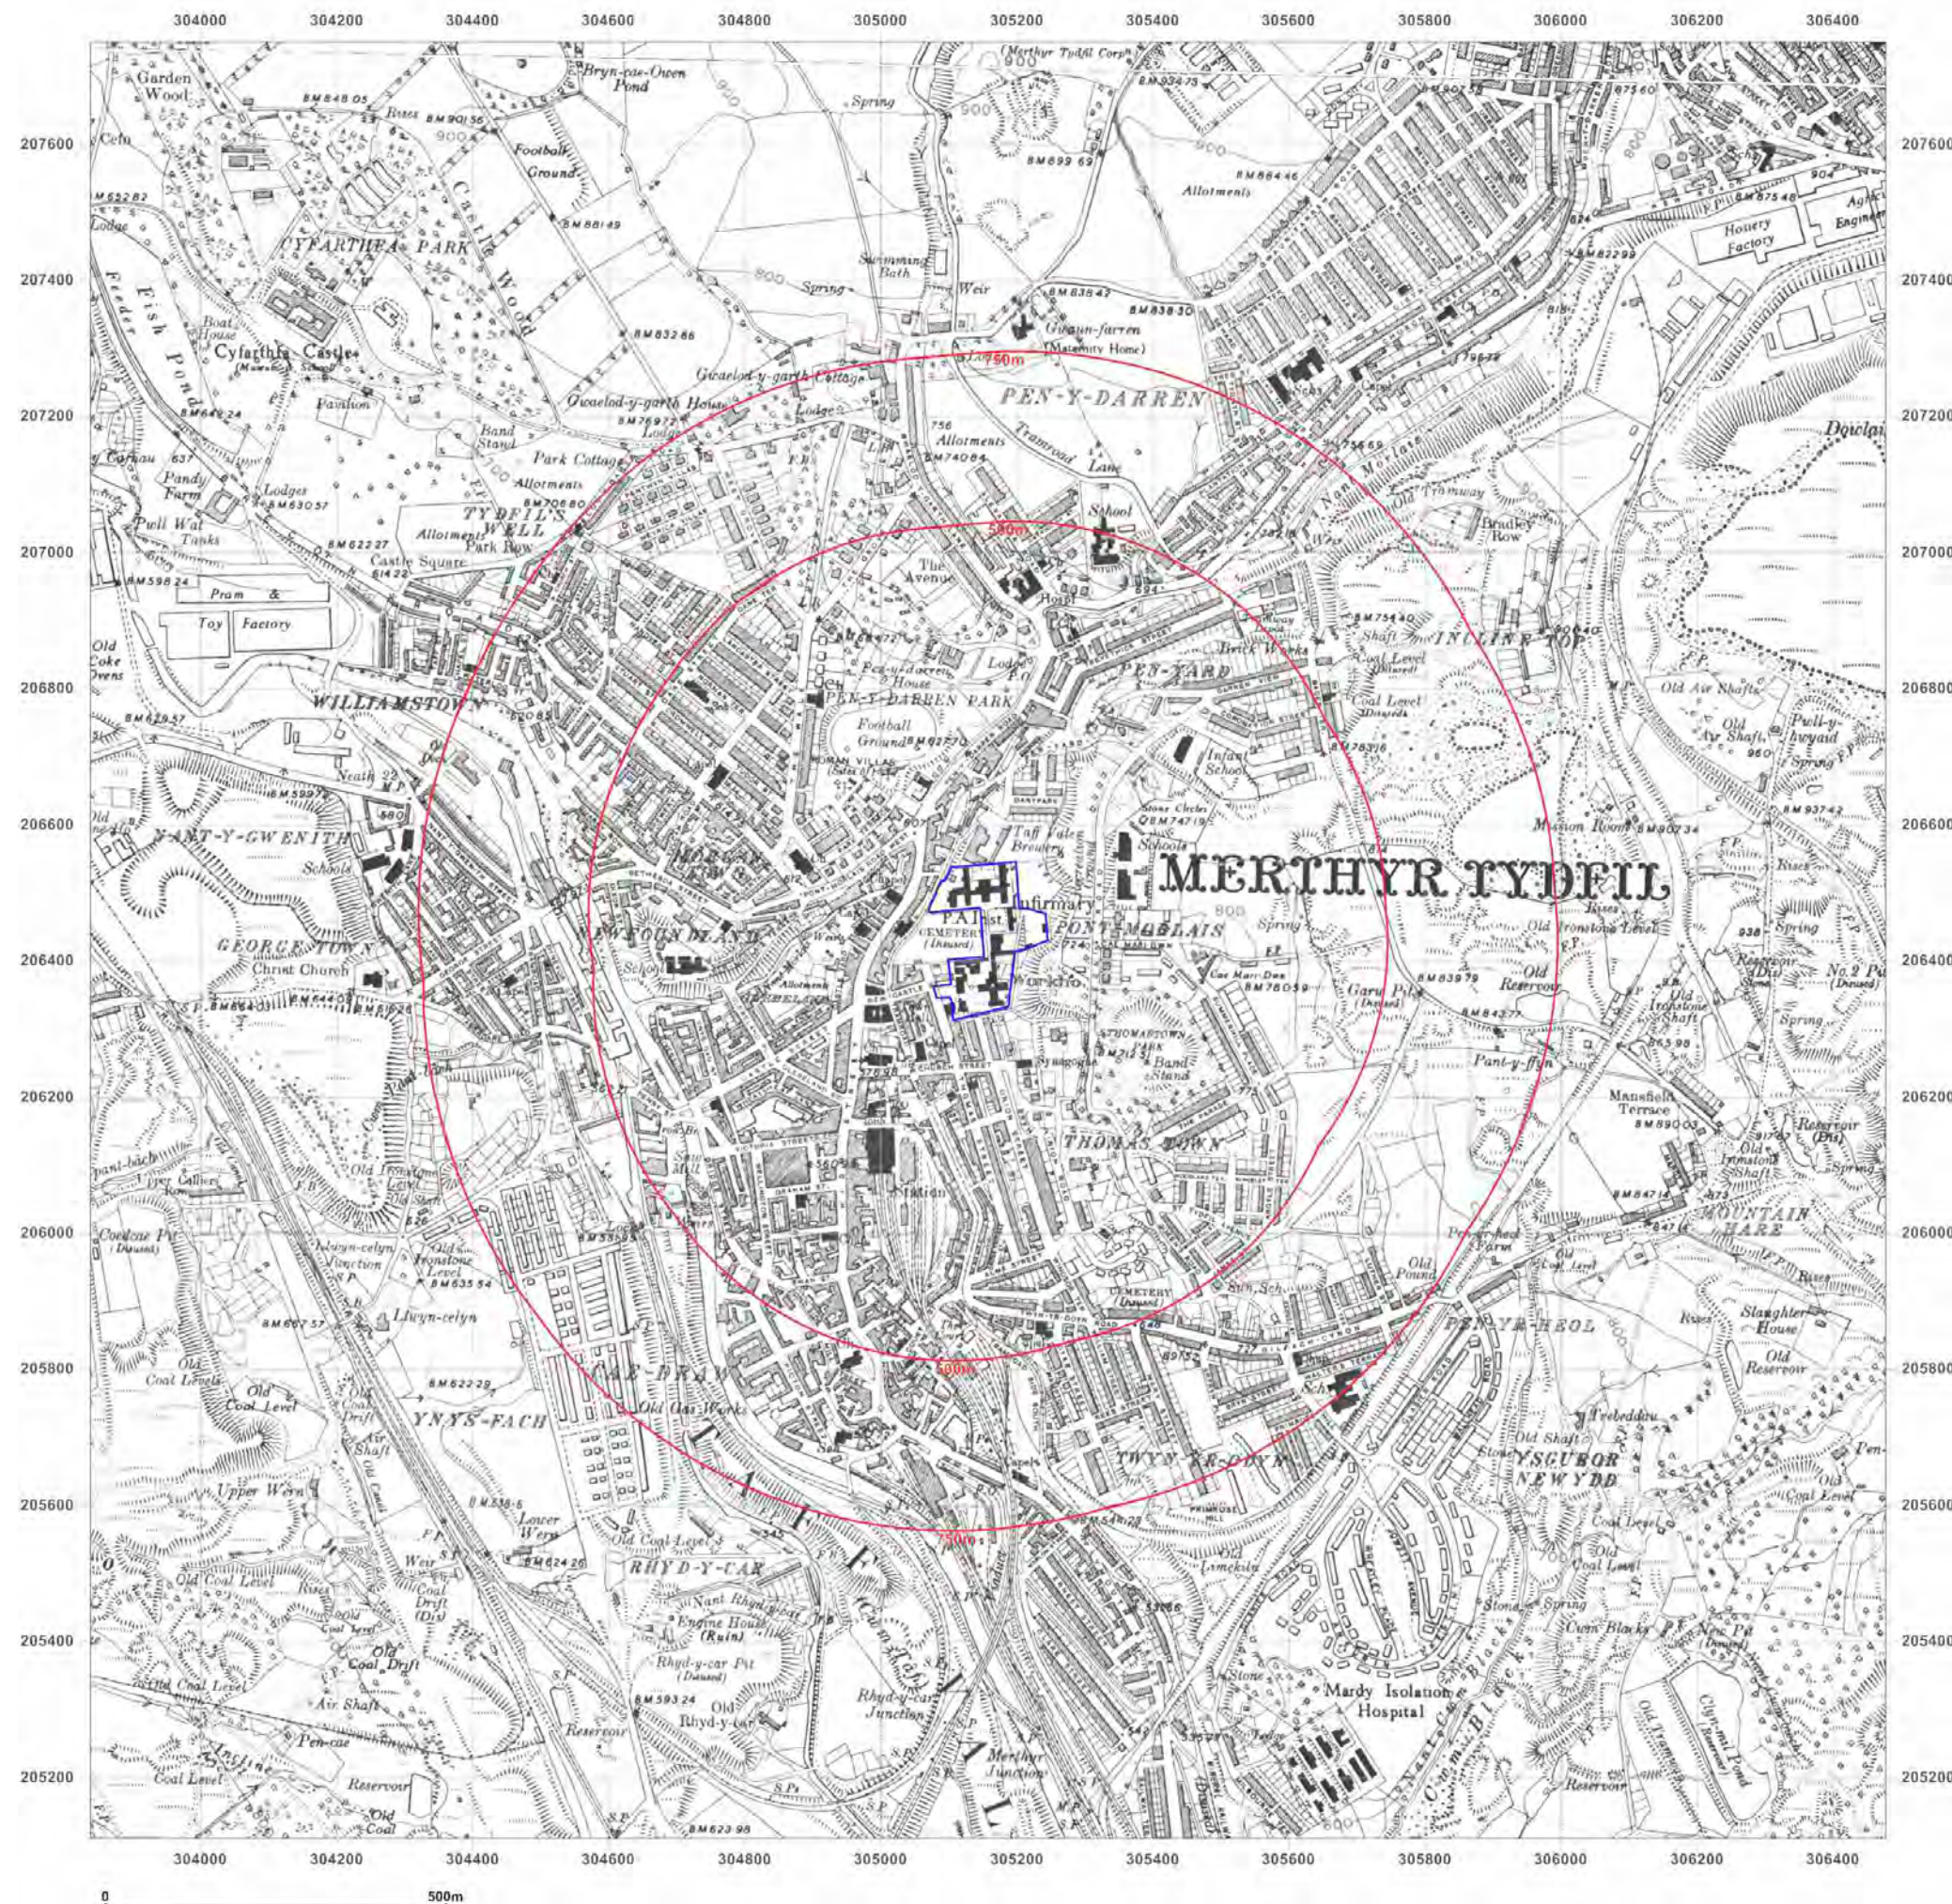

Site Details:

MERTHYR TYDFIL, CF47 0BL

Client Ref: 19-S715-TPC-21988
Report Ref: HMD-154-6127015
Grid Ref: 305157, 206430

Map Name: Provisional

Map date: 1965

Scale: 1:10,560

Printed at: 1:10,560



Surveyed 1965
 Revised 1965
 Edition N/A
 Copyright N/A
 Levelled N/A

Surveyed 1965
 Revised 1965
 Edition N/A
 Copyright N/A
 Levelled N/A




Produced by
 Groundsure Insights
 T: 08444 159000
 E: info@groundsure.com
 W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 26 June 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

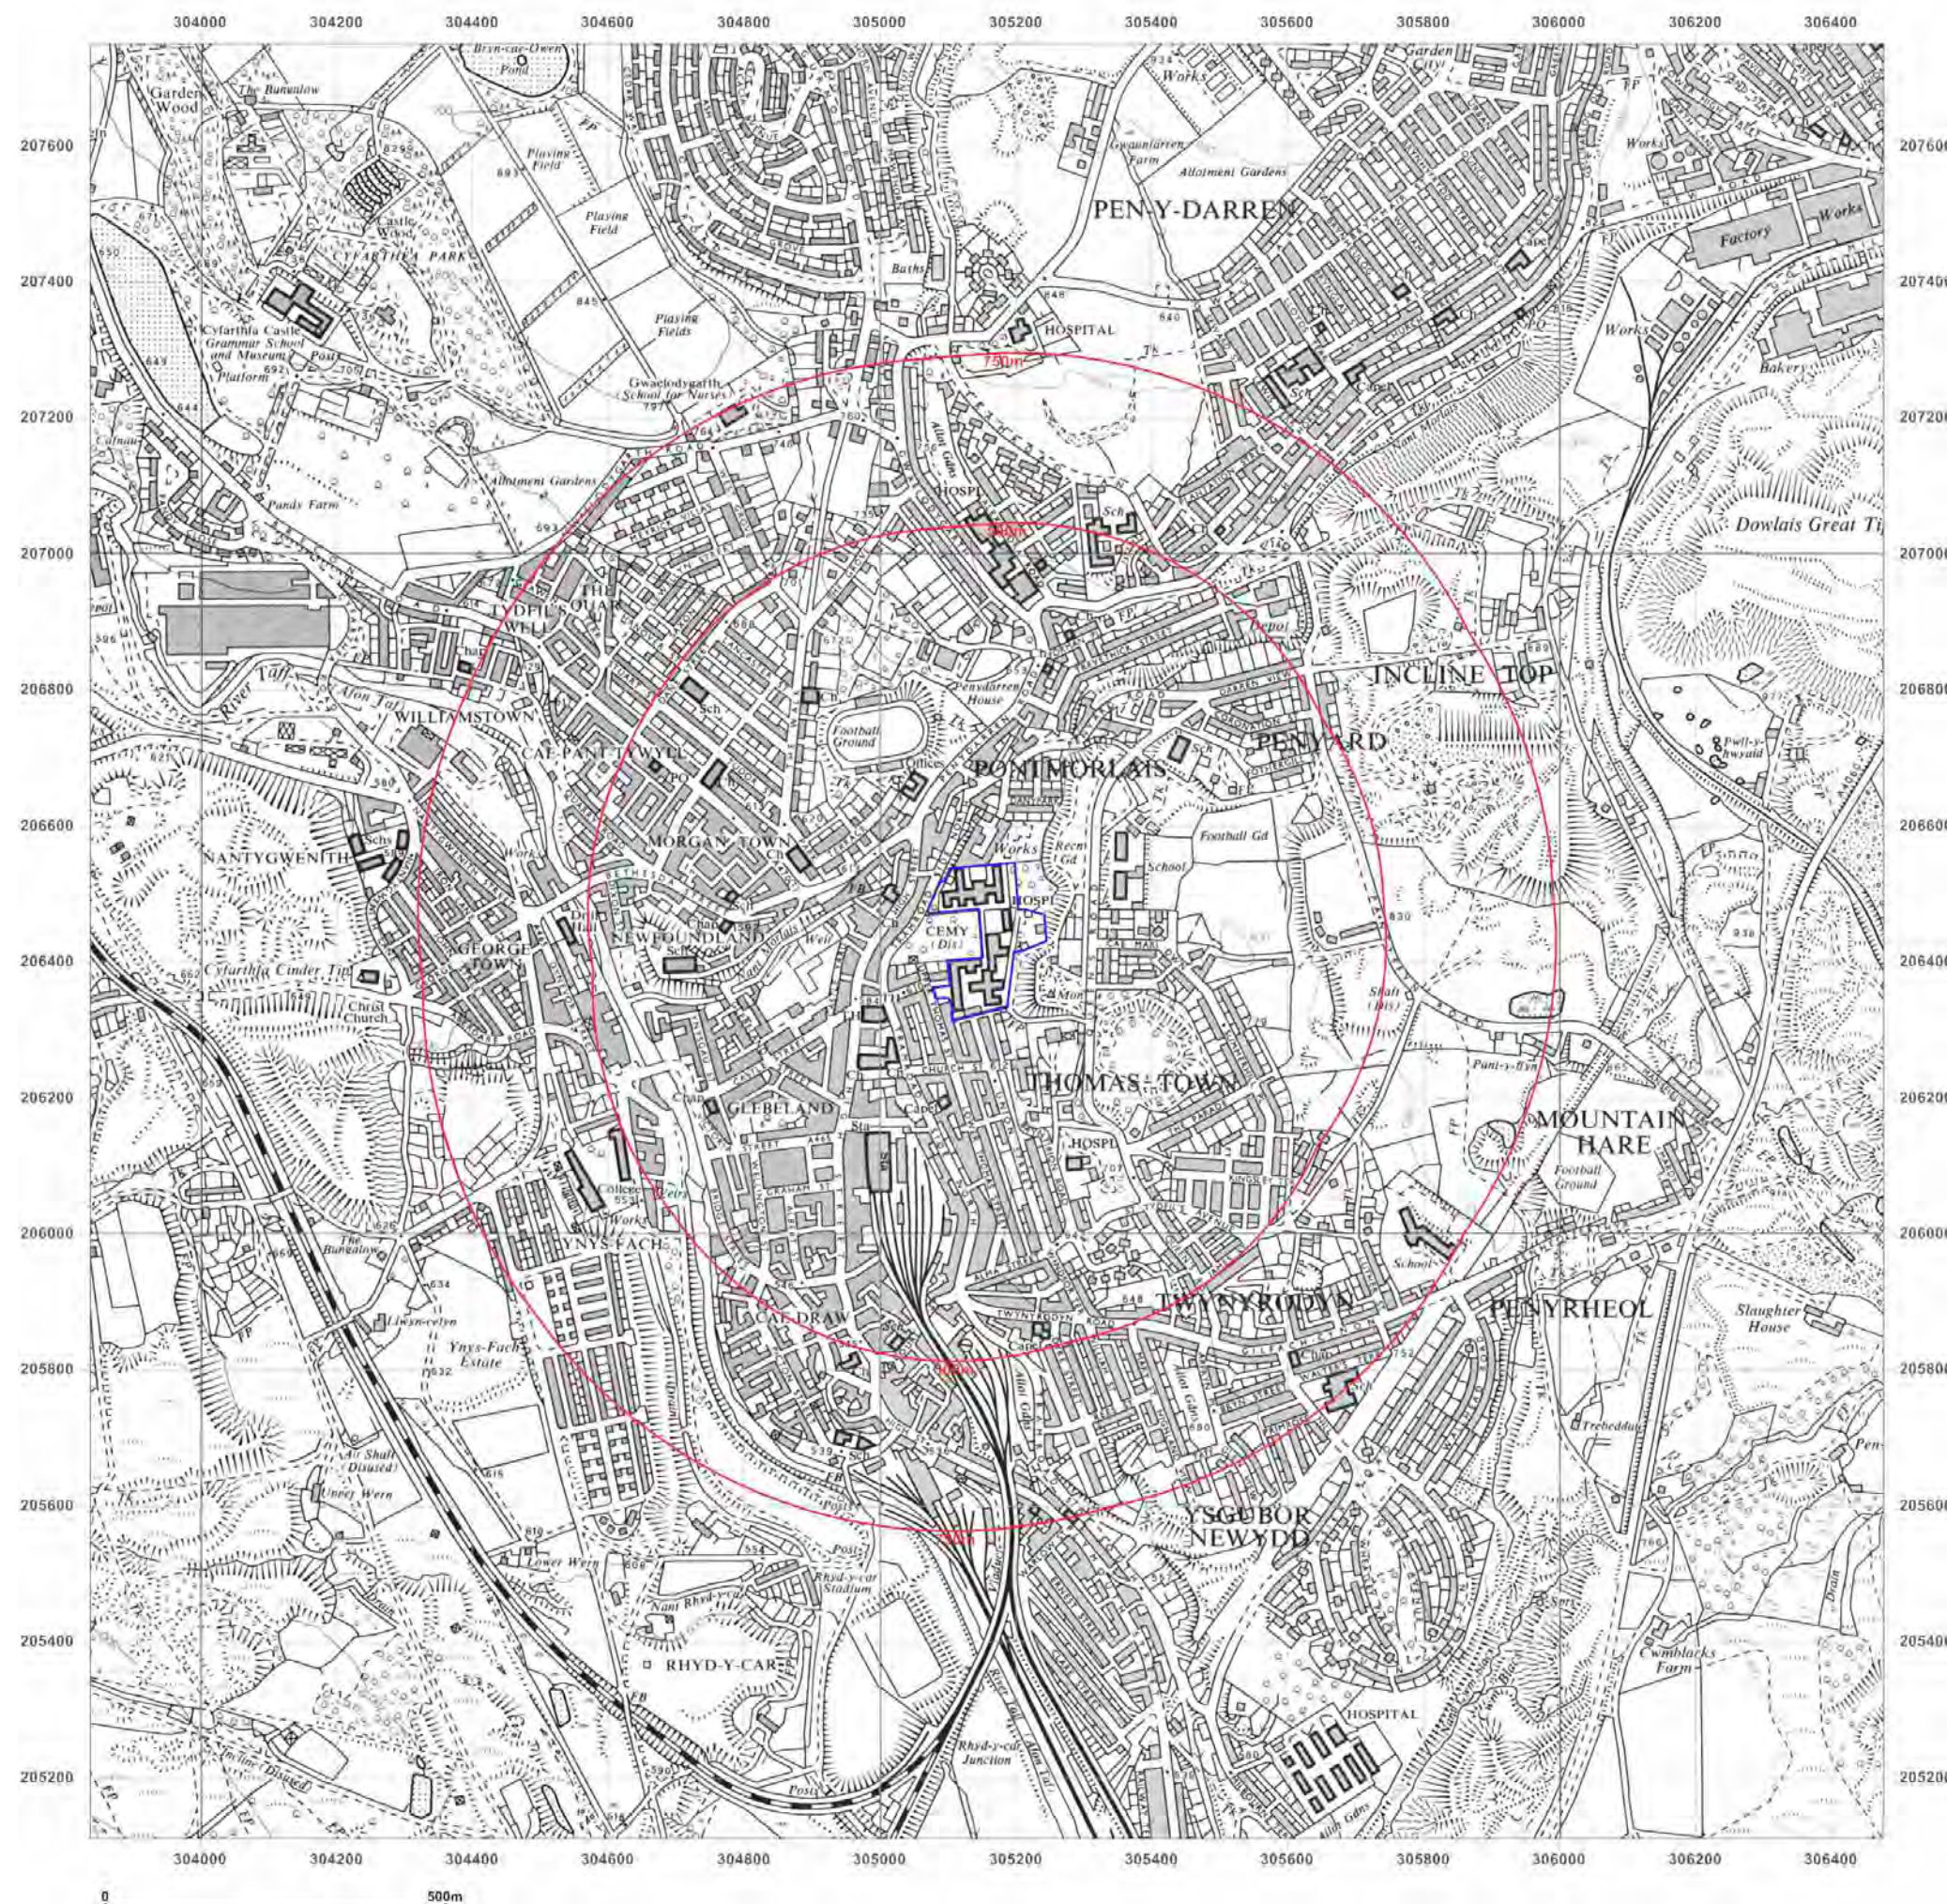

Site Details:

MERTHYR TYDFIL, CF47 0BL

Client Ref: 19-S715-TPC-21988
Report Ref: HMD-154-6127015
Grid Ref: 305157, 206430

Map Name: National Grid

Map date: 1976-1977

Scale: 1:10,000

Printed at: 1:10,000



Surveyed 1975
 Revised 1976
 Edition N/A
 Copyright N/A
 Levelled N/A

Surveyed 1974
 Revised 1977
 Edition N/A
 Copyright 1977
 Levelled 1975




Produced by
 Groundsure Insights
 T: 08444 159000
 E: info@groundsure.com
 W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 26 June 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

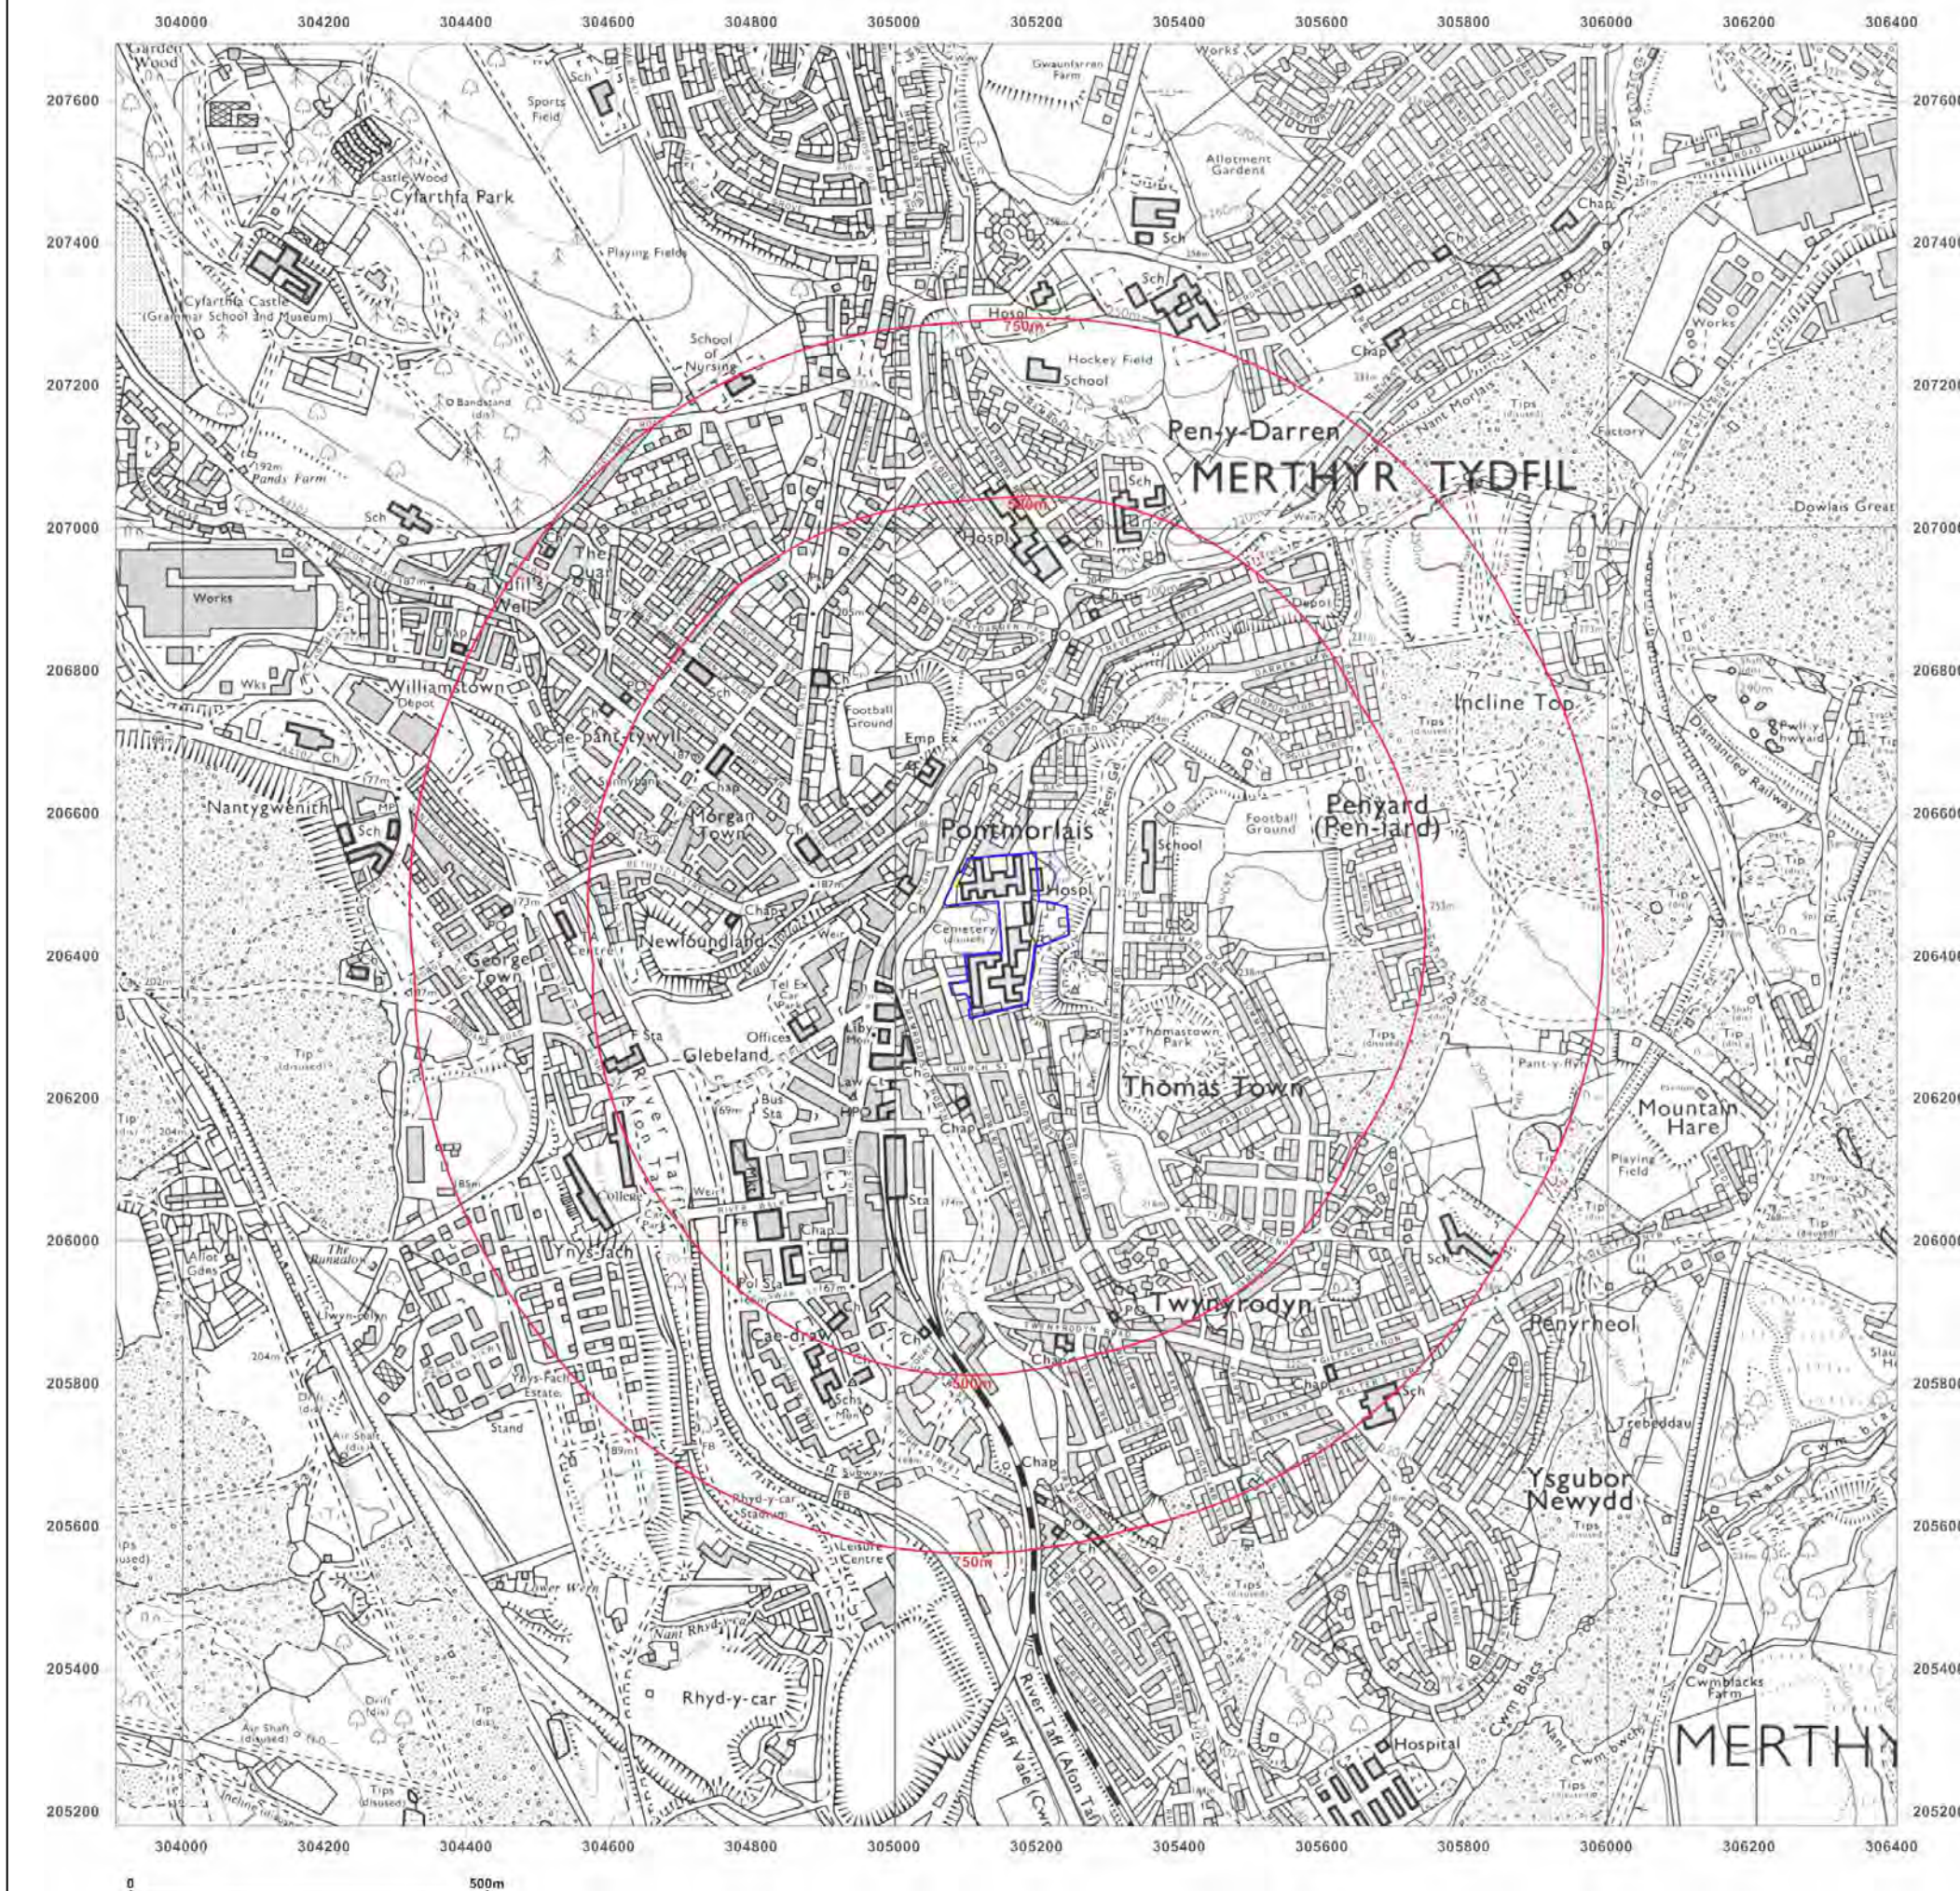

Site Details:

MERTHYR TYDFIL, CF47 0BL

Client Ref: 19-S715-TPC-21988
Report Ref: HMD-154-6127015
Grid Ref: 305157, 206430

Map Name: National Grid

Map date: 1982

Scale: 1:10,000

Printed at: 1:10,000



Surveyed 1974
 Revised 1982
 Edition N/A
 Copyright N/A
 Levelled N/A




Produced by
 Groundsure Insights
 T: 08444 159000
 E: info@groundsure.com
 W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 26 June 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

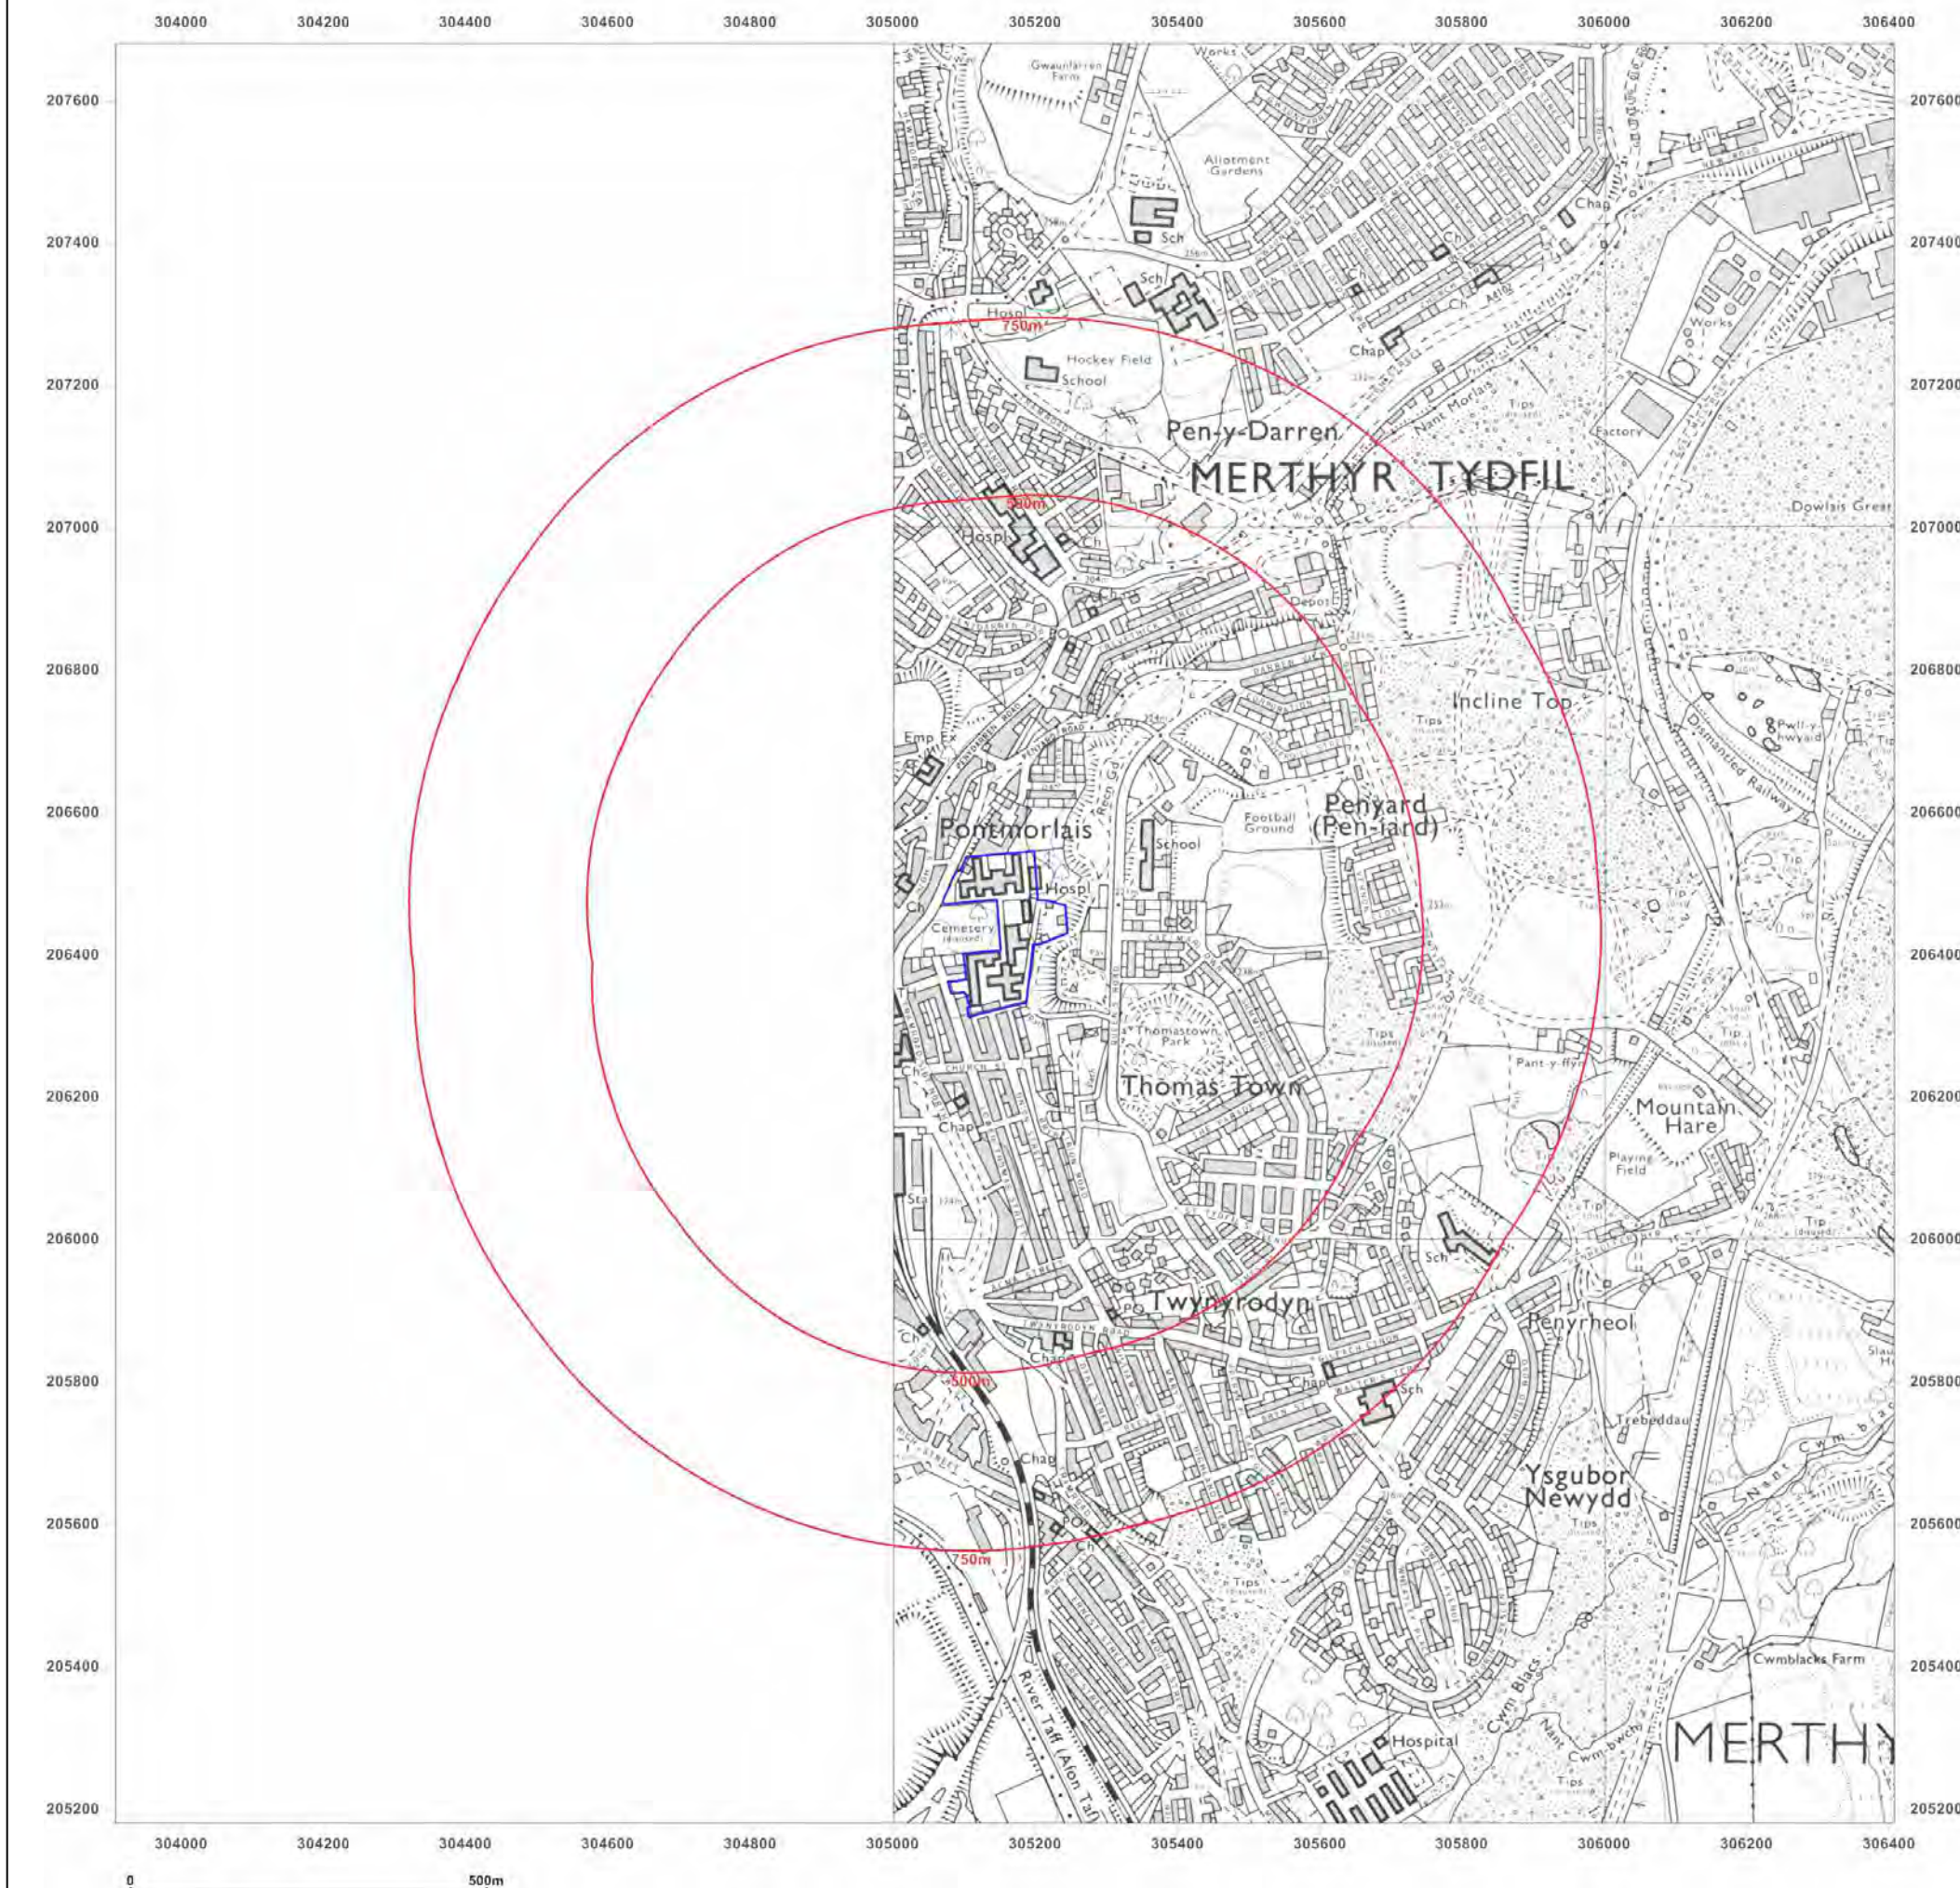

Site Details:

MERTHYR TYDFIL, CF47 0BL

Client Ref: 19-S715-TPC-21988
Report Ref: HMD-154-6127015
Grid Ref: 305157, 206430

Map Name: National Grid

Map date: 1992

Scale: 1:10,000

Printed at: 1:10,000



Surveyed 1990
 Revised 1992
 Edition N/A
 Copyright N/A
 Levelled N/A

Surveyed 1989
 Revised 1992
 Edition N/A
 Copyright N/A
 Levelled N/A




Produced by
 Groundsure Insights
 T: 08444 159000
 E: info@groundsure.com
 W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 26 June 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

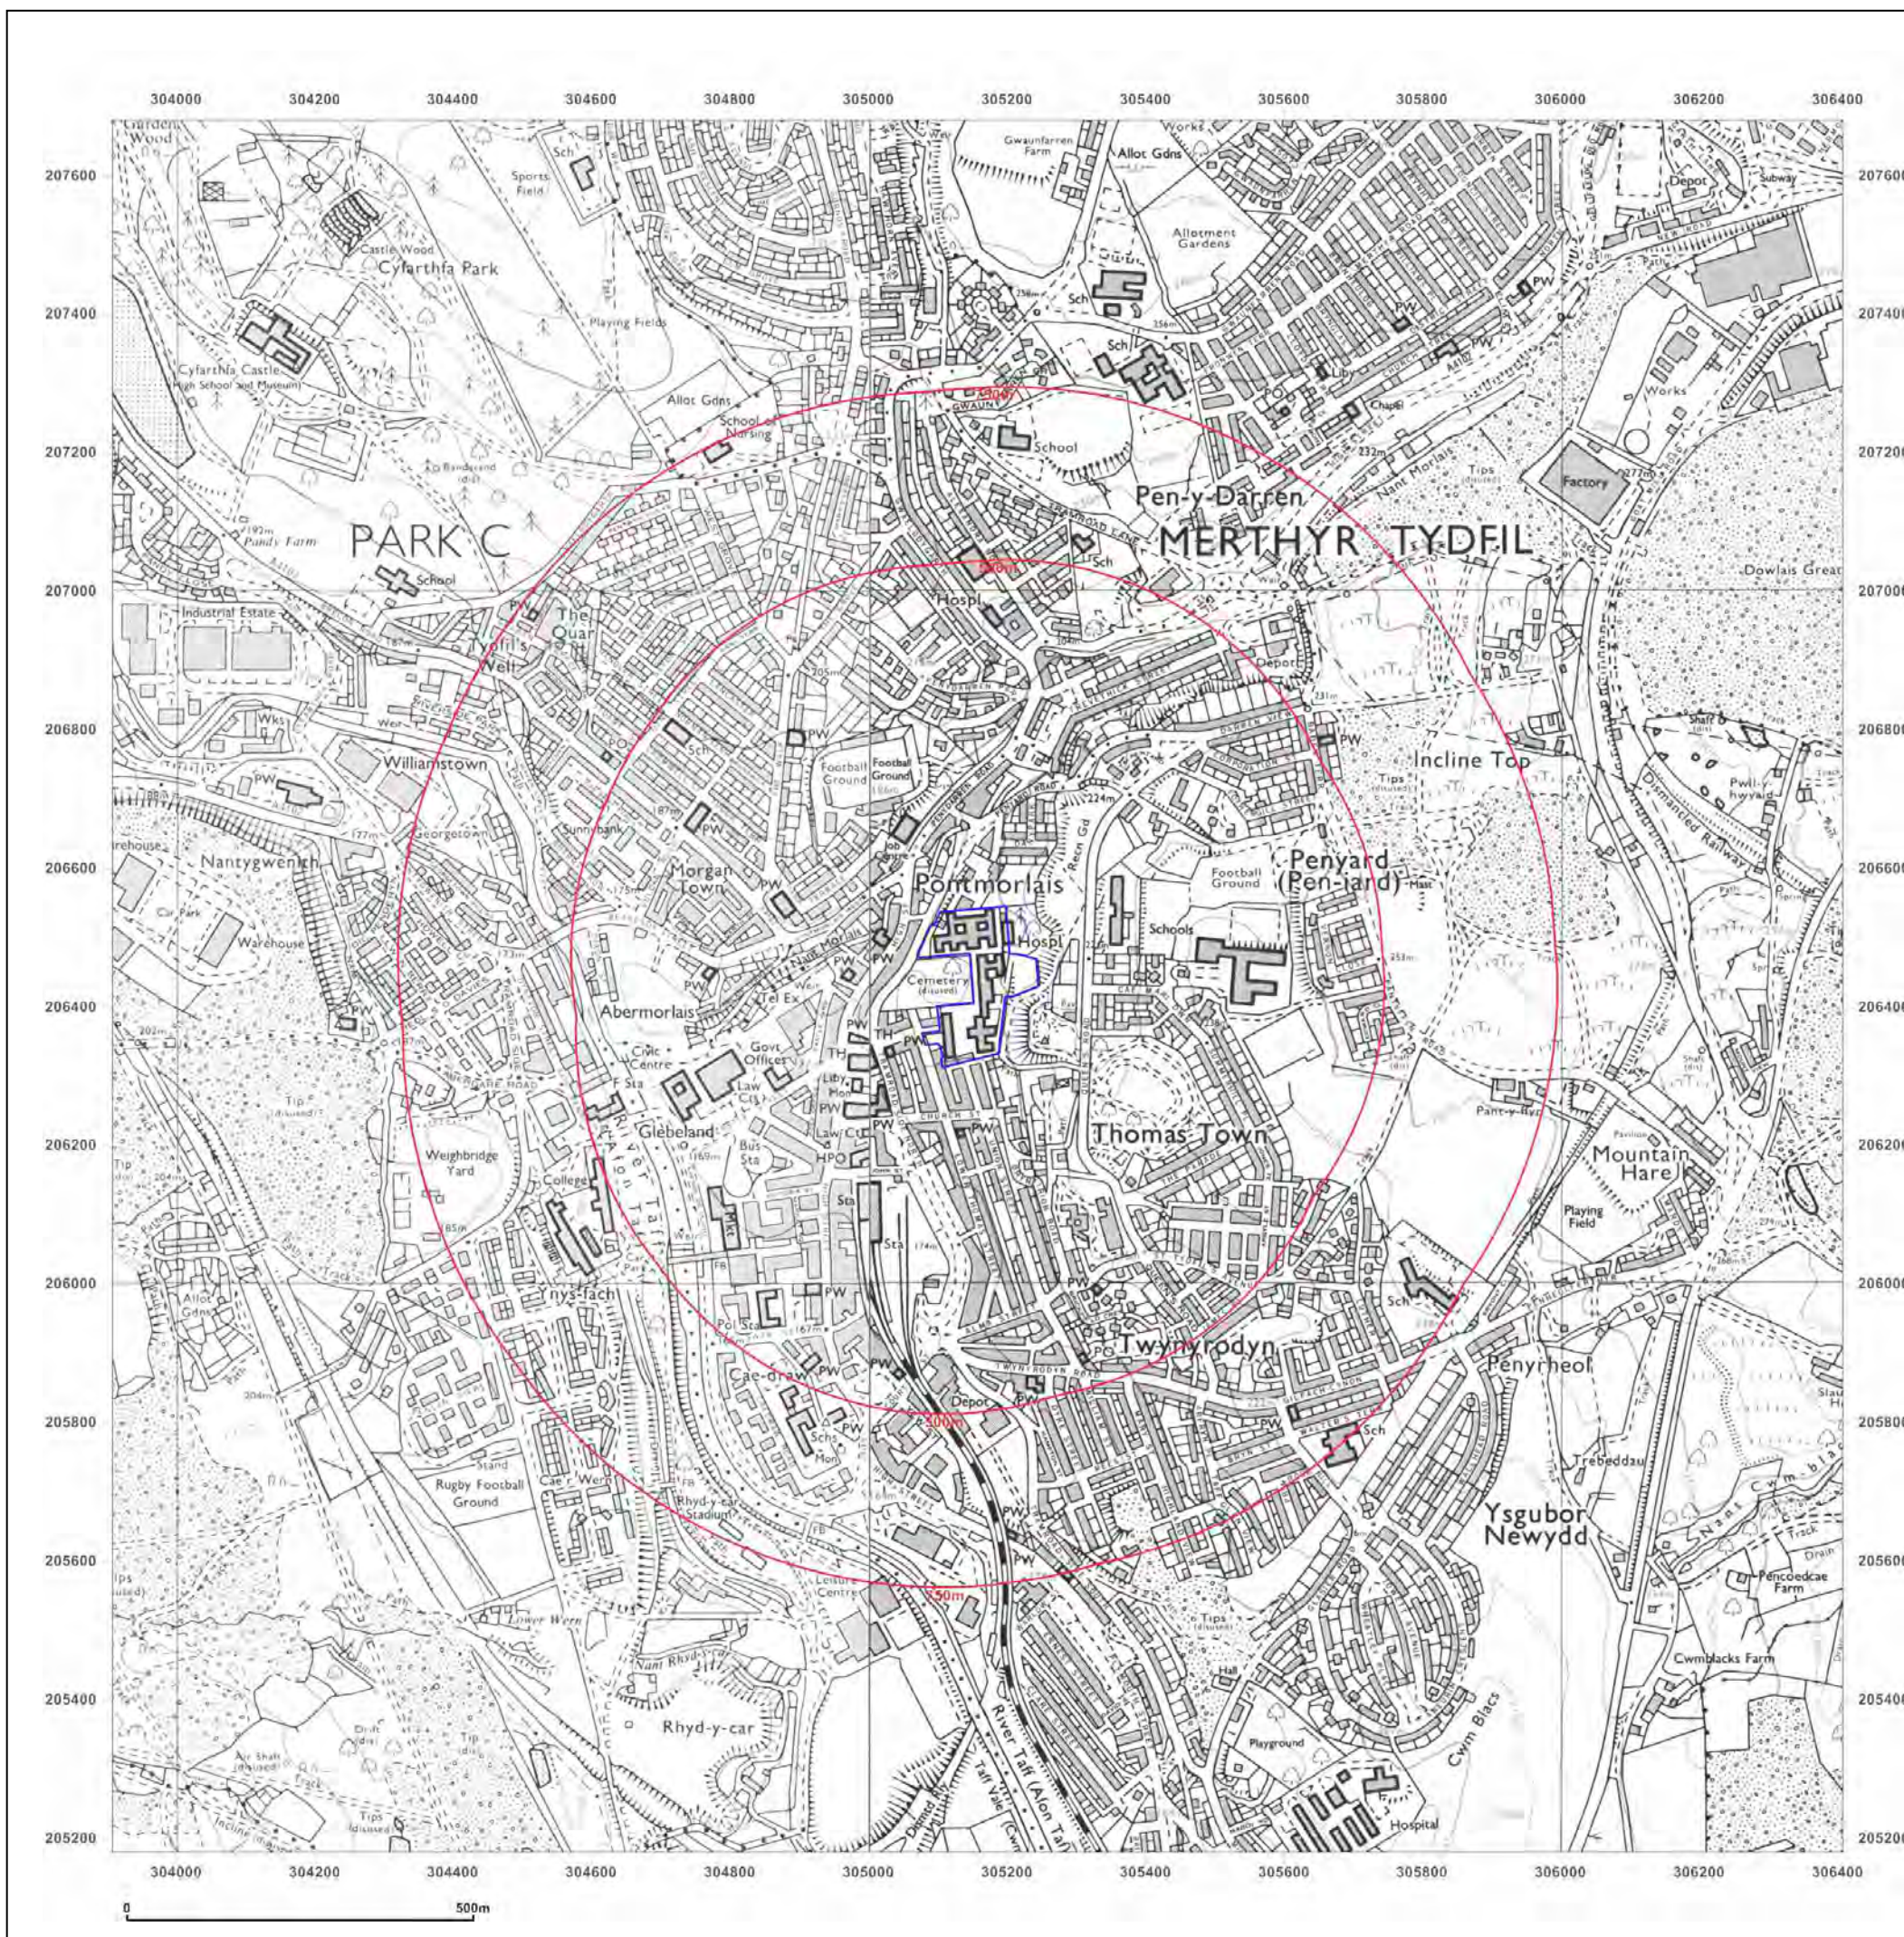

Site Details:

MERTHYR TYDFIL, CF47 0BL

Client Ref: 19-S715-TPC-21988
Report Ref: HMD-154-6127015
Grid Ref: 305157, 206430

Map Name: 1:10,000 Raster

Map date: 2002

Scale: 1:10,000

Printed at: 1:10,000




Produced by
Groundsure Insights
T: 08444 159000
E: info@groundsure.com
W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 26 June 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

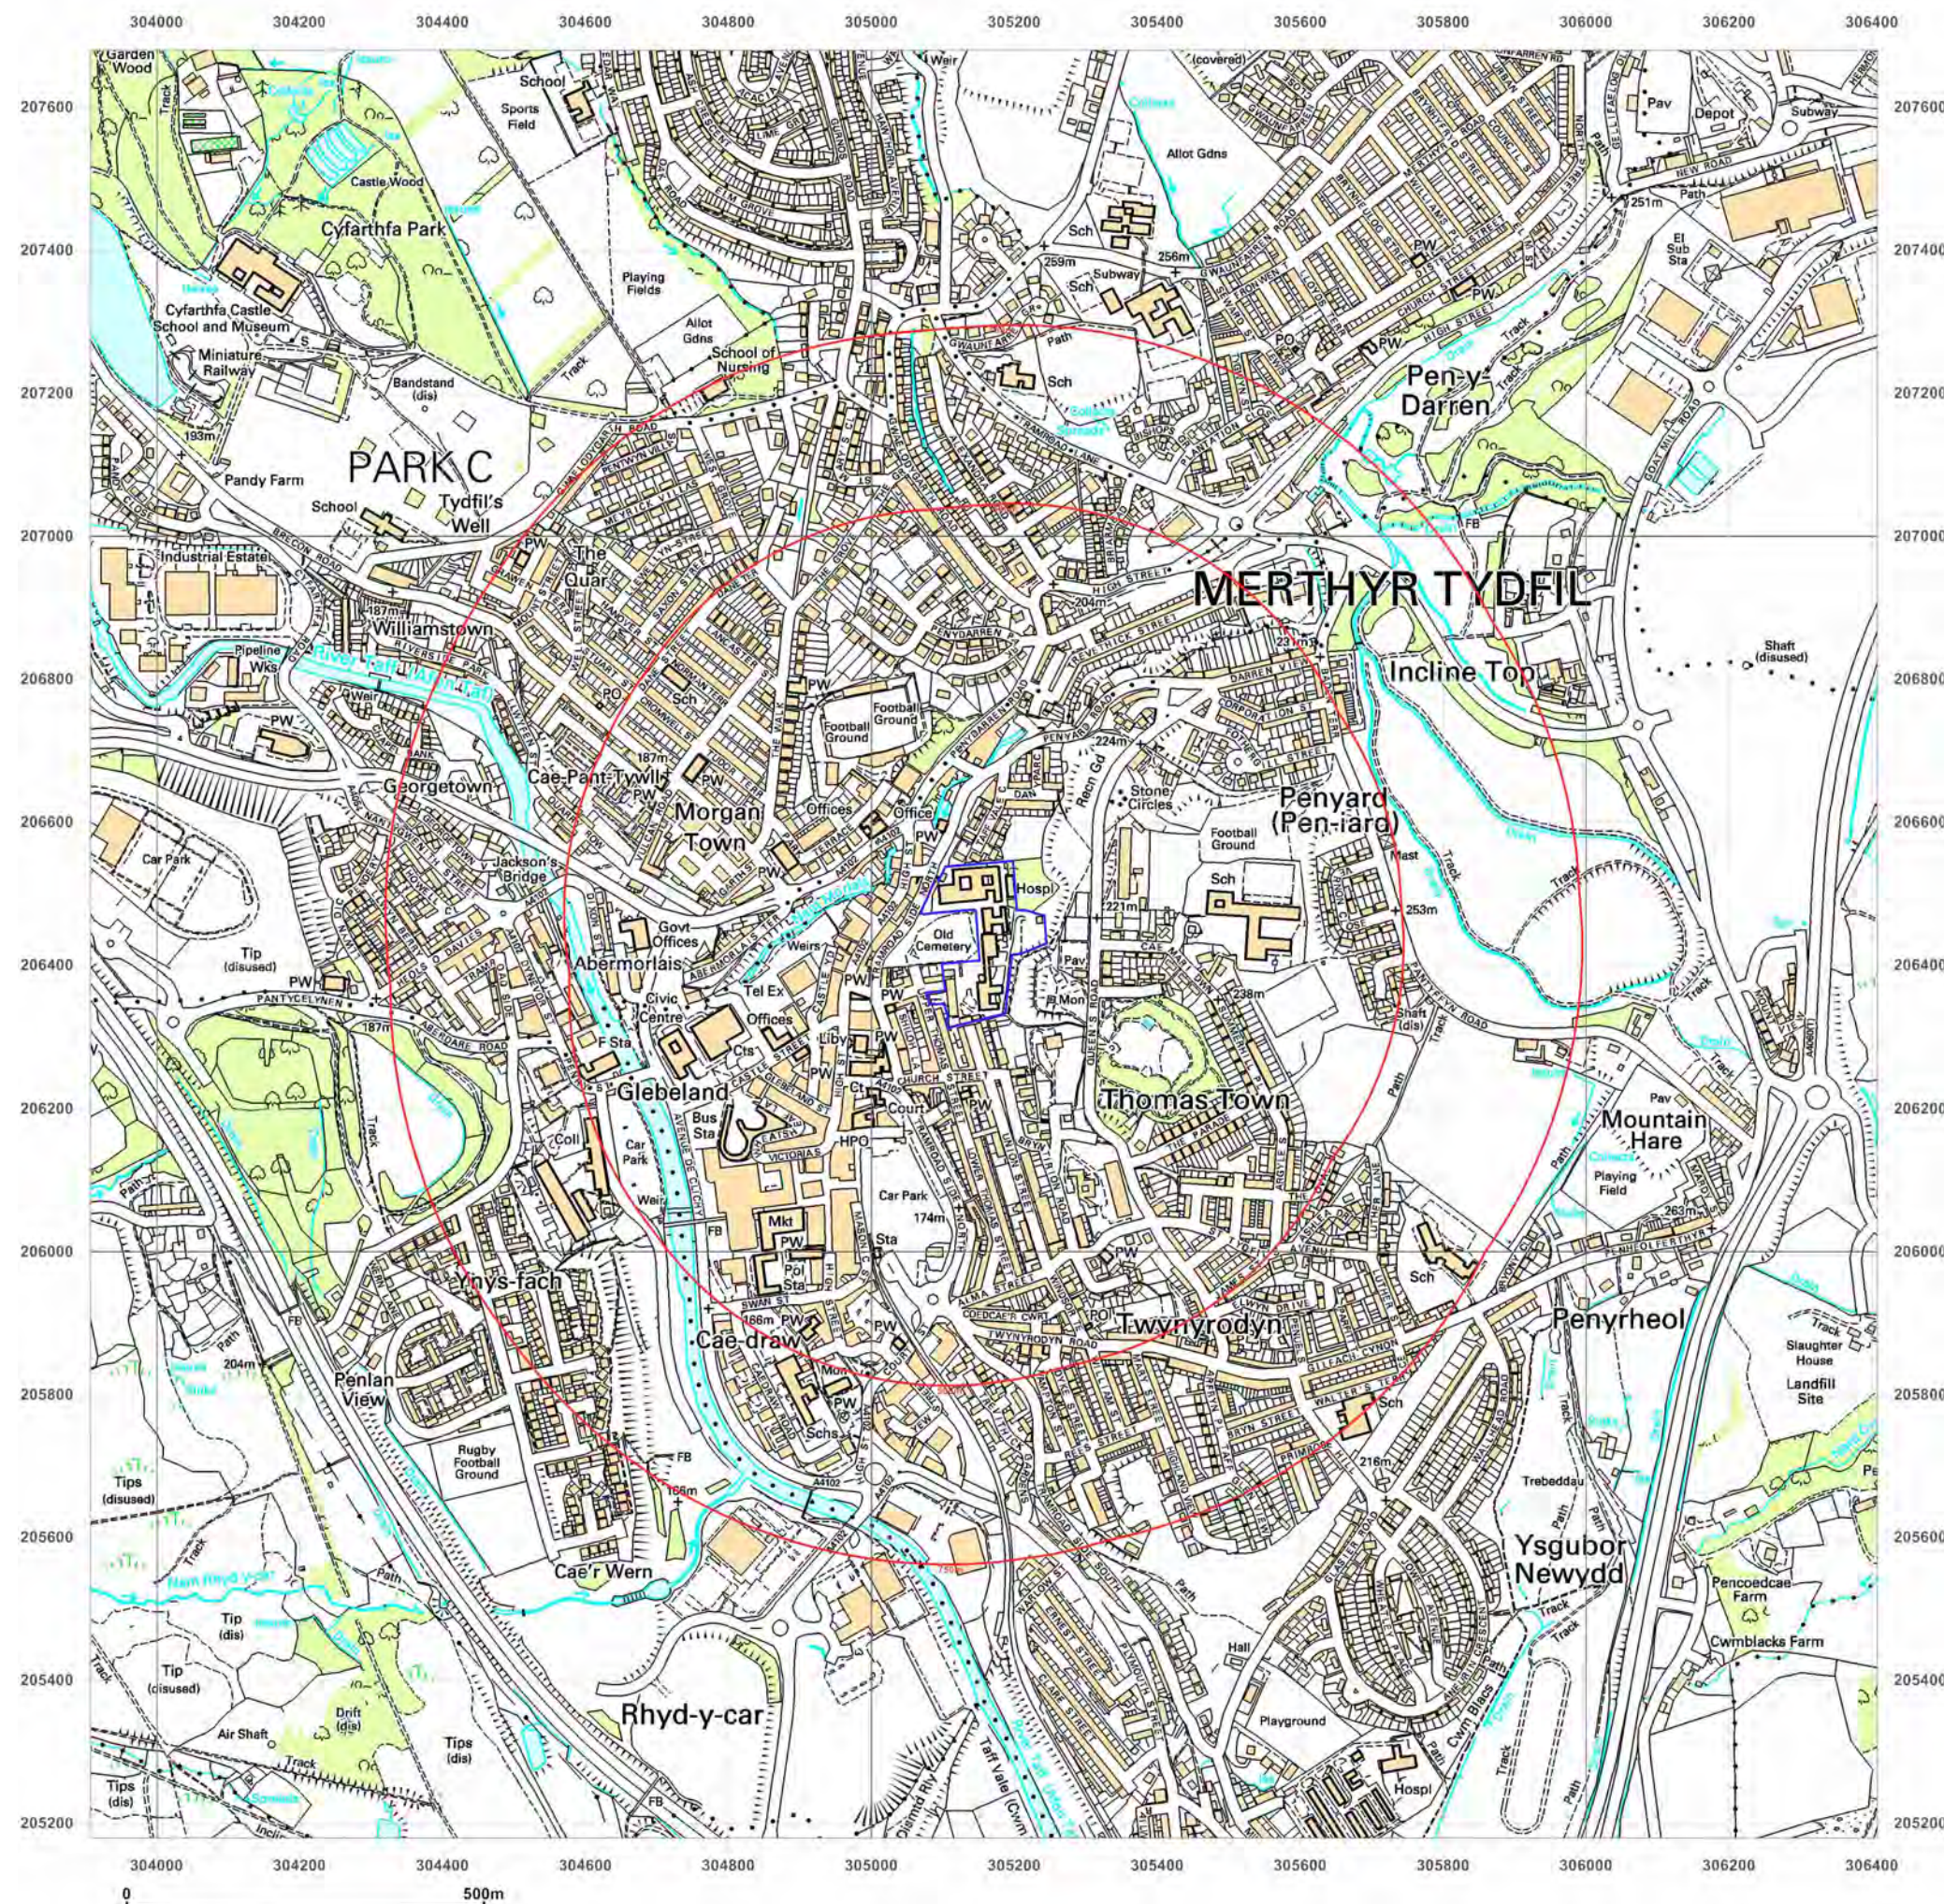

Site Details:

MERTHYR TYDFIL, CF47 0BL

Client Ref: 19-S715-TPC-21988
Report Ref: HMD-154-6127015
Grid Ref: 305157, 206430

Map Name: National Grid

Map date: 2010

Scale: 1:10,000

Printed at: 1:10,000



Produced by
 Groundsure Insights
 T: 08444 159000
 E: info@groundsure.com
 W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 26 June 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf



Site Details:

MERTHYR TYDFIL, CF47 0BL

Client Ref: 19-S715-TPC-21988
Report Ref: HMD-154-6127015
Grid Ref: 305157, 206430

Map Name: National Grid

Map date: 2014

Scale: 1:10,000

Printed at: 1:10,000




Produced by
 Groundsure Insights
 T: 08444 159000
 E: info@groundsure.com
 W: www.groundsure.com

© Crown copyright and database rights 2018 Ordnance Survey 100035207

Production date: 26 June 2019

Map legend available at:
www.groundsure.com/sites/default/files/groundsure_legend.pdf

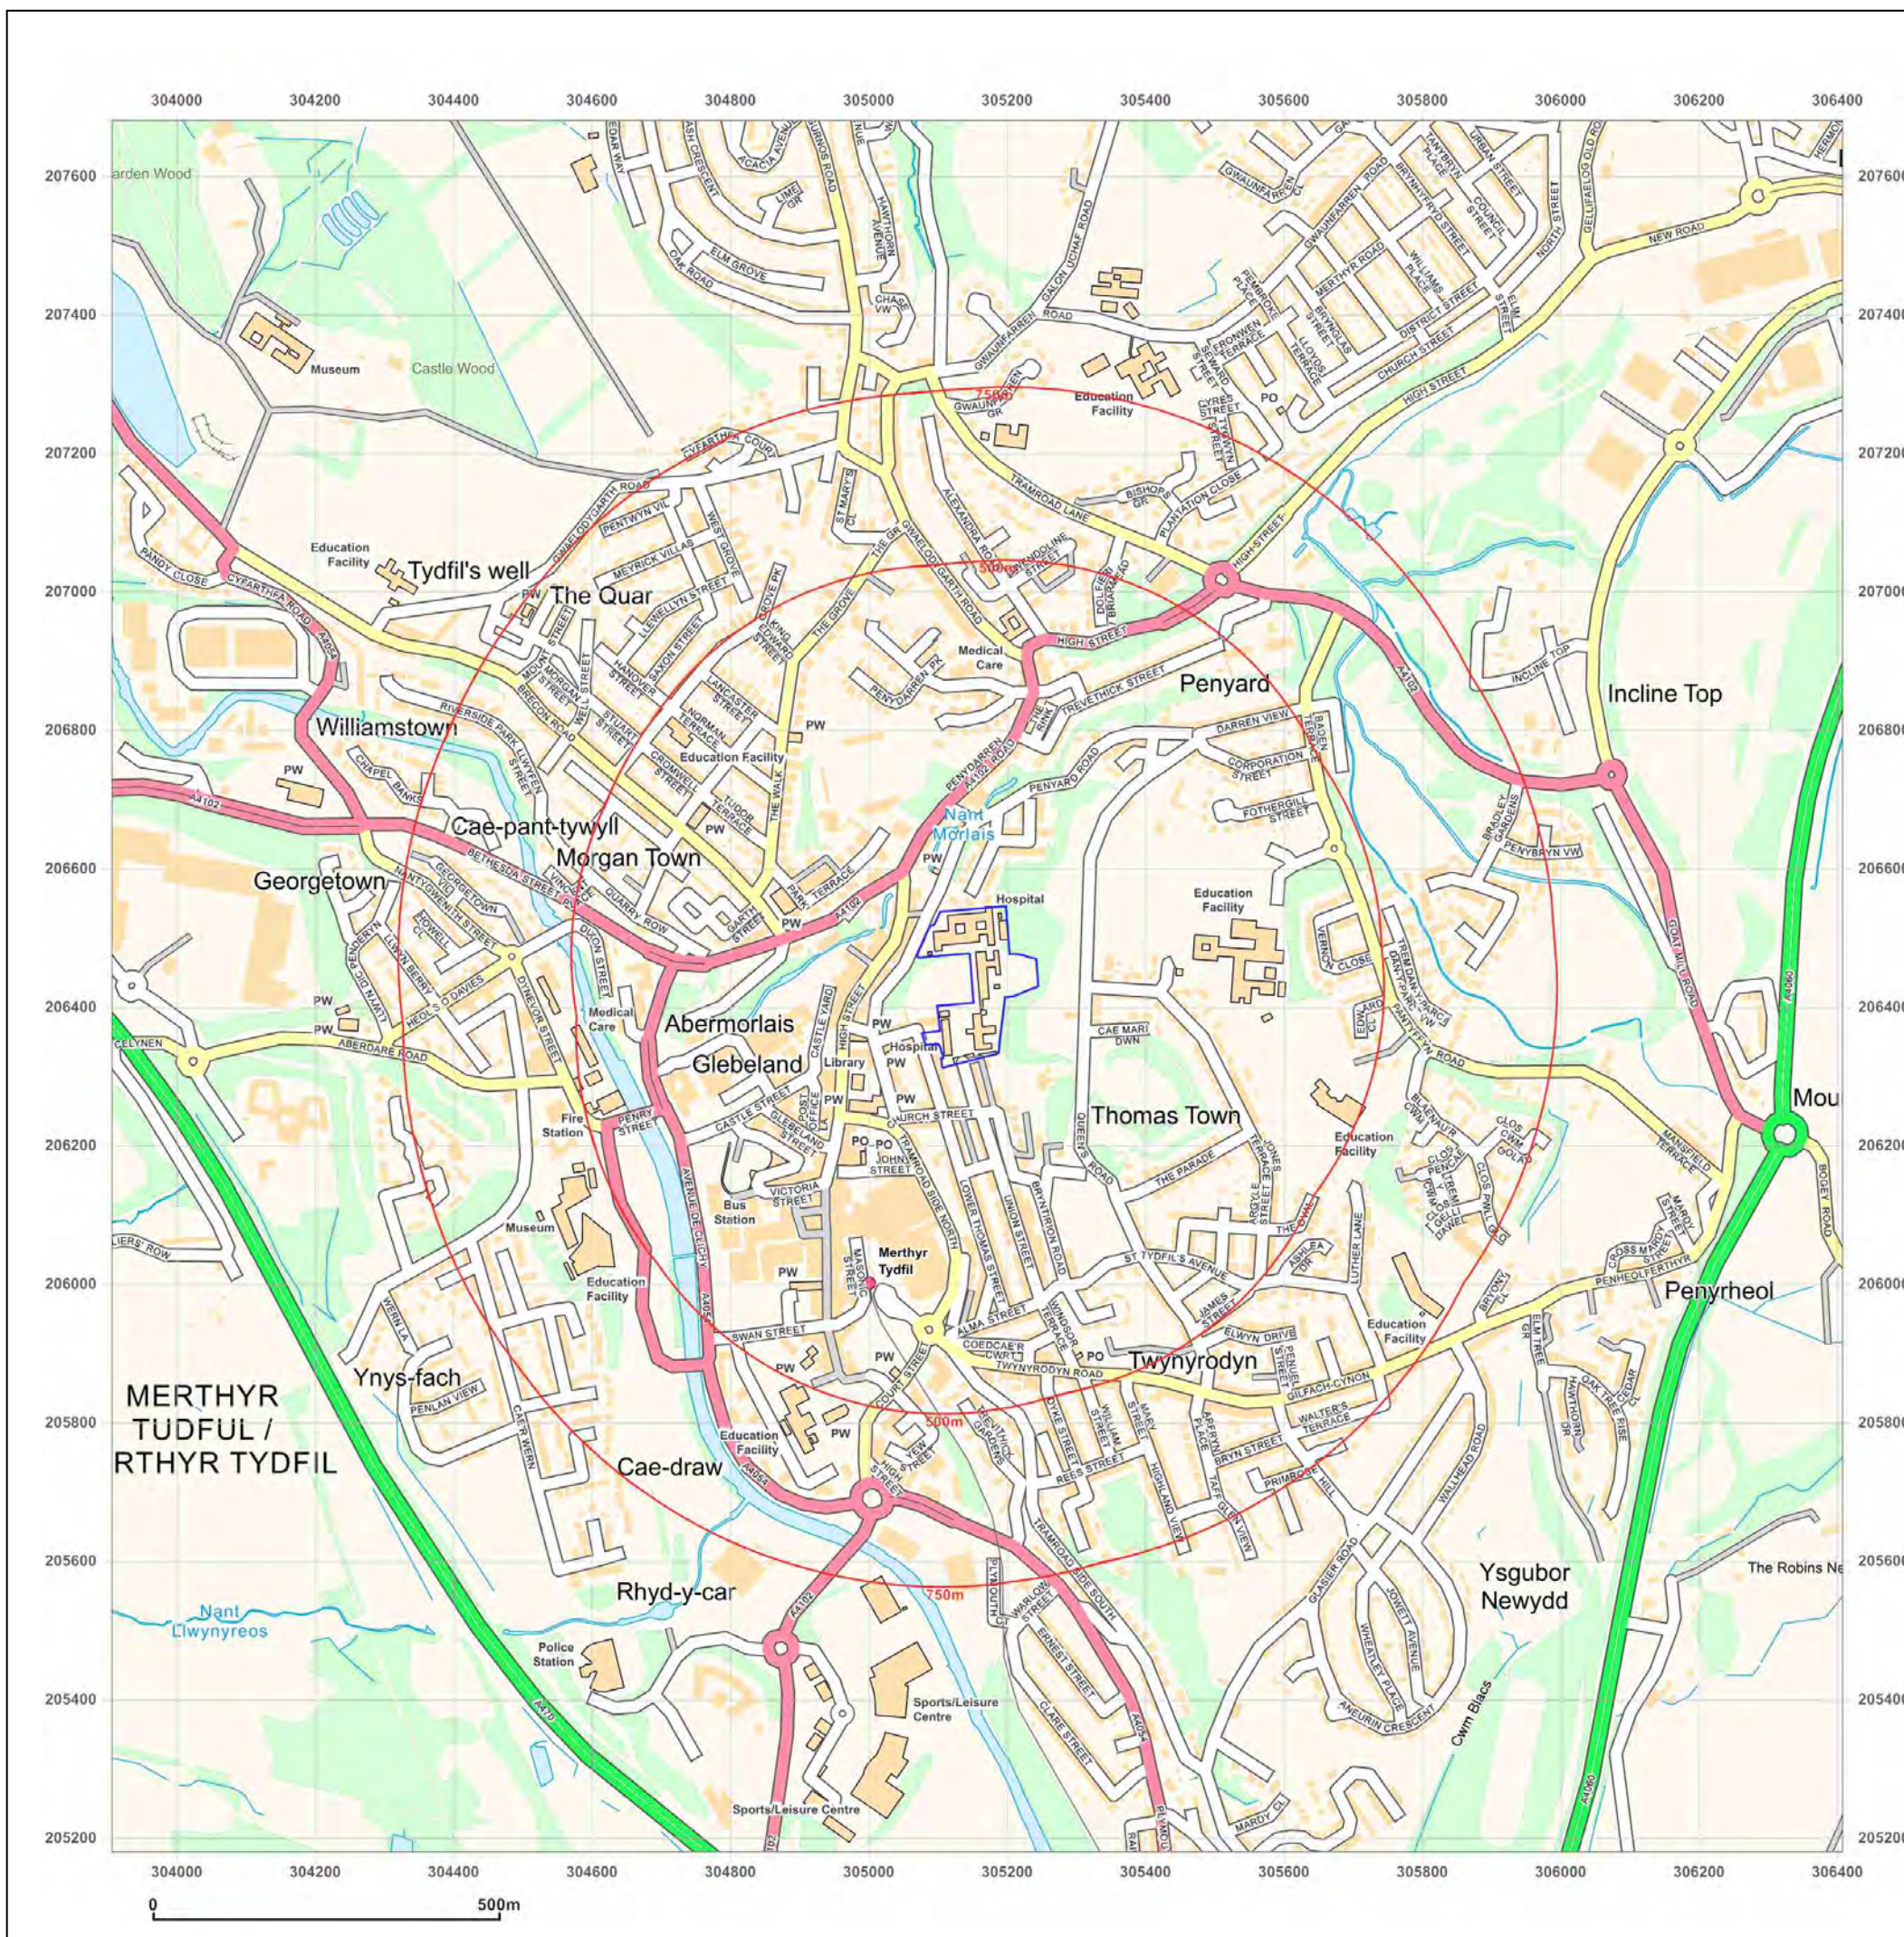

APPENDIX 4 ▪ Coal Mining Consultants Report




The Coal
Authority

Consultants Coal Mining Report

305181 206444
Merthyr Tydfil

Date of enquiry:	26 June 2019
Date enquiry received:	26 June 2019
Issue date:	26 June 2019
Our reference:	51002152819001
Your reference:	HMD-154-6127016

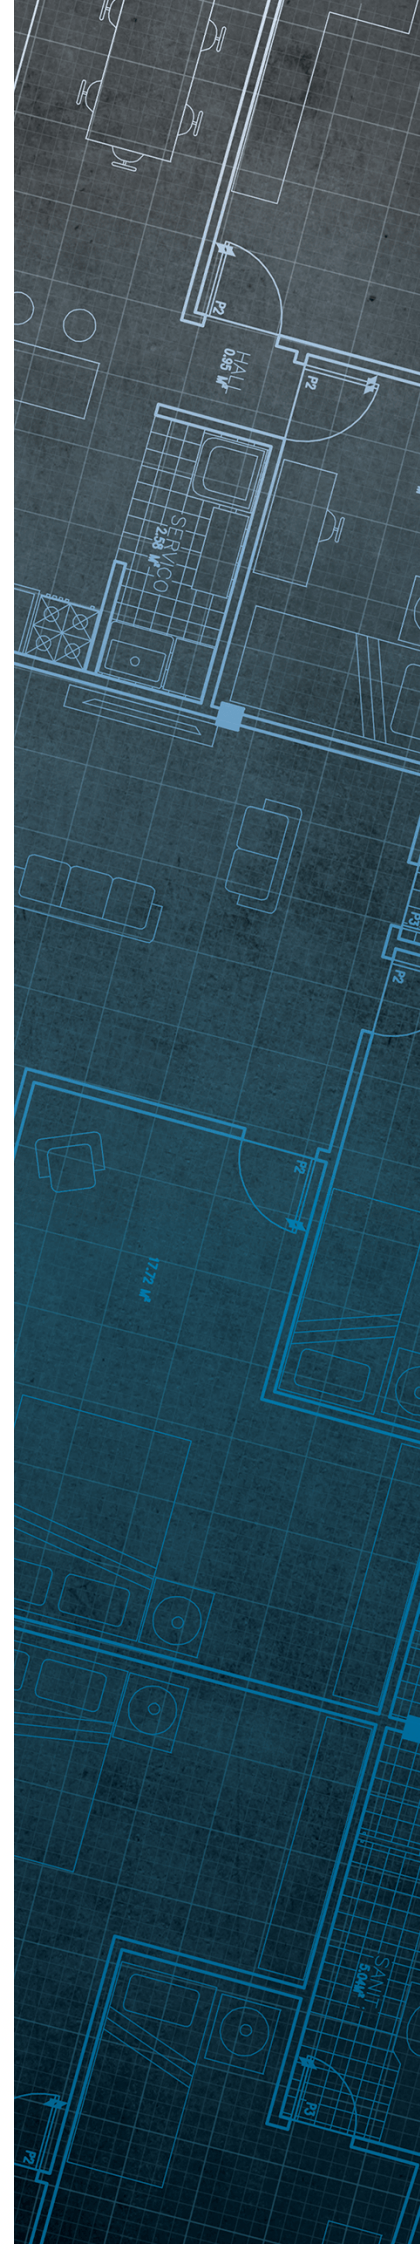

Consultants

Coal Mining Report

This report is based on and limited to the records held by the Coal Authority at the time the report was produced.

Client name

GROUNDSURE LIMITED

Enquiry address

305181 206444
Merthyr Tydfil

How to contact us

0345 762 6848 (UK)
+44 (0)1623 637 000 (International)

200 Lichfield Lane
Mansfield
Nottinghamshire
NG18 4RG


www.groundstability.com

 @coalauthority

 /company/the-coal-authority

 /thecoalauthority

 /thecoalauthority

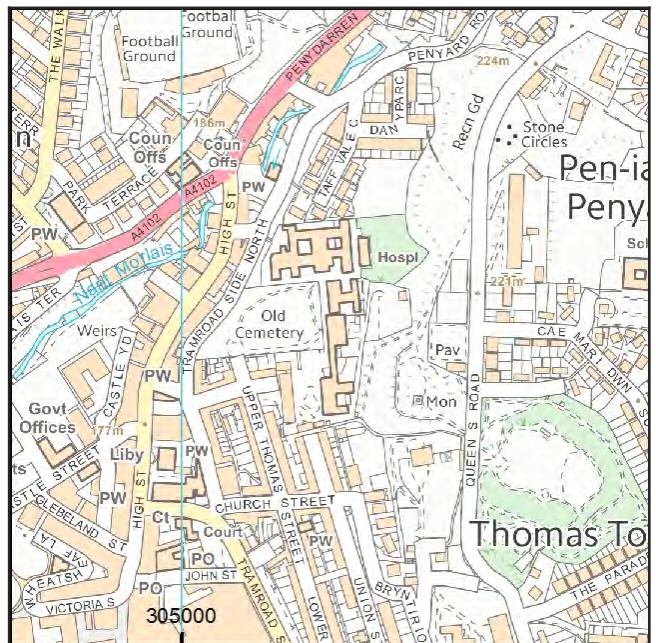

Approximate position of property



Reproduced by permission of
Ordnance Survey on behalf of
HMSO. © Crown copyright and
database right 2018. All rights
reserved.

Ordnance Survey Licence number: 100020315

Section 1 – Mining activity and geology

Past underground mining

No past mining recorded.

Probable unrecorded shallow workings

None.

Spine roadways at shallow depth

No spine roadway recorded at shallow depth.

Mine entries

None recorded within 100 metres of the enquiry boundary.

Abandoned mine plan catalogue numbers

None available.

Outcrops

No outcrops recorded.

Geological faults, fissures and breaklines

No faults, fissures or breaklines recorded.

Opencast mines

Please refer to the “Summary of findings” map (on separate sheet) for details of any opencast areas within 500 metres of the enquiry boundary.

Coal Authority managed tips

None recorded within 500 metres of the enquiry boundary.

Section 2 – Investigative or remedial activity

Please refer to the 'Summary of findings' map (on separate sheet) for details of any activity within the area of the site boundary.

Site investigations

None recorded within 50 metres of the enquiry boundary.

Remediated sites

None recorded within 50 metres of the enquiry boundary.

Coal mining subsidence

The Coal Authority has not received a damage notice or claim for the subject property, or any property within 50 metres of the enquiry boundary, since 31 October 1994.

There is no current Stop Notice delaying the start of remedial works or repairs to the property.

The Coal Authority is not aware of any request having been made to carry out preventive works before coal is worked under section 33 of the Coal Mining Subsidence Act 1991.

Mine gas

None recorded within 500 metres of the enquiry boundary.

Mine water treatment schemes

None recorded within 500 metres of the enquiry boundary.

Section 3 – Licensing and future mining activity

Future underground mining

None recorded.

Coal mining licensing

None recorded within 200 metres of the enquiry boundary.

Court orders

None recorded.

Section 46 notices

No notices have been given, under section 46 of the Coal Mining Subsidence Act 1991, stating that the land is at risk of subsidence.

Withdrawal of support notices

The property is not in an area where a notice to withdraw support has been given.

The property is not in an area where a notice has been given under section 41 of the Coal Industry Act 1994, cancelling the entitlement to withdraw support.

Payments to owners of former copyhold land

The property is not in an area where a relevant notice has been published under the Coal Industry Act 1975/Coal Industry Act 1994.

Section 4 – Further information

Based on the responses in this report, no further information has been highlighted.

Section 5 – Data definitions

The datasets used in this report have limitations and assumptions within their results. For more guidance on the data and the results specific to the enquiry boundary, please **call us on 0345 762 6848** or **email us at groundstability@coal.gov.uk**.

Past underground coal mining

Details of all recorded underground mining relative to the enquiry boundary. Only past underground workings where the enquiry boundary is within 0.7 times the depth of the workings (zone of likely physical influence) allowing for seam inclination, will be included.

Probable unrecorded shallow workings

Areas where the Coal Authority believes there to be unrecorded coal workings that exist at or close to the surface (less than 30 metres deep).

Spine roadways at shallow depth

Connecting roadways either, working to working, or, surface to working, both in-seam and cross measures that exist at or close to the surface (less than 30 metres deep), either within or within 10 metres of the enquiry boundary.

Mine entries

Details of any shaft or adit either within, or within 100 metres of the enquiry boundary including approximate location, brief treatment details where known, the mineral worked from the mine entry and conveyance details where the mine entry has previously been sold by the Authority or its predecessors British Coal or the National Coal Board.

Abandoned mine plan catalogue numbers

Plan numbers extracted from the abandoned mines catalogue containing details of coal and other mineral abandonment plans deposited via the Mines Inspectorate in accordance with the Coal Mines Regulation Act and Metalliferous Mines Regulation Act 1872. A maximum of 9 plan extents that intersect with the enquiry boundary will be included. This does not infer that the workings and/or mine entries shown on the abandonment plan will be relevant to the site/property boundary.

Outcrops

Details of seam outcrops will be included where the enquiry boundary intersects with a conjectured or actual seam outcrop location (derived by either the British Geological Survey or the Coal Authority) or intersects with a defined 50 metres buffer on the coal (dip) side of the outcrop. An indication of whether the Coal Authority believes the seam to be of sufficient thickness and/or quality to have been worked will also be included.

Geological faults, fissures and breaklines

Geological disturbances or fractures in the bedrock. Surface fault lines (British Geological Survey derived data) and fissures and breaklines (Coal Authority derived data) intersecting with the enquiry boundary will be included. In some circumstances faults, fissures or breaklines have been known to contribute to surface subsidence damage as a consequence of underground coal mining.

Opencast mines

Opencast coal sites from which coal has been removed in the past by opencast (surface) methods and where the enquiry boundary is within 500 metres of either the licence area, site boundary, excavation area (high wall) or coaling area.

Coal Authority managed tips

Locations of disused colliery tip sites owned and managed by the Coal Authority, located within 500 metres of the enquiry boundary.

Site investigations

Details of site investigations within 50 metres of the enquiry boundary where the Coal Authority has received information relating to coal mining risk investigation and/or remediation by third parties.

Remediated sites

Sites where the Coal Authority has undertaken remedial works either within or within 50 metres of the enquiry boundary following report of a hazard relating to coal mining under the Coal Authority's Emergency Surface Hazard Call Out procedures.

Coal mining subsidence

Details of alleged coal mining subsidence claims made since 31 October 1994 either within or within 50 metres of the enquiry boundary. Where the claim relates to the enquiry boundary confirmation of whether the claim was accepted, rejected or whether liability is still being determined will be given. Where the claim has been discharged, whether this was by repair, payment of compensation or a combination of both, the value of the claim, where known, will also be given.

Details of any current 'Stop Notice' deferring remedial works or repairs affecting the property/site, and if so the date of the notice.

Details of any request made to execute preventative works before coal is worked under section 33 of the Coal Mining Subsidence Act 1991. If yes, whether any person withheld consent or failed to comply with any request to execute preventative works.

Mine gas

Reports of alleged mine gas emissions received by the Coal Authority, either within or within 500 metres of the enquiry boundary that subsequently required investigation and action by the Coal Authority to mitigate the effects of the mine gas emission.

Mine water treatment schemes

Locations where the Coal Authority has constructed or operates assets that remove pollutants from mine water prior to the treated mine water being discharged into the receiving water body.

These schemes are part of the UK's strategy to meet the requirements of the Water Framework Directive. Schemes fall into 2 basic categories: Remedial – mitigating the impact of existing pollution or Preventative – preventing a future pollution incident.

Mine water treatment schemes generally consist of one or more primary settlement lagoons and one or more reed beds for secondary treatment. A small number are more specialised process treatment plants.

Future underground mining

Details of all planned underground mining relative to the enquiry boundary. Only those future workings where the enquiry boundary is within 0.7 times the depth of the workings (zone of likely physical influence) allowing for seam inclination will be included.

Coal mining licensing

Details of all licenses issued by the Coal Authority either within or within 200 metres of the enquiry boundary in relation to the under taking of surface coal mining, underground coal mining or underground coal gasification.

Court orders

Orders in respect of the working of coal under the Mines (Working Facilities and Support) Acts of 1923 and 1966 or any statutory modification or amendment thereof.

Section 46 notices

Notice of proposals relating to underground coal mining operations that have been given under section 46 of the Coal Mining Subsidence Act 1991.

Withdrawal of support notices

Published notices of entitlement to withdraw support and the date of the notice. Details of any revocation notice withdrawing the entitlement to withdraw support given under Section 41 of the Coal Industry Act 1994.

Payment to owners of former copyhold land

Relevant notices which may affect the property and any subsequent notice of retained interests in coal and coal mines, acceptance or rejection notices and whether any compensation has been paid to a claimant.

APPENDIX 5 ▪ Asbestos Register and Summary

Materials Register : Combined - All Records

Created On 25/10/2012

Showing records for	All Asbestos Types and All Product Types
Showing material records for 1 Site	

Important note	Disclaimer
Please note that this document is intended as a guideline only and is to be used in conjunction with the full report and specific material assessment information	Where survey information has been recently added, such information should be regarded as interim, pending the issue of the final report. Final reports are available in the 'attachments' section of the site view.

Material Assessments

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0001	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Stairs TS221	Beige tile and bitumen 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0002	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Stairs Ts221	Brown edging strips 50.0m Run	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0003	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Cupboard 1	Beige tile and bitumen 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0004	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Meeting room TS207	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0005	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Male wc TS203	Black skirting 50.0m Run	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0006	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Male wc TS203	Grey linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0007	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Consulting TS201	Beige tile and bitumen 25.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0008	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Records/reception TS208	Beige tile and bitumen 25.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0009	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Store TS204	White tile and bitumen 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0010	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Store TS202	White tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0011	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Female wc TS205	Black skirting 50.0m Run	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0012	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Female wc TS205	Grey linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0013	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Admissions TS206	Beige tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0014	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Senior nurse TS209	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0015	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Corridor TS218	White tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0016	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Lobby TS211	White tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0017	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Medical records TS217	Grey linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0018	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Medical records TS217	Black skirting 50.0m Run	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0019	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Consulting TS216	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0020	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Secretaries TS215	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0021	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Consulting TS210	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0022	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Consulting TS214	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0023	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Store TS213	Beige tile and bitumen 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0024	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Consulting TS212	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0025	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Stairs TS220	Brown vinyl 50.0m Run	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0026	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Stairs TS220	Beige tile 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0027	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Stairs TS220	Brown vinyl 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0028	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Stairs TS220	Boxing to pipe work 50.0m ²	Sampled	Insulating Board	No Visible	Unsealed Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0029	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Store TS220a	Beige tile 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0030	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Lobby TS219	Bitumen membrane Small Amounts	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0031	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Office TS236	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0032	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Seclusion room TS242	Black skirting 50.0m Run	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0033	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Assisted bathroom TS244	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0034	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Store TS243	No Asbestos N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0035	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Male wc TS241	Black skirting 25.0m Run	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0036	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Female wc TS240	Black skirting 25.0m Run	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0037	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Disabled wc TS239	Black skirting 25.0m Run	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0038	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Shower TS238	Black skirting 25.0m Run	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0039	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	5 Bed ward TS245	Beige tile and bitumen 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0040	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Nurse sub-station TS246	Beige tile and bitumen 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0041	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Corridor TS250	Beige tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0042	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Corridor TS250	Light cream tile and bitumen 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0043	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Corridor TS250	Cream tile and bitumen Small Amounts	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0044	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	5 Bed ward TS247	Beige tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0045	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Smoking room TS248	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0046	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Day/dining room TS248a	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0047	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Smoking room TS248b	Beige linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0048	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Ward pantry TS249	Bitumen paste Small Amounts	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0049	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Office TS237	Insulating panel 10.0m ²	Sampled	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0050	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Corridor TS253 Ceiling void	Flange gasket Small Amounts	Sampled	Gasket	No Visible	Encapsulated Textile/Paper	Chrysotile	Low	5	5	10
1077922/0051	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Clean utility TS233 Underside of sink	Acoustic pads 2 Items	Sampled	Bitumen	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	4	7
1077922/0052	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Clean utility TS233	Brown tile and bitumen 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0053	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Corridor TS253	Beige tile and bitumen 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0054	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Corridor TS251	Cream tile and bitumen Small Amounts	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0055	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Lift TS251a	Cream tile and bitumen Small Amounts	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0056	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Lift TS251a	Light brown tile 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0057	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Stairs TS252	Insulating panel 10.0m ²	Visually Similar To	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0058	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Dirty utility TS232	White panels 50.0m ²	Sampled	Insulating Board	No Visible	Unsealed Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0059	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Dirty utility TS232 Underside of sink	Acoustic pads 2 Items	Sampled	Bitumen	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	4	7
1077922/0060	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Dirty utility TS232	Black skirting 25.0m Run	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0061	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Lift TS251a Electric Cupboard	Electric box N/A	Presumed Asbestos	Rope	No Visible	N/A	Asbestos	Low	5	0	5
1077922/0062	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Wc TS235	Beige tile and bitumen 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0063	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Staff base TS234	White panels 50.0m ²	Visually Similar To	Insulating Board	No Visible	Unsealed Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0064	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Staff base TS234	Beige tile and bitumen 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0065	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Day Room TS222	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0066	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Office TS223	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0067	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Single bed ward TS224	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0068	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Single bed ward TS225	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0069	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Single bed ward TS226	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0070	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Store TS255	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0071	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Staff wc TS254a	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0072	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Wc TS228	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0073	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Bathroom TS227	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0074	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Corridor TS254	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0075	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Secure room TS229	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0076	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	5 bed war TS231	Beige tile and bitumen 50.0m Run	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0077	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Wc TS230a	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0078	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 1	Bathroom TS230	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0079	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Utility TS262	Acoustic pad Small Amounts	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0080	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Store TS290a	Fawn coloured tile and bitumen 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0081	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Stairs/lobby TS290	Black nosing 10.0m Run	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0082	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Store TS290a	Brown nosing Small Amounts	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0083	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Wc TS283	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0084	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Corridor TS289	White panels 50.0m ²	Sampled	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0085	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Corridor TS289	Beige tile and bitumen 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0086	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Single bed ward TS264	Beige tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0087	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Single bed ward TS264	White panels 50.0m ²	Visually Similar To	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0088	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Single bed ward TS265	White panels 50.0m ²	Visually Similar To	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0089	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Single bed TS265	Beige tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0090	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	5 bed ward TS266	White panels 50.0m ²	Visually Similar To	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0091	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	5 bed ward TS266	Beige tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0092	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Single bed ward TS261	White panels 50.0m ²	Visually Similar To	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0093	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Single bed TS261	Beige tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0094	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Stairs/lobby TS290	White panels 50.0m ²	Visually Similar To	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0095	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Single bed ward TS260	White panels 50.0m ²	Visually Similar To	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0096	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Single bed ward TS260	Beige tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0097	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Male wc TS259	White panels 10.0m ²	Visually Similar To	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0098	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Female wc TS258	White panels 50.0m ²	Visually Similar To	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0099	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	5 bed ward TS257	White panels 50.0m ²	Visually Similar To	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0100	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	5 bed ward TS257	Beige tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0101	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	5 bed ward TS257	Cream tie and bitumen Small Amounts	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0102	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Dirty utility TS267	White panel 50.0m ²	Sampled	Insulating Board	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0103	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Dirty utility TS267 Underside of sink	Acoustic pad 1 Item	Sampled	Bitumen	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	4	7
1077922/0104	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Wc TS270	Beige tile and bitumen 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0105	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Wc TS270	White panel 5.00m ²	Visually Similar To	Insulating Board	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0106	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Staff base TS269	Cream tile and bitumen 5.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0107	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Staff base TS269	White panel 5.00m ²	Visually Similar To	Insulating Board	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0108	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Office TS271	Bitumen paper insulator 50.0m ²	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0109	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Corridor TS286	Cream tie and bitumen Small Amounts	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0110	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Switch TS272a	Beige tile and bitumen 2.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0111	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 3	Lift motor room	No Access N/A	No Access - Presumed Asbestos	Select Product	No Visible	N/A	No Access	Very Low	3	0	3
1077922/0112	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 3	Lift motor room Electric box	Electrics N/A	Presumed Asbestos	Rope	No Visible	N/A	Asbestos	Low	5	0	5

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0113	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Office TS272	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0114	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Clean utility TS268 Underside of sink	Acoustic pad 1 Item	Sampled	Bitumen	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	0	3
1077922/0115	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Clean utility TS268	Brown floor tile and bitumen 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0116	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Lift TS288	Fawn coloured tile and bitumen 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0117	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Lift TS288	Cream tie and bitumen Small Amounts	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0118	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Stairs TS282	White panel 50.0m ²	Visually Similar To	Insulating Board	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0119	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Store TS278	No Asbestos N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0120	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Assisted bathroom TS279	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0121	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Bathroom TS277	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0122	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Male wc TS276	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0123	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Disabled wc TS274	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0124	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Waste TS273	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0125	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Female wc TS275	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0126	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Corridor TS285	Beige tile and bitumen 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0127	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Corridor TS285	Cream tile and bitumen Small Amounts	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0128	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Nurse sub-station TS281	Beige tile and bitumen 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0129	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	5 bed ward TS252	Beige tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0130	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	5 bed ward TS280	Beige tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0131	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Smoking room TS283	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0132	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Smoking room TS283a	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0133	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Smoking room TS283b	Beige linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0134	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Ward pantry TS287 Underside of sink	Acoustic pads 4 Items	Sampled	Bitumen	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	4	7
1077922/0135	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 2	Ward pantry TS287	Acoustic pad 1 Item	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0136	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Lift shaft	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0137	Condition Monitoring Survey	Ext	St Tydfils, Psychiatric Unit/G	Front entrance	Tongue and groove boarding 50.0m ²	Sampled	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0138	Condition Monitoring Survey	Ext	St Tydfils, Psychiatric Unit/G	Front of building Wall	Bitumen membrane 50.0m Run	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	Chrysotile	Very Low	2	1	3

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0139	Condition Monitoring Survey	Ext	St Tydfils, Psychiatric Unit/F 1	Adjacent 5 bed ward TS231	Bitumen lining to concrete slabs 50.0m ²	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0140	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Consulting room TF009	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0141	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Psychology office TF010	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0142	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Corridor 2 TF005	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0143	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Consulting room TF008a	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0144	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Consulting room TF008	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0145	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Library TF007	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0146	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Consulting room TF006	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0147	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Female wc TF002	Grey linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0148	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Kitchen TF004	Acoustic pad 1 item	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0149	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Male wc TF003	Black cistern Small Amounts	Sampled	Plastics	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0150	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Lobby	Beige tile and bitumen 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0151	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Corridor 1 TF001	Grey linoleum 5.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0152	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Male wc TF003	Grey linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0153	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Kitchen TF004	Grey linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0154	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Lobby TS016	Grey linoleum 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0155	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Store TF018	Grey linoleum 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0156	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Corridor TF014	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0157	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Consulting room TF017	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0158	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Consulting room TF015	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0159	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Lobby TF011	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0160	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Cupboard TF012	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0161	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Office TF115	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0162	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Office TF116	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0163	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Kitchen TF117	Speckled linoleum 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0164	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Kitchen TF117	Acoustic pad 1 Item	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0165	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Corridor TF132	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0166	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Creditors TF113	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0167	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Office TF114	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0168	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Store TF112	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0169	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Office TF119	Boxing to beam 10.0m ²	Sampled	Insulating Board	No Visible	Painted/Encapsulated Board	Asbestos Removed	Non asbestos	0	0	0
1077922/0170	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Office TF119a Ceiling	Boxing to beam 10.0m ²	Visually Similar To	Insulating Board	No Visible	Painted/Encapsulated Board	Amosite	Low	5	3	8

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0171	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Office TF118	Boxing to beam, and soffit board 10.0m ²	Sampled	Insulating Board	No Visible	Painted/Encapsulated Board	Asbestos Removed	Non asbestos	0	0	0
1077922/0172	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Male wc TF123	Beige linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0173	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Kitchen TF125	Acoustic pads Small Amounts	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0174	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Kitchen TF125	Off white linoleum 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0175	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Photocopier room TF121	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0176	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Corridor TF130	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0177	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Computers TF124	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0178	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Corridor TF129	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0179	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Attic	Bitumen membrane, covers front underside of roof only 50.0m ²	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0180	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Office TF122	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0181	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Supplies TF126	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0182	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Office TF127	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0183	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Office TF128	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0184	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Stairwell TF101	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0185	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Female Wc TF102	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0186	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Office TF103	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0187	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Male wc TF104	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0188	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Secretaries office TF105	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0189	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Store TF106	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0190	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Office TF107	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0191	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Finance Office TF108	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0192	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Corridor TF133	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0193	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Finance Office TF110	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0194	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Director of finance TF111	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0195	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Server TF109	Beige linoleum 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0196	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Stairwell TF201	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0197	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Corridor TF206	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0198	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Store TF202	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0199	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Store TF203	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0200	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Store TF204	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0201	Condition Monitoring Survey	Int	St Tydfils, Central Offices/F 1	Store TF205	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0202	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Secretary TF022	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0203	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Office TF026 Floor	Red linoleum 50.0m ²	Sampled	Vinyl	No Visible	N/A	N/A	Non asbestos	0	0	0
1077922/0204	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Kitchen TF023	Acoustic pad 1 Item	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0205	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Kitchen TF023	Beige linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0206	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Crossroads office TF021	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0207	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Lobby TF020	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0208	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Corridor TF027	Cream tile and bitumen 10.0m ²	Sampled	Vinyl	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	4	7
1077922/0209	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Corridor TF027 Floor	Green tile and bitumen 1.00m ²	Sampled	Vinyl	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	4	7
1077922/0210	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Office TF029	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0211	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Waiting TF028	Beige linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0212	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Lobby TF030	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0213	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Corridor TF027	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0214	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Stairwell TF019	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0215	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Kitchen TF035	Acoustic pad Small Amounts	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0216	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Kitchen TF034	Beige linoleum 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0217	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Corridor TF031	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0218	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Office TF033	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0219	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Office TF032a	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0220	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Office TF032	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0221	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Wc TF035	Black cistern Small Amounts	Sampled	Plastics	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0222	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Wc TF035	Beige linoleum 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0223	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Corridor TF037	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0224	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Office TF037a	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0225	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Boiler/store TF024	Grey floor tile and bitumen 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0226	Condition Monitoring Survey	Int	St Tydfils, Central Offices/B	Boiler Room Electric boxes	Boiler Room Wall N/A	Presumed Asbestos	Rope	No Visible	N/A	Asbestos	Low	5	0	5
1077922/0227	Condition Monitoring Survey	Int	St Tydfils, Central Offices/B	Boiler Room Electric boxes	Fuse flash guards presumed to be inside electrics Small Amounts	Presumed Asbestos	Cloth	No Visible	N/A	Asbestos	Low	5	0	5
1077922/0229	Condition Monitoring Survey	Int	St Tydfils, Central Offices/B	Boiler Room	Debris Small Amounts	Sampled	Debris	Visible Debris	Debris	Asbestos Removed	Non asbestos	0	0	0
1077922/0230	Condition Monitoring Survey	Int	St Tydfils, Central Offices/B	Boiler Room	White pipe lagging Small Amounts	Presumed Asbestos	Thermal Lagging	Visible Debris	Debris	Asbestos Removed	Non asbestos	0	0	0
1077922/0231	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Office TF036	Insulating board 50.0m ²	Sampled	Insulating Board	No Visible	Unsealed Board	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0232	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Office TF038	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0233	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Plant room TF025	Cement flue pipe 50.0m Run	Sampled	Cement	No Visible	N/A	Asbestos Removed	Non asbestos	0	0	0
1077922/0234	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Plant room TF025	Rope seal 10.0m Run	Sampled	Rope	No Visible	N/A	Asbestos Removed	Non asbestos	0	0	0
1077922/0235	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Plant room TF025	Flange gasket Small Amounts	Sampled	Gasket	No Visible	N/A	Asbestos Removed	Non asbestos	0	0	0
1077922/0236	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Plant room TF025	White lining Small Amounts	Sampled	Millboard	No Visible	N/A	Asbestos Removed	Non asbestos	0	0	0
1077922/0237	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Plant room TF025	Black flange gasket Small Amounts	Sampled	Gasket	No Visible	Encapsulated Textile/Paper	No Asbestos Detected	Non asbestos	0	0	0
1077922/0238	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Plant room TF025	Debris from previous flange gasket Small Amounts	Sampled	Gasket	No Visible	N/A	Asbestos Removed	Non asbestos	0	0	0
1077922/0239	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Plant room TF025	Jointing sealant in tin Small Amounts	Sampled	Mastic	No Visible	Reinforced - Composite Materials	Asbestos Removed	Non asbestos	0	0	0
1077922/0240	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Plant room TF025	Bitumen membrane 10.0m ²	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0241	Condition Monitoring Survey	Int	St Tydfils, Central Offices/G	Plant room TF025	Bitumen pipe wrap Small Amounts	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0242	Condition Monitoring Survey	Int	St Tydfils, Staff Change Linen/G	Office 326	White flecked tile and bitumen 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0243	Condition Monitoring Survey	Int	St Tydfils, Staff Change Linen/G	Store 325	Grey linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0244	Condition Monitoring Survey	Int	St Tydfils, Staff Change Linen/G	Female changing 318	Grey linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0245	Condition Monitoring Survey	Int	St Tydfils, Staff Change Linen/G	Female lockers 317	Grey linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0246	Condition Monitoring Survey	Int	St Tydfils, Staff Change Linen/G	Female toilets/shower	Grey linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0247	Condition Monitoring Survey	Int	St Tydfils, Staff Change Linen/G	Washing area 301	Grey linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0248	Condition Monitoring Survey	Int	St Tydfils, Staff Change Linen/G	Wc 302	Grey linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0249	Condition Monitoring Survey	Int	St Tydfils, Staff Change Linen/G	Wc 303	Grey linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0250	Condition Monitoring Survey	Int	St Tydfils, Staff Change Linen/G	Corridor 1 327	White flecked tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0251	Condition Monitoring Survey	Int	St Tydfils, Staff Change Linen/G	Corridor 1 327	Debris in screw holes Small Amounts	Sampled	Debris	Visible Debris	Debris	No Asbestos Detected	Non asbestos	0	0	0
1077922/0252	Condition Monitoring Survey	Int	St Tydfils, Staff Change Linen/G	Linen store 305	Tan coloured linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0253	Condition Monitoring Survey	Int	St Tydfils, Staff Change Linen/G	Domestic 304	Tan coloured linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0254	Condition Monitoring Survey	Int	St Tydfils, Staff Change Linen/G	Corridor 2 328	White flecked tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0255	Condition Monitoring Survey	Int	St Tydfils, Staff Change Linen/G	Female changing 306	Tan coloured linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0256	Condition Monitoring Survey	Int	St Tydfils, Staff Change Linen/G	Staff rest 307	Tan coloured linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0257	Condition Monitoring Survey	Int	St Tydfils, Staff Change Linen/G	Store 308	Tan coloured linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0258	Condition Monitoring Survey	Int	St Tydfils, Staff Change Linen/G	CLNR store 311	White flecked tile and bitumen Small Amounts	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0259	Condition Monitoring Survey	Int	St Tydfils, Staff Change Linen/G	Cleaner 309	White flecked tile and bitumen 5.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0260	Condition Monitoring Survey	Int	St Tydfils, Staff Change Linen/G	Linen store 310	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0261	Condition Monitoring Survey	Int	St Tydfils, Staff Change Linen/G	Male toilet/showers 312	Grey linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0262	Condition Monitoring Survey	Int	St Tydfils, Staff Change Linen/G	Male changing 316	Grey linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0263	Condition Monitoring Survey	Int	St Tydfils, Staff Change Linen/G	Corridor 3 329	White flecked tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0264	Condition Monitoring Survey	Ext	St Tydfils, Staff Change Linen/G	Windows	Putty 50.0m Run	Sampled	Mastic	High	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0265	Condition Monitoring Survey	Ext	St Tydfils, Staff Change Linen/G	External of female toilets	Mastic Small Amounts	Sampled	Mastic	Low	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0266	Condition Monitoring Survey	Ext	St Tydfils, Staff Change Linen/G	Walls to front entrance	Textured coating 50.0m ²	Sampled	Textured Coating	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0267	Condition Monitoring Survey	Ext	St Tydfils, Staff Change Linen/G	External of linen store	Mastic bead 50.0m ²	Sampled	Mastic	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0268	Condition Monitoring Survey	Ext	St Tydfils, Staff Change Linen/G	Adjacent male toilet	Bitumen membrane 50.0m Run	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0269	Condition Monitoring Survey	Ext	St Tydfils, Staff Change Linen/G	Roof	Bitumen membrane 50.0m ²	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0270	Condition Monitoring Survey	Int	Laundry Boiler Room/G	Old Laundry Boiler Room	Fuse flash guards Small Amounts	Sampled	Cloth	No Visible	N/A	Asbestos Removed	Non asbestos	0	0	0
1077922/0271	Condition Monitoring Survey	Int	Laundry Boiler Room/G	Old Laundry Boiler Room	Board for insulating Small Amounts	Sampled	Insulating Board	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0272	Condition Monitoring Survey	Int	Laundry Boiler Room/G	Old Laundry Boiler Room	Melamine board Small Amounts	Sampled	Plastics	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0273	Condition Monitoring Survey	Int	Laundry Boiler Room/G	Old Laundry Boiler Room	Rope seal around inside of electric box Small Amounts	Sampled	Rope	No Visible	Encapsulated Textile/Paper	No Asbestos Detected	Non asbestos	0	0	0
1077922/0274	Condition Monitoring Survey	Int	Laundry Boiler Room/G	Old Laundry Boiler Room	Residue lagging Small Amounts	Sampled	Debris	No Visible	N/A	Asbestos Removed	Non asbestos	0	0	0
1077922/0275	Condition Monitoring Survey	Int	Laundry Boiler Room/G	Old Laundry Boiler Room	Rope cloth Small Amounts	Sampled	Rope	No Visible	Encapsulated Textile/Paper	No Asbestos Detected	Non asbestos	0	0	0
1077922/0276	Condition Monitoring Survey	Int	Laundry Boiler Room/G	Old Laundry Boiler Room	Residue lagging Small Amounts	Sampled	Debris	Visible Debris	Debris	Asbestos Removed	Non asbestos	0	0	0
1077922/0277	Condition Monitoring Survey	Int	Laundry Boiler Room/G	Old Laundry Boiler Room	Lagging residue Small Amounts	Sampled	Debris	Visible Debris	Debris	Asbestos Removed	Non asbestos	0	0	0
1077922/0278	Condition Monitoring Survey	Int	Laundry Boiler Room/G	Old Laundry Boiler Room	Flange gaskets Small Amounts	Sampled	Vinyl	No Visible	Encapsulated Textile/Paper	No Asbestos Detected	Non asbestos	0	0	0
1077922/0279	Condition Monitoring Survey	Int	Laundry Boiler Room/G	Old Laundry Boiler Room	Debris Small Amounts	Sampled	Debris	Visible Debris	Debris	Asbestos Removed	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0280	Condition Monitoring Survey	Int	Laundry Boiler Room/G	Old Laundry Boiler Room	Lagging residue Small Amounts	Sampled	Debris	Visible Debris	Debris	Asbestos Removed	Non asbestos	0	0	0
1077922/0281	Condition Monitoring Survey	Int	Laundry Boiler Room/G	Old Laundry Boiler Room	Debris Small Amounts	Sampled	Debris	Visible Debris	Debris	No Asbestos Detected	Non asbestos	0	0	0
1077922/0282	Condition Monitoring Survey	Int	Laundry Boiler Room/G	Tank room	Bitumen adhesive Small Amounts	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0283	Condition Monitoring Survey	Ext	Laundry Boiler Room/G	Front entrance	Bitumen membrane 50.0m ²	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0284	Condition Monitoring Survey	Int	St Tydfils Laundry Store/G	Store Ceiling	Insulating panel 50.0m ²	Sampled	Insulating Board	Low	Painted/Encapsulated Board	Amosite	Low	6	2	8
1077922/0285	Condition Monitoring Survey	Int	St Tydfils Laundry Store/G	Store Floor	Beige tile and bitumen Small Amounts	Sampled	Vinyl	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	3	6
1077922/0286	Condition Monitoring Survey	Int	St Tydfils Laundry Store/G	Soffit to side of building Soffit	Insulating panels 25.0m Run	Sampled	Insulating Board	Low	Unsealed Board	Amosite	Medium	7	2	9
1077922/0287	Condition Monitoring Survey	Int	St Tydfils Laundry Store/G	Back of building	Broken board Small Amounts	Sampled	Debris	Visible Debris	Debris	Asbestos Removed	Non asbestos	0	0	0
1077922/0288	Condition Monitoring Survey	Int	St Tydfils Laundry Store/G	Front of building	Bitumen membrane 50.0m Run	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0289	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Waiting space GF33	Off white linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0290	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Office/reception GF32	Green linoleum 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0291	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Sisters office GF34	Green linoleum 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0292	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Sisters office GF34 Ceiling void underneath RSJ	Slate packer Small Amounts	Sampled	Cement	Low	Unsealed Cement	Chrysotile	Very Low	4	4	8
1077922/0293	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Corridor GF39	Off white linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0294	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Wheel chairs GF35	Off white linoleum 5.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0295	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Wc GF11	Brown mottle linoleum 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0296	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Sluice GF29 Underside of sink	Acoustic pads 2 Items	Sampled	Bitumen	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	4	7
1077922/0297	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Sluice GF29	Beige linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0298	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Switch Room GF38	Infill panel Small Amounts	Sampled	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0299	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Clothes store GF37	Off white linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0300	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Ward pantry GF36 Underside of sink	Bitumen pads 2 Items	Sampled	Bitumen	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	4	7
1077922/0301	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Ward pantry GF36	Acoustic pads Small Amounts	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0302	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Corridor GF38	Off white linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0303	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Corridor GF38	Paint 10.0m ²	Sampled	Other	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0304	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Staff wc GF12	Off white linoleum 5.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0305	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Wc GF11	Beige linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0306	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Clean utility GF28 Underside of sink	Acoustic pad 1 Item	Sampled	Bitumen	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	4	7
1077922/0307	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Wc GF11	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0308	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Corridor GF37	Off white linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0309	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Vestibule GF31	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0310	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Day room GF40	Off white linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0311	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Day room GF40 Underside of sink	Acoustic pad 2 Items	Sampled	Bitumen	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	4	7
1077922/0312	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Day room GF40 Ceiling void	Ceiling void N/A	Presumed Asbestos	Insulating Board	No Visible	N/A	Asbestos	Low	5	0	5
1077922/0313	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Day room GF40	Felt membrane 50.0m ²	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0314	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Office GF 49	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0315	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Lobby GF 50	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0316	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Remedial therapist GF47	Purple linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0317	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Wc GF42	Brown mottle•• linoleum 5.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0318	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Wc GF48	No Suspect ACM Observed N/A	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0319	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Store GF43	Light green linoleum 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0320	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Store GF44	Light green linoleum 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0321	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Corridor GF50	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0322	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Television room GF41	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0323	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Treatment room GF09	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0324	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Office GF10	Purple linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0325	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	ADL kitchen GF08 Underside of sink	Acoustic pads 2 Items	Sampled	Bitumen	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	4	7
1077922/0326	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	ADL kitchen GF08 Underside of sink	Acoustic pads 2 Items	Sampled	Bitumen	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	4	7
1077922/0327	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	ADL bathroom GF07	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0328	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Bathroom GF02	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0329	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Corridor GF04	Off white linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0330	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Treatment room GF01	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0331	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Physiotherapy GF06	Beige linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0332	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Treatment GF27	Off white linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0333	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Corridor GF58	Off white linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0334	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Store GF26	Off white linoleum 5.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0335	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Sub-waiting GF14/25	Off white linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0336	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Examination 4 GF15	Beige linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0337	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Recovery GF24	Off white linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0338	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Consulting GF23	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0339	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Dental GF22	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0340	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Utility/laundry GF21 Underside of sink	Acoustic pad 1 item	Sampled	Bitumen	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	4	7
1077922/0341	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Utility/laundry GF21	Brown mottle•• linoleum 5.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0342	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Clinical waste GF15	Beige linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0343	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Store GF15	Beige linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0344	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Examination 2 GF17	Beige linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0345	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Examination 3 GF16	Beige linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0346	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Treatment GF13	Green linoleum 5.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0347	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Store 01	White panels 50.0m ²	Sampled	Insulating Board	Visible Debris	Unsealed Board	Asbestos Removed	Non asbestos	0	0	0
1077922/0348	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Store 01	Debris Small Amounts	Sampled	Debris	Visible Debris	Debris	No Asbestos Detected	Non asbestos	0	0	0
1077922/0349	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Store 03	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0350	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Store 02	paper Small Amounts	Sampled	Paper	Low	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0351	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Store 02	No Access N/A	No Access - Presumed Asbestos	Select Product	No Visible	N/A	No Access	Very Low	3	0	3
1077922/0352	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Painters 67	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0353	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Electricians workshop 75	Tin of sealant with asbestos fibers in Small Amounts	Sampled	Other	No Visible	Reinforced - Composite Materials	Asbestos Removed	Non asbestos	0	0	0
1077922/0354	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Store 71	Fire blanket 1 Item	Sampled	Cloth	No Visible	Encapsulated Textile/Paper	Asbestos Removed	Non asbestos	0	0	0
1077922/0355	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Workshop 75	Fuse flash guard Small Amounts	Sampled	Cloth	No Visible	Encapsulated Textile/Paper	Asbestos Removed	Non asbestos	0	0	0
1077922/0356	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Electricians workshop 75	Insulating tiles Small Amounts	Sampled	Insulating Board	Medium	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0357	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Store 71	Roof slates Small Amounts	Sampled	Cement	No Visible	Reinforced - Composite Materials	Asbestos Removed	Non asbestos	0	0	0
1077922/0358	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Store 72	Coiled rope 50.0m Run	Sampled	Rope	No Visible	Reinforced - Composite Materials	Asbestos Removed	Non asbestos	0	0	0
1077922/0359	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Store 72	Coiled rope 50.0m Run	Sampled	Rope	No Visible	Reinforced - Composite Materials	Asbestos Removed	Non asbestos	0	0	0
1077922/0360	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Store 72	Fire blanket Small Amounts	Sampled	Cloth	No Visible	Encapsulated Textile/Paper	Asbestos Removed	Non asbestos	0	0	0
1077922/0361	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Store 72	Rolled up flooring 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	Asbestos Removed	Non asbestos	0	0	0
1077922/0362	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Store 72	Red rolled up flooring product 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0363	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Store 72	Pink floor material 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0364	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Store 72	In a tin, flaked particles Small Amounts	Sampled	Other	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0365	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Store 72	Tins of flaked heat resistant material Small Amounts	Presumed Asbestos	Other	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0366	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Store 69 Floor	Cream tile and bitumen 50.0m ²	Sampled	Vinyl	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	5	8
1077922/0367	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Store 68 Floor	Cream tile and bitumen 50.0m ²	Visually Similar To	Vinyl	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	5	8
1077922/0368	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Mess room 76 Under window	Cream painted panel 10.0m ²	Sampled	Cement	No Visible	Painted/Sealed Cement	Chrysotile	Very Low	2	3	5
1077922/0369	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Mess room 76	Flange gasket debris Small Amounts	Sampled	Gasket	Visible Debris	Debris	No Asbestos Detected	Non asbestos	0	0	0
1077922/0370	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Mess room 76	Grey tile 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0371	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Mess room 76 Wall	Electric boxes N/A	Presumed Asbestos	Rope	No Visible	N/A	Asbestos	Low	5	0	5
1077922/0372	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Lockers 75	Grey tile 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0373	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Wc/shower 74	Grey tile 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0374	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Wc/shower 74 Floor	Flange gaskets Small Amounts	Sampled	Gasket	No Visible	N/A	Asbestos Removed	Non asbestos	0	0	0
1077922/0375	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Lockers 73 Ceiling	Paint 50.0m ²	Sampled	Textured Coating	Visible Debris	Painted/Sealed Cement	Chrysotile	Low	5	5	10
1077922/0376	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Calorifier 77	Rope in wax covering Small Amounts	Sampled	Rope	No Visible	N/A	Asbestos Removed	Non asbestos	0	0	0
1077922/0377	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Calorifier 77	Flange gasket Small Amounts	Sampled	Gasket	No Visible	Encapsulated Textile/Paper	No Asbestos Detected	Non asbestos	0	0	0
1077922/0378	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Calorifier 77 Pipework behind calorifier 2	Flange gasket Small Amounts	Sampled	Gasket	No Visible	Encapsulated Textile/Paper	Chrysotile	Low	5	3	8
1077922/0379	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Calorifier 77	Flange gasket Small Amounts	Sampled	Gasket	No Visible	Encapsulated Textile/Paper	No Asbestos Detected	Non asbestos	0	0	0
1077922/0380	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Calorifier 77	Lagging debris Small Amounts	Sampled	Thermal Lagging	Visible Debris	Debris	Asbestos Removed	Non asbestos	0	0	0
1077922/0381	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Calorifier 77	Lagging debris Small Amounts	Sampled	Thermal Lagging	Visible Debris	Debris	Asbestos Removed	Non asbestos	0	0	0
1077922/0382	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Calorifier 77	Left over mmmf from pipe Small Amounts	Sampled	Thermal Lagging	High	Unsealed Spray/Lagging/Textile	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0383	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Calorifier 77	Gasket material Small Amounts	Sampled	Gasket	No Visible	Encapsulated Textile/Paper	Asbestos Removed	Non asbestos	0	0	0
1077922/0384	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Calorifier 77	Debris Small Amounts	Sampled	Debris	Visible Debris	Debris	Asbestos Removed	Non asbestos	0	0	0
1077922/0385	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Calorifier 77	Debris Small Amounts	Sampled	Debris	Visible Debris	Debris	No Asbestos Detected	Non asbestos	0	0	0
1077922/0386	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Calorifier 77	Debris on pipe work Small Amounts	Sampled	Debris	Visible Debris	Debris	No Asbestos Detected	Non asbestos	0	0	0
1077922/0387	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Calorifier 77 Wall around pipe	Putty seal around pipe Small Amounts	Sampled	Mastic	No Visible	Reinforced - Composite Materials	Chrysotile	Very Low	2	2	4
1077922/0388	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Calorifier 77	Flange gasket to redundant pipe work Small Amounts	Sampled	Gasket	No Visible	N/A	Asbestos Removed	Non asbestos	0	0	0
1077922/0389	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Calorifier 77 Wall	Electrical boxes N/A	Presumed Asbestos	Rope	No Visible	N/A	Asbestos	Low	5	0	5
1077922/0390	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Calorifier 77 Metal clad pipework	Pipe work N/A	Presumed Asbestos	Paper	No Visible	N/A	Asbestos	Low	5	4	9
1077922/0391	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Calorifier 77 Wall void	No Access N/A	Presumed Asbestos	Other	No Visible	N/A	Asbestos	Low	6	2	8
1077922/0392	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Calorifier 77 Ceiling	No Access N/A	Presumed Asbestos	Other	No Visible	N/A	Asbestos	Low	6	2	8
1077922/0393	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Boiler house 78 Door header	Infill panel Small Amounts	Sampled	Cement	No Visible	Painted/Sealed Cement	Chrysotile	Very Low	2	2	4
1077922/0394	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Boiler house 78 Pipe at back of boiler one	Rope seal Small Amounts	Sampled	Rope	No Visible	Encapsulated Textile/Paper	Chrysotile	Low	5	3	8
1077922/0395	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Boiler house 78 Pipe at back of boiler two	Rope seal Small Amounts	Visually Similar To	Rope	No Visible	Encapsulated Textile/Paper	Chrysotile	Low	5	3	8
1077922/0396	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Boiler house 78	Rope seal Small Amounts	Sampled	Rope	No Visible	Encapsulated Textile/Paper	No Asbestos Detected	Non asbestos	0	0	0
1077922/0397	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Boiler house 78	Pink flange gasket Small Amounts	Sampled	Gasket	No Visible	Encapsulated Textile/Paper	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0398	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Boiler house 78 Boiler one veiwing eye	White seal Small Amounts	Sampled	Gasket	No Visible	Encapsulated Textile/Paper	Chrysotile	Low	5	3	8
1077922/0399	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Boiler house 78 Front of boiler 2 around viewing eye	White seal Small Amounts	Visually Similar To	Gasket	No Visible	Encapsulated Textile/Paper	Chrysotile	Low	5	3	8
1077922/0400	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Boiler house 78 Front of boiler three around veiwing panel	White seal Small Amounts	Visually Similar To	Gasket	No Visible	Encapsulated Textile/Paper	Chrysotile	Low	5	3	8
1077922/0401	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Boiler house 78 Bottom left hand corner of boiler room	Flange gasket Small Amounts	Sampled	Gasket	Low	Unsealed Spray/Lagging/Textile	Chrysotile	Medium	7	4	11
1077922/0402	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Boiler house 78 Front of boiler three	Cream flange gasket Small Amounts	Sampled	Gasket	No Visible	Encapsulated Textile/Paper	Chrysotile	Low	5	3	8
1077922/0403	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Boiler house 78	Debris Small Amounts	Sampled	Debris	Visible Debris	Debris	Asbestos Removed	Non asbestos	0	0	0
1077922/0404	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Boiler house 78 Duct through wall	Debris Small Amounts	Sampled	Debris	Visible Debris	Debris	Asbestos Removed	Non asbestos	0	0	0
1077922/0405	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Boiler house 78 Door header	Infill panel Small Amounts	Visually Similar To	Cement	Medium	Painted/Sealed Cement	Chrysotile	Very Low	4	3	7
1077922/0406	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Boiler house 78	Flange gaskets Small Amounts	Sampled	Gasket	No Visible	Encapsulated Textile/Paper	Asbestos Removed	Non asbestos	0	0	0
1077922/0407	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Boiler house 78	White flange gasket Small Amounts	Sampled	Gasket	No Visible	Encapsulated Textile/Paper	No Asbestos Detected	Non asbestos	0	0	0
1077922/0408	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Boiler house 78	Flange gasket Small Amounts	Sampled	Gasket	No Visible	Encapsulated Textile/Paper	Asbestos Removed	Non asbestos	0	0	0
1077922/0409	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Boiler house 78	Big pink flange gaskets Small Amounts	Sampled	Gasket	No Visible	Encapsulated Textile/Paper	Asbestos Removed	Non asbestos	0	0	0
1077922/0410	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Boiler house 78 Sky lights	Boiler house Small Amounts	Presumed Asbestos	Other	No Visible	N/A	Asbestos	Low	6	2	8
1077922/0411	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Boiler house 78	Pipe ducts from boilers N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0412	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Boiler house 78 Wall	Electric boxes N/A	Presumed Asbestos	Rope	No Visible	N/A	Asbestos	Low	5	0	5

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0413	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Boiler house 78 Pipework	Pipe work clad in metal N/A	Presumed Asbestos	Paper	No Visible	N/A	Asbestos	Low	5	3	8
1077922/0414	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Boiler house 78	Debris Small Amounts	Sampled	Debris	Visible Debris	Debris	Asbestos Removed	Non asbestos	0	0	0
1077922/0415	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Electricians workshop 75 Wall	Electric box N/A	Presumed Asbestos	Insulating Board	Low	Unsealed Board	Asbestos	Medium	8	4	12
1077922/0416	Condition Monitoring Survey	Int	St Tydfils, Main Boiler House/G	Boiler house 78 Back wall	Old coal store N/A	Presumed Asbestos	Thermal Lagging	No Visible	N/A	Asbestos	Low	6	3	9
1077922/0417	Condition Monitoring Survey	Int	St Tydfils, Hafod House/G	Kitchen 006	Grey floor tile and bitumen 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0418	Condition Monitoring Survey	Int	St Tydfils, Hafod House/G	Kitchen 006	Black vinyl Small Amounts	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0419	Condition Monitoring Survey	Int	St Tydfils, Hafod House/G	Kitchen 006	Beige tile and bitumen Small Amounts	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0420	Condition Monitoring Survey	Int	St Tydfils, Hafod House/G	Kitchen 006	Rope textile seal Small Amounts	Sampled	Rope	No Visible	Encapsulated Textile/Paper	No Asbestos Detected	Non asbestos	0	0	0
1077922/0421	Condition Monitoring Survey	Int	St Tydfils, Hafod House/G	Kitchen 006	Cement compound Small Amounts	Sampled	Cement	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0422	Condition Monitoring Survey	Int	St Tydfils, Hafod House/G	Kitchen 006	Acoustic pads 2 Items	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0423	Condition Monitoring Survey	Int	St Tydfils, Hafod House/G	Lounge 005	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0424	Condition Monitoring Survey	Int	St Tydfils, Hafod House/G	Flat 1 003	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0425	Condition Monitoring Survey	Int	St Tydfils, Hafod House/G	Lobby 001	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0426	Condition Monitoring Survey	Int	St Tydfils, Hafod House/G	Hall 002	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0427	Condition Monitoring Survey	Int	St Tydfils, Hafod House/G	Wc 004	Beige mottled linoleum 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0428	Condition Monitoring Survey	Int	St Tydfils, Hafod House/G	Kitchen 006	Felt membrane 50.0m ²	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0429	Condition Monitoring Survey	Int	St Tydfils, Hafod House/F 1	Flat 2 102	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0430	Condition Monitoring Survey	Int	St Tydfils, Hafod House/F 1	Flat 3 104	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0431	Condition Monitoring Survey	Int	St Tydfils, Hafod House/G	Flat 4 105	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0432	Condition Monitoring Survey	Int	St Tydfils, Hafod House/F 1	Stair case	Black vinyl 16 Items	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0433	Condition Monitoring Survey	Int	St Tydfils, Hafod House/F 1	Landing 101	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0434	Condition Monitoring Survey	Int	St Tydfils, Hafod House/F 1	Bathroom 103	Blue patterned linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0435	Condition Monitoring Survey	Int	St Tydfils, Hafod House/F 1	Attic space, via bathroom 103	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0436	Condition Monitoring Survey	Ext	St Tydfils, Hafod House/G	Boiler 007	Felt membrane 10.0m ²	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0437	Condition Monitoring Survey	Ext	St Tydfils, Hafod House/G	Kitchen 006 Roof	Roof slates 50.0m ²	Sampled	Cement	Low	Unsealed Cement	Chrysotile	Very Low	4	2	6
1077922/0438	Condition Monitoring Survey	Int	St Tydfils, Psychology Therapy Centre/G	Lobby pt01	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0439	Condition Monitoring Survey	Int	St Tydfils, Psychology Therapy Centre/G	Disabled wc pt02	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0440	Condition Monitoring Survey	Int	St Tydfils, Psychology Therapy Centre/G	Kitchen pt03	Acoustic pad Small Amounts	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0441	Condition Monitoring Survey	Int	St Tydfils, Psychology Therapy Centre/G	Office 1 pt04	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0442	Condition Monitoring Survey	Int	St Tydfils, Psychology Therapy Centre/G	Main reception pt09	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0443	Condition Monitoring Survey	Int	St Tydfils, Psychology Therapy Centre/G	Office 2 pt05	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0444	Condition Monitoring Survey	Int	St Tydfils, Psychology Therapy Centre/G	Office pt06	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0445	Condition Monitoring Survey	Int	St Tydfils, Psychology Therapy Centre/G	Office 4 pt07	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0446	Condition Monitoring Survey	Int	St Tydfils, Psychology Therapy Centre/G	Office 5 pt08	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0447	Condition Monitoring Survey	Int	St Tydfils, Psychology Therapy Centre/G	All roof area Roof space	Roof area entry point N/A	Presumed Asbestos	Bitumen	No Visible	N/A	Asbestos	Very Low	4	0	4
1077922/0448	Condition Monitoring Survey	Ext	St Tydfils, Psychology Therapy Centre/G	Above main reception pt09	Roof slate 50.0m ²	Sampled	Cement	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0449	Condition Monitoring Survey	Int	St Tydfils, Gardeners Shed/G	Gardeners shed 01 Floor	Slate coloured floor covering 50.0m ²	Sampled	Vinyl	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	5	8
1077922/0450	Condition Monitoring Survey	Int	St Tydfils, Gardeners Shed/G	Gardeners shed 01	Green floor covering 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0451	Condition Monitoring Survey	Ext	St Tydfils, Gardeners Shed/G	Gardeners shed 01 Wall	Expansion joints 50.0m Run	Sampled	Mastic	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	2	5
1077922/0452	Condition Monitoring Survey	Ext	St Tydfils, Gardeners Shed/G	Roof Roof	Cement corrugated roof 50.0m ²	Sampled	Cement	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	2	5
1077922/0453	Condition Monitoring Survey	Ext	St Tydfils, Gardeners Shed/G	Gardeners shed 01 Edge and centre of roof	Corner covering 5.00m ²	Sampled	Cement	Low	Unsealed Cement	Chrysotile	Very Low	4	1	5
1077922/0454	Condition Monitoring Survey	Ext	St Tydfils, Gardeners Shed/G	Gardeners shed 01 Walls at either end	Corrugated wall cover 50.0m ²	Sampled	Cement	Low	Unsealed Cement	Chrysotile	Very Low	4	2	6
1077922/0455	Condition Monitoring Survey	Ext	St Tydfils, Gardeners Shed/G	Gardeners shed 01 Wall	Cement rain water goods 25.0m Run	Sampled	Cement	Low	Unsealed Cement	Chrysotile	Very Low	4	2	6

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0456	Condition Monitoring Survey	Ext	St Tydfils, Gardeners Shed/G	Gardeners shed 01 Wall	Rain water down pipe 6.00m Run	Sampled	Cement	Low	Unsealed Cement	Chrysotile	Very Low	4	2	6
1077922/0457	Condition Monitoring Survey	Int	St Tydfils, Medical Store/G	Medical gases 01	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0458	Condition Monitoring Survey	Int	St Tydfils, Medical Store/G	Oxygen store 02	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0459	Condition Monitoring Survey	Int	St Tydfils, Medical Store/G	Cylinder store 03	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0460	Condition Monitoring Survey	Ext	St Tydfils, Medical Store/G	Externals	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0461	Condition Monitoring Survey	Int	St Tydfils, Body Store/G	Fridge 1	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0462	Condition Monitoring Survey	Int	St Tydfils, Body Store/G	Fridge 2	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0463	Condition Monitoring Survey	Int	St Tydfils, Body Store/G	Body store 03	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0464	Condition Monitoring Survey	Int	St Tydfils, Body Store/G	Wc 06	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0465	Condition Monitoring Survey	Int	St Tydfils, Body Store/G	Post mortem 04	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0466	Condition Monitoring Survey	Int	St Tydfils, Body Store/G	Changing room 05	Red floor covering 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0467	Condition Monitoring Survey	Int	St Tydfils, Body Store/G	Viewing 02	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0468	Condition Monitoring Survey	Int	St Tydfils, Body Store/G	Lobby/waiting 01	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0469	Condition Monitoring Survey	Int	St Tydfils, Body Store/G	Attic space	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0470	Condition Monitoring Survey	Ext	St Tydfils, Body Store/G	Externals	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0471	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Female wc 003 Floor	Blue linoleum 50.0m ²	Sampled	Vinyl	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	3	6
1077922/0472	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Female wc 003	Blue melamine 50.0m ²	Sampled	Plastics	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0473	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Cupboard 004 Floor	Blue linoleum 4.00m ²	Visually Similar To	Vinyl	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	3	6

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0474	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Lobby 002 Floor	Blue linoleum 5.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	Chrysotile	Very Low	2	3	5
1077922/0475	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Lobby 002 Step	Black vinyl nosings 2 Items	Sampled	Plastics	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	2	5
1077922/0476	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Male wc 005 Floor	Blue linoleum 50.0m ²	Visually Similar To	Vinyl	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	3	6
1077922/0477	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Male wc 005	Blue melamine 2.00m ²	Visually Similar To	Plastics	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0478	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Stairs GF45	Grey tile 10.0m ²	Sampled	Vinyl	Low	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0479	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Store 1 001	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0480	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Store 3 008 Door frame	Slate packers Small Amounts	Sampled	Cement	Medium	Unsealed Cement	Chrysotile	Low	5	2	7
1077922/0481	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Store 2 007	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0482	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Store 4 010	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0483	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Store 5 011	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0484	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Store 6 012	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0485	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Corridor 1 006	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0486	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Wc 017 Wall and floor	Black cistern 1 Item	Sampled	Plastics	Visible Debris	Reinforced - Composite Materials	Asbestos Removed	Non asbestos	0	0	0
1077922/0487	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Store 7 014	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0488	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Store 9 016	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0489	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Corridor 3 013	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0490	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Store 8 015 Floor	Green vinyl tiles and bitumen Small Amounts	Sampled	Vinyl	Medium	Reinforced - Composite Materials	Chrysotile	Very Low	4	3	7
1077922/0491	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Store 8 015 Floor	Beige tile and bitumen 50.0m ²	Sampled	Vinyl	Medium	Reinforced - Composite Materials	Chrysotile	Very Low	4	3	7

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0492	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Corridor 2 009 Ceiling	Slate packing Small Amounts	Sampled	Cement	No Visible	Unsealed Cement	Chrysotile	Very Low	3	2	5
1077922/0493	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Corridor 2 009 Redundant pipework	Flange gasket Small Amounts	Sampled	Gasket	Low	Encapsulated Textile/Paper	Chrysotile	Low	6	2	8
1077922/0494	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Corridor 4 018 Pipework	Flange gasket Small Amounts	Sampled	Gasket	No Visible	Encapsulated Textile/Paper	Chrysotile	Low	5	3	8
1077922/0495	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Stairwell 019 Steps	White nosings 46 Items	Sampled	Vinyl	Low	Reinforced - Composite Materials	Amosite	Very Low	4	2	6
1077922/0496	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Stairwell 019 Steps	Green tile and bitumen 50.0m ²	Sampled	Vinyl	Visible Debris	Reinforced - Composite Materials	Chrysotile	Low	5	3	8
1077922/0497	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Store 10 020	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0498	Condition Monitoring Survey	Ext	St Tydfils Day Care Unit/B	Court yard	Bitumen wrap 10.0m ²	Sampled	Cloth	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0499	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Stairs GF	Beige linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0500	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Store 13 024	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0501	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Store 12 023	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0502	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Corridor 5 022 Ceiling	Slate packing Small Amounts	Visually Similar To	Cement	No Visible	Unsealed Cement	Chrysotile	Very Low	3	2	5
1077922/0503	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Store 11 021	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0504	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Lift	Redundant lift N/A	No Access - Presumed Asbestos	Select Product	No Visible	N/A	No Access	Very Low	3	0	3
1077922/0505	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Store 14 026 Pipework inside sterilizer	Rope 10.0m Run	Sampled	Rope	Medium	Unsealed Spray/Lagging/Textile	Asbestos Removed	Non asbestos	0	0	0
1077922/0506	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Store 14 026 Sterilizer drum	Card wrap 2.00m ²	Sampled	Paper	No Visible	Encapsulated Textile/Paper	Chrysotile	Low	5	3	8
1077922/0507	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Store 14 026 Inside sterilizer drum	Flange gasket Small Amounts	Sampled	Gasket	Low	Encapsulated Textile/Paper	Chrysotile	Low	6	2	8
1077922/0508	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Store 15 028 Pipework	Flange gasket Small Amounts	Sampled	Gasket	No Visible	Encapsulated Textile/Paper	Chrysotile	Low	5	3	8

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0509	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	Age concern office 54	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0510	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	Office 52	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0511	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	Corridor 53	Beige linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0512	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	Staff wc 51	Beige linoleum 4.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0513	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	Stairs 53a	Beige linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0514	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	Office 53b	Dark red tile 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0515	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	Office 53b	Red tile 50.0m ²	Sampled	Vinyl	Medium	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0516	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	Roof space FF28	Roof felt 50.0m ²	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0517	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	Craft room FF10 Underside of sink	Acoustic pad 1 Item	Sampled	Bitumen	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	4	7
1077922/0518	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	Craft room FF10	Grey linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0519	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	Workshop FF14	Grey linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0520	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	Workshop FF14 Underside of sink	Acoustic pad 1 Item	Sampled	Bitumen	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	4	7
1077922/0521	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	Workshop FF14	Insulating panel Small Amounts	Sampled	Cement	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0522	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	Lobby FF20	Beige linoleum 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0523	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	OT store FF11	Beige linoleum 5.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0524	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	Male wc FF12	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0525	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	Female wc FF12	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0526	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Corridor 6 025	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0527	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	Counseling room FF09	Beige linoleum 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0528	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	Lobby FF19	Beige linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0529	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	Physio store FF17	Beige linoleum 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0530	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	Woodwork FF15 Underside of sink	Acoustic pad 1 Item	Presumed Asbestos	Bitumen	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	4	7
1077922/0531	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	Relaxation/group room FF07	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0532	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	Corridor FF16	Beige linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0533	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	Lift FF01a	No Access N/A	No Access - Presumed Asbestos	Select Product	No Visible	N/A	No Access	Very Low	3	0	3
1077922/0534	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	Games room FF02	Blue linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0535	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	Gymnasium FF04	Blue linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0536	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	Staff changing FF05	Blue linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0537	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	Office FF06	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0538	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	Wax therapy FF03	Blue linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0539	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	ADL kitchen FF16	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0540	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	Wc FF08	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0541	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Stairs GF04 Steps	White nosings 36 Items	Sampled	Vinyl	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	2	5
1077922/0542	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Stairs GF04	Brown linoleum and bitumen 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0543	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	Stairs FF21	Green linoleum and bitumen 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0544	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Lobby/stairs GF06	White nosing Small Amounts	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0545	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Lobby/stairs GF06	Dark green linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0546	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Lobby/stairs GF06	Pale green linoleum 10.0m Run	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0547	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Lift GF08a	No Access N/A	No Access - Presumed Asbestos	Select Product	No Visible	N/A	No Access	Very Low	3	0	3
1077922/0548	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Ward SF20 Floor	White tile Small Amounts	Sampled	Vinyl	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	2	5
1077922/0549	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Loft	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0550	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Workshop SF26 Floor, back half of room	Red linoleum 50.0m ²	Sampled	Vinyl	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	3	6
1077922/0551	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Store SF27	Red tile 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0552	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Workshop SF25 Floor	Grey linoleum 50.0m ²	Sampled	Vinyl	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	3	6
1077922/0553	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Wc SF24	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0554	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Lobby SF21	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0555	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Wc SF23	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0556	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Store SF22 Floor	Grey linoleum 50.0m ²	Visually Similar To	Vinyl	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	3	6
1077922/0557	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Store SF22 Inside sluice machine	Flange gaskets Small Amounts	Sampled	Gasket	Low	Reinforced - Composite Materials	Chrysotile	Very Low	4	3	7
1077922/0558	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Kitchen SF29	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0559	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Store SF30	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0560	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Store SF19	Grey tile 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0561	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Store SF28	Grey tile Small Amounts	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0562	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Corridor SF18	Blue linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	Asbestos Removed	Non asbestos	0	0	0
1077922/0563	Condition Monitoring Survey	Ext	St Tydfils Day Care Unit/F 2	Office SF15 Strylight	Rope seal 25.0m Run	Sampled	Rope	Low	Unsealed Spray/Lagging/Textile	Chrysotile	Medium	7	2	9
1077922/0564	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Corridor SF18	Bitumen membrane 50.0m Run	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0565	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Office SF02	Cream linoleum 50.0m ²	Sampled	Vinyl	Low	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0566	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Office SF03	Pale grey linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0567	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Office SF17	Pale grey linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0568	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Office SF16	Pale grey linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0569	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Office SF15	Pale grey linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0570	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Staff changing SF12	Pale grey linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0571	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Office SF10	Pale grey linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0572	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Wc SF08/09	Pale grey linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0573	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Office SF04	Pale grey linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0574	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Lobby SF07	Blue linoleum 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	Asbestos Removed	Non asbestos	0	0	0
1077922/0575	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Store SF05	Blue linoleum 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	Asbestos Removed	Non asbestos	0	0	0
1077922/0576	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Lobby SF08	Blue linoleum 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	Asbestos Removed	Non asbestos	0	0	0
1077922/0577	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Office SF03	Blue linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0578	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Wc SF08/09	Blue linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0579	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Office SF15	Rope Small Amounts	Sampled	Rope	No Visible	Encapsulated Textile/Paper	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0580	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	WC SF13	Pale grey floor tiles 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	Asbestos Removed	Non asbestos	0	0	0
1077922/0581	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	WC SF13	Black cistern 1 Item	Sampled	Plastics	Low	Reinforced - Composite Materials	Asbestos Removed	Non asbestos	0	0	0
1077922/0582	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Lift SF01a	No Access N/A	No Access - Presumed Asbestos	Select Product	No Visible	N/A	No Access	Very Low	3	0	3
1077922/0583	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Flat roof Inner roof	Flat roof N/A	Presumed Asbestos	Bitumen	Low	Reinforced - Composite Materials	Asbestos	Low	5	1	6
1077922/0584	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 1	Stairs FF22	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0585	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Utility SF33	Red tile 50.0m ²	Sampled	Vinyl	Medium	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0586	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Utility SF37	Red tile 50.0m ²	Visually Similar To	Vinyl	Medium	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0587	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Utility SF37	Bitumen paste Small Amounts	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0588	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Corridor SF32 Floor	Dark green tile 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	Asbestos Removed	Non asbestos	0	0	0
1077922/0589	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Corridor SF32 Floor	Cream floor tile Small Amounts	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	Asbestos Removed	Non asbestos	0	0	0
1077922/0590	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Wc SF34 Floor	Dark green tile 5.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	Asbestos Removed	Non asbestos	0	0	0
1077922/0591	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Corridor SF32 Electric box	Mill board Small Amounts	Sampled	Millboard	No Visible	Unsealed Board	Asbestos Removed	Non asbestos	0	0	0
1077922/0592	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Stairs SF31 Floor	Dark green tile 50.0m ²	Visually Similar To	Vinyl	Medium	Reinforced - Composite Materials	Chrysotile	Very Low	4	3	7
1077922/0593	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Tank room SF36	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0594	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/F 2	Office SF36	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0595	Condition Monitoring Survey	Int	St Tydfils, Workshops/F 1	Mess room FF24 Floor	Beige linoleum and bitumen 50.0m ²	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	Asbestos Removed	Non asbestos	0	0	0
1077922/0596	Condition Monitoring Survey	Int	St Tydfils, Workshops/F 1	Lobby FF26	Beige linoleum and bitumen 10.0m ²	Visually Similar To	Bitumen	No Visible	N/A	Asbestos Removed	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0597	Condition Monitoring Survey	Int	St Tydfils, Workshops/F 1	Stairs FF27	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0598	Condition Monitoring Survey	Int	St Tydfils, Workshops/F 1	Office FF25	No Asbestos N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0599	Condition Monitoring Survey	Int	St Tydfils, Workshops/F 1	Store FF30 Floor	Green tiles and bitumen 10.0m ²	Sampled	Vinyl	No Visible	N/A	Asbestos Removed	Non asbestos	0	0	0
1077922/0600	Condition Monitoring Survey	Int	St Tydfils, Workshops/F 1	Carpenters workshop FF29	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0601	Condition Monitoring Survey	Int	St Tydfils, Workshops/F 1	Machine room FF31 Wall	Electrical Boxes N/A	Presumed Asbestos	Rope	No Visible	N/A	Asbestos Removed	Non asbestos	0	0	0
1077922/0602	Condition Monitoring Survey	Int	St Tydfils, Workshops/G	Store 65	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0603	Condition Monitoring Survey	Int	St Tydfils, Workshops/G	Store 66	Bitumen roll of roof felt 10.0m ²	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0604	Condition Monitoring Survey	Int	St Tydfils, Workshops/G	Store 66	Roof slate 10.0m ²	Sampled	Cement	No Visible	Reinforced - Composite Materials	Asbestos Removed	Non asbestos	0	0	0
1077922/0605	Condition Monitoring Survey	Int	St Tydfils, Workshops/F 1	Store FF32 Roof/ceiling in centre of room	Cement profiled sheets 10.0m ²	Presumed Asbestos	Cement	Low	Unsealed Cement	Asbestos	Low	6	2	8
1077922/0606	Condition Monitoring Survey	Int	St Tydfils, Workshops/F 1	Store FF33 Floor	Deep grey tile and bitumen 50.0m ²	Sampled	Vinyl	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	4	7
1077922/0607	Condition Monitoring Survey	Int	St Tydfils, Workshops/F 1	Store FF35	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0608	Condition Monitoring Survey	Int	St Tydfils, Workshops/F 1	Office FF36 Floor	Dark brown tile and bitumen 50.0m ²	Sampled	Vinyl	No Visible	N/A	Asbestos Removed	Non asbestos	0	0	0
1077922/0609	Condition Monitoring Survey	Int	St Tydfils, Workshops/F 1	Office FF36	Roof slates Small Amounts	Sampled	Cement	No Visible	Reinforced - Composite Materials	Asbestos Removed	Non asbestos	0	0	0
1077922/0610	Condition Monitoring Survey	Int	St Tydfils, Workshops/F 1	Store FF37 Floor	Dark brown tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	N/A	Asbestos Removed	Non asbestos	0	0	0
1077922/0611	Condition Monitoring Survey	Int	St Tydfils, Workshops/F 1	Store FF34	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0612	Condition Monitoring Survey	Int	St Tydfils, Workshops/F 1	Store FF32	Lagging debris Small Amounts	Sampled	Debris	No Visible	N/A	Asbestos Removed	Non asbestos	0	0	0
1077922/0613	Condition Monitoring Survey	Int	St Tydfils, Workshops/F 1	Store FF32	Insulating board 10.0m ²	Sampled	Insulating Board	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0614	Condition Monitoring Survey	Int	St Tydfils, Workshops/F 1	Mezzanine floor 1 Wall	Lagging 10.0m Run	Sampled	Thermal Lagging	High	Encapsulated Lagging/Spray	Asbestos Removed	Non asbestos	0	0	0
1077922/0615	Condition Monitoring Survey	Int	St Tydfils Main Building/F 3	Kitchen T5103	Acoustic pads Small Amounts	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0616	Condition Monitoring Survey	Int	St Tydfils Main Building/F 3	Office T5104	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0617	Condition Monitoring Survey	Int	St Tydfils Main Building/F 3	Office T5105	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0618	Condition Monitoring Survey	Int	St Tydfils Main Building/F 3	Office T5106	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0619	Condition Monitoring Survey	Int	St Tydfils Main Building/F 3	Office T599	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0620	Condition Monitoring Survey	Int	St Tydfils Main Building/F 3	Store T5102	Blue linoleum 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0621	Condition Monitoring Survey	Int	St Tydfils Main Building/F 3	Store T5101	Blue linoleum 5.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0622	Condition Monitoring Survey	Int	St Tydfils Main Building/F 3	Office T5100	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0623	Condition Monitoring Survey	Int	St Tydfils Main Building/F 3	Corridor T5112	Grey linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0624	Condition Monitoring Survey	Int	St Tydfils Main Building/F 3	Corridor T5112	Black skirting board 50.0m Run	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0625	Condition Monitoring Survey	Int	St Tydfils Main Building/F 3	Staircase T598	Black skirting board 10.0m Run	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0626	Condition Monitoring Survey	Int	St Tydfils Main Building/F 3	Staircase T598	Grey linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0627	Condition Monitoring Survey	Int	St Tydfils Main Building/F 3	Payroll team leader T5110	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0628	Condition Monitoring Survey	Int	St Tydfils Main Building/F 3	Corridor T5111	Black skirting board 50.0m Run	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0629	Condition Monitoring Survey	Int	St Tydfils Main Building/F 3	Corridor T5111	Grey linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0630	Condition Monitoring Survey	Int	St Tydfils Main Building/F 3	Female wc T5109	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0631	Condition Monitoring Survey	Int	St Tydfils Main Building/F 3	Male wc T5107	Blue linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0632	Condition Monitoring Survey	Int	St Tydfils Main Building/F 3	Male wc T5107	Black skirting board 25.0m Run	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0633	Condition Monitoring Survey	Int	St Tydfils Main Building/F 3	Payroll T5108	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0634	Condition Monitoring Survey	Int	St Tydfils Main Building/F 3	Loft	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0635	Condition Monitoring Survey	Int	St Tydfils Main Building/F 2	Store T586	Dark grey linoleum 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0636	Condition Monitoring Survey	Int	St Tydfils Main Building/F 2	Store T586	Light grey linoleum 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0637	Condition Monitoring Survey	Int	St Tydfils Main Building/F 2	Store T586	Black skirting 50.0m Run	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0638	Condition Monitoring Survey	Int	St Tydfils Main Building/F 2	Store T585	Blue linoleum 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0639	Condition Monitoring Survey	Int	St Tydfils Main Building/F 2	Store T585	Black skirting 25.0m Run	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0640	Condition Monitoring Survey	Int	St Tydfils Main Building/F 2	Office T587	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0641	Condition Monitoring Survey	Int	St Tydfils Main Building/F 2	Office T588	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0642	Condition Monitoring Survey	Int	St Tydfils Main Building/F 2	Office T589	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0643	Condition Monitoring Survey	Int	St Tydfils Main Building/F 2	Office T590	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0644	Condition Monitoring Survey	Int	St Tydfils Main Building/F 2	Office T584	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0645	Condition Monitoring Survey	Int	St Tydfils Main Building/F 2	Office T583	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0646	Condition Monitoring Survey	Int	St Tydfils Main Building/F 2	Office T596	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0647	Condition Monitoring Survey	Int	St Tydfils Main Building/F 2	Office T595	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0648	Condition Monitoring Survey	Int	St Tydfils Main Building/F 2	Office T594	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0649	Condition Monitoring Survey	Int	St Tydfils Main Building/F 2	Office T593	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0650	Condition Monitoring Survey	Int	St Tydfils Main Building/F 2	Office T592	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0651	Condition Monitoring Survey	Int	St Tydfils Main Building/F 2	Corridor T597	Black skirting 50.0m Run	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0652	Condition Monitoring Survey	Int	St Tydfils Main Building/F 2	Corridor T597	Light grey linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0653	Condition Monitoring Survey	Int	St Tydfils Main Building/F 2	Female wc T591	Black skirting 50.0m Run	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0654	Condition Monitoring Survey	Int	St Tydfils Main Building/F 2	Female Wc T591	Blue linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0655	Condition Monitoring Survey	Int	St Tydfils Main Building/F 2	Staircase T582	Black skirting 10.0m Run	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0656	Condition Monitoring Survey	Int	St Tydfils Main Building/F 2	Staircase T582	Light grey linoleum 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0657	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Lobby T476	Brown tiles 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0658	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Assisted shower and wc T444	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0659	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Wc T443	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0660	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Staff wc T446	Cream tile and bitumen 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0661	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	6 bed ward T445	Brown tiles 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0662	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	6 bed ward T445	Pink tiles Small Amounts	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0663	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	6 bed ward T445	Brown tile and bitumen 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0664	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	6 bed ward T445	Pale cream tiles Small Amounts	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0665	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	6 bed ward T445	Tan coloured tiles at door entrance Small Amounts	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0666	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Corridor T477	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0667	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Clean utility T447 Underside of sink	Acoustic pad 1 Item	Sampled	Bitumen	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	4	7
1077922/0668	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Equipment store T449	Cream tile and bitumen 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0669	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Corridor T482a	Cream tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0670	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Single bed ward T474	Brown tile and bitumen 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0671	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Single bed ward T475	Brown tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0672	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	5 bed ward T469	Brown tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0673	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	5 bed ward T468	Brown tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0674	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Assisted bath and wc T470	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0675	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Assisted wc T471	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0676	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Wc T473	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0677	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	First floor ceiling voids	No Access N/A	No Access - Presumed Asbestos	Select Product	No Visible	N/A	No Access	Very Low	3	0	3
1077922/0678	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Nurse station T448	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0679	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Cupboard	Cream floor tiles and bitumen 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0680	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Dirty utility T450	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0681	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Corridor T478	White board 10.0m ²	Sampled	Insulating Board	No Visible	Unsealed Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0682	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	4 bed ward T452	Brown tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0683	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Laundry T454	Cream floor tiles and bitumen 5.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0684	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Clinical waste T467	Grey tile and bitumen 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0685	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Assisted bath and wc T453	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0686	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Single bed ward T456	Brown tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0687	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Single bed ward T457	Brown tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0688	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Ward pantry T466	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0689	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Corridor T480	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0690	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Corridor T479	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0691	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Wheel chair store T451	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0692	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Lobby T481	Brown tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0693	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Lobby T481	Insulating tiles 50.0m ²	Sampled	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0694	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Staircase T483	Brown nosings 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0695	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Staircase T483	Insulating tiles 50.0m ²	Visually Similar To	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0696	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Lobby T481	Above fixed tiles N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0697	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Staircase T483	Above fixed tiles N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0698	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Lobby T482	Cream floor tiles and bitumen 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0699	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Doctor T463	Cream floor tiles and bitumen 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0700	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Lobby T482	Pale cream tiles Small Amounts	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0701	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Quiet room T458	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0702	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Sister T462	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0703	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Dining day room T459	Brown tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0704	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Assisted wc T460	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0705	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Assisted wc T461	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0706	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Corridor T581	Grey specked linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0707	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Domestic T465	Black vinyl strip Small Amounts	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0708	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Domestic T465	Grey specked linoleum 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0709	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Store T464	Brown tile and bitumen 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0710	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Treatment room T559	Blue tiles 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0711	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Treatment room T559 Underside of sink	Acoustic pads 3 Items	Sampled	Bitumen	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	4	7
1077922/0712	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Store T558 Ceiling void	Cement tile used as packing Small Amounts	Sampled	Cement	Low	Painted/Sealed Cement	Chrysotile	Very Low	3	4	7
1077922/0713	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Store T558	Insulating tiles 10.0m ²	Visually Similar To	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0714	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Kitchen T563 Underside of sink	Acoustic pads 2 Items	Sampled	Bitumen	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	4	7
1077922/0715	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Wc T560	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0716	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Consulting room T562	Above fixed ceiling tiles N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0717	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Store T577	Above fixed ceiling tiles N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0718	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Corridor T578	Above fixed ceiling tiles N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0719	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Physiotherapy	Above fixed ceiling tiles N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0720	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Staircase T564	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0721	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Corridor T579	Insulating tiles 50.0m ²	Sampled	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0722	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Corridor T579	Beige linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0723	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Corridor T579	Above fixed ceiling tiles N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0724	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Female wc T568	Above fixed ceiling tiles N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0725	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Male wc T567 Ceiling void	Slate packers Small Amounts	Sampled	Cement	Low	Unsealed Cement	Chrysotile	Very Low	4	4	8
1077922/0726	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Store T569	Insulating tiles 10.0m ²	Visually Similar To	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0727	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Store T569	Beige linoleum 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0728	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Store T569	Above fixed ceiling tiles N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0729	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Dish wash T573	Beige mottled linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0730	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Servery T571	Beige mottled linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0731	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Entrance to dining area	Beige mottled linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0732	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Dish wash T573	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0733	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Attic space Attic	Limited access due to height restrictions and visual restrictions N/A	Presumed Asbestos	Insulating Board	No Visible	N/A	Asbestos	Low	5	2	7
1077922/0734	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Store T570	Cream floor tiles and bitumen 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0735	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Store T570	Insulating tiles 5.00m ²	Visually Similar To	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0736	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Store T570	Above fixed ceiling tiles N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0737	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Entrance to dining area	Insulating tiles 5.00m ²	Visually Similar To	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0738	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Entrance to dining area	Above fixed ceiling tiles N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0739	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Corridor 1	Insulating tiles 50.0m ²	Sampled	Insulating Board	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0740	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Corridor 1	Grey specked linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0741	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	6 bed ward T640	Grey tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0742	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Single bed ward T641	Grey tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0743	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Single bed ward	Grey tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0744	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	5 bed ward T646	Grey tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0745	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	5 bed ward T647	Grey tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0746	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Assisted bath and wc T645	Grey specked linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0747	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Assisted wc T644	Grey specked linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0748	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Wc T643	Grey specked linoleum 5.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0749	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Corridor T670	Cream floor tiles and bitumen adhesive 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0750	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Cupboard 1	Cream floor tiles and bitumen adhesive 5.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0751	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Lobby T639	Cream floor tiles and bitumen adhesive 5.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0752	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Store T639a	Cream floor tiles and bitumen adhesive 5.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0753	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Disabled T638	Grey specked linoleum 5.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0754	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Nurse station T648	Cream floor tiles and bitumen adhesive 5.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0755	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Corridor T671	Cream floor tiles and bitumen adhesive 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0756	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Equipment store T649	Cream floor tiles and bitumen adhesive 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0757	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Staff wc T650	Cream floor tiles and bitumen adhesive 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0758	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Clean utility T651 Underside of sink	Acoustic pads 3 Items	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	Chrysotile	Very Low	2	4	6
1077922/0759	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Clean utility T651	Brown tile 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0760	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Dirty utility T653 Underside of sink	Acoustic pads 2 Items	Sampled	Bitumen	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	4	7
1077922/0761	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Dirty utility T653	Grey specked linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0762	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Wheel chair store T652	Cream floor tiles and bitumen adhesive 5.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0763	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Cupboard 2	Cream floor tiles and bitumen adhesive 5.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0764	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Laundry T655	Cream floor tiles and bitumen adhesive 5.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0765	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	4 bed ward T654	Grey tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0766	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Assisted bath and wc T656	Grey specked linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0767	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Disposal T689	Grey tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0768	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Corridor T672	Cream floor tiles and bitumen adhesive 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0769	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Assisted shower and wc T657	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0770	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Corridor T673	Cream floor tiles and bitumen adhesive 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0771	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Single bed ward T658	Grey tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0772	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Single bed ward T659	Grey tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0773	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Corridor T672	Fawn coloured tile Small Amounts	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0774	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Corridor T673	White tile Small Amounts	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0775	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Ward pantry T668	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0776	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Above all areas on first floor Ceiling voids	Panels N/A	Presumed Asbestos	Insulating Board	No Visible	N/A	Asbestos	Low	5	2	7
1077922/0777	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Store T667	Ceiling tiles 10.0m ²	Sampled	Insulating Board	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0778	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Store T667	Cream floor tiles and bitumen 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0779	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Store T667	Above fixed tiles N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0780	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Store T667 Wall	Electrical Boxes N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0781	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Store T667	Grey specked linoleum 5.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0782	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Corridor T580	Beige linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0783	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Lobby T674	Beige linoleum 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0784	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Lobby T674	Ceiling tiles 10.0m ²	Visually Similar To	Insulating Board	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0785	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Lobby T674	Above fixed ceiling tiles N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0786	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Lift	Black linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0787	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Assistant wc T662	Grey specked linoleum 5.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0788	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Assistant wc T661	Grey specked linoleum 5.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0789	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Dining/day room T663	Green tile and bitumen 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0790	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Chapel T660	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0791	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Sister T664	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0792	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Lobby T675	Cream floor tiles and bitumen adhesive 6.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0793	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Lobby T675	White tile Small Amounts	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0794	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Ward pantry T471	Beige linoleum 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0795	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Corridor T734	White tile 50.0m ²	Sampled	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0796	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Corridor T734	Above fixed tiles N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0797	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Loft	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0798	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Ward pantry T741	Acoustic pads Small Amounts	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0799	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Day room T749	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0800	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Disposable T737	Beige linoleum 5.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0801	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Disposable T737	Loose tiles Small Amounts	Visually Similar To	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0802	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Store T736	Beige linoleum 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0803	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Store T735	Beige linoleum 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0804	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Ward T730	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0805	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Ward T730 stairs	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0806	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Sister office T739	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0807	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Bathroom T738	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0808	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	2 bed ward T729	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0809	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Staff wc T733	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0810	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Drug store T732	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0811	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Nurse station T731	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0812	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Single bed ward T728	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0813	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Single bed ward T727	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0814	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Bathroom T725	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0815	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Sluice room T726	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0816	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Wc T727a	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0817	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Loft area Loft	Panels N/A	Presumed Asbestos	Insulating Board	No Visible	N/A	Asbestos	Low	5	0	5
1077922/0818	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Reception 509	Bitumen membrane 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0819	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Porters room T511 Under pipe	Cement packer under pipe Small Amounts	Sampled	Cement	Low	Unsealed Cement	Chrysotile	Very Low	4	5	9
1077922/0820	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Store T506	Cream floor tile and bitumen 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0821	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Waiting room T504	Bitumen membrane 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0822	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Entrance lobby T503	Bitumen membrane 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0823	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T512	Cream floor tile with brown fleck and bitumen 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0824	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Kitchen T501	Cream floor tile with brown fleck and bitumen 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0825	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Kitchen T501 Underside of sink	Acoustic pad 1 Item	Sampled	Bitumen	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	4	7
1077922/0826	Condition Monitoring Survey	Int	St Tydfils Main Building/G	General office T502	Bitumen membrane 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0827	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Porters rest room T506	Acoustic pad 1 Item	Sampled	Bitumen	Low	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0828	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Porters rest room T506	Cream floor tile with brown fleck and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0829	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Porters rest room T506 Fixed ceiling panel	Cement board 10.0m ²	Sampled	Cement	No Visible	Painted/Sealed Cement	Chrysotile	Very Low	2	4	6
1077922/0830	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Visitors wc T507 Fixed ceiling panel	Cement board 10.0m ²	Visually Similar To	Cement	No Visible	Painted/Sealed Cement	Chrysotile	Very Low	2	4	6
1077922/0831	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Stair T508	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0832	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Trolley bay T545	Red linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0833	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Trolley wash T526	Grey linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0834	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Cooking area T547	Ceiling tiles 50.0m ²	Sampled	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0835	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Cooking area T547/cooking prep T548	Above fixed tiles N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0836	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Store T527	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0837	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Catering manager T528	Cream floor tile with brown fleck and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0838	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Trolley bay T545	Black board 10.0m ²	Sampled	Insulating Board	No Visible	Unsealed Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0839	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Cooking prep	Black board 2.00m ²	Visually Similar To	Insulating Board	No Visible	Unsealed Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0840	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Wash area T529	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0841	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Chill prep T549	Black board 2.00m ²	Visually Similar To	Insulating Board	No Visible	Unsealed Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0842	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Pastry and diet prep T550	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0843	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Cooking prep T454 Underside of movable trolley	Acoustic pads 3 items	Sampled	Bitumen	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	5	8
1077922/0844	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T552	Black board 2.00m ²	Visually Similar To	Insulating Board	No Visible	Unsealed Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0845	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Deep freeze T533	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0846	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Chill room T531	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0847	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Meat and fish prep T532	Cream floor tile with brown fleck and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0848	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Dry store T534	Cream floor tile with brown fleck and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0849	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T553	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0850	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Day store T535	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0851	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Hardware and cookery store T538	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0852	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Veg prep T539	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0853	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Day to day store T548	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0854	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T554	Tiles 50.0m ²	Sampled	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0855	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T555	Tiles 50.0m ²	Visually Similar To	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0856	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T554/T555	Above fixed tiles N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0857	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Dry waste store	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0858	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Shower/wc T542	Tiles 50.0m ²	Visually Similar To	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0859	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Shower/wc T542	Grey linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0860	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Store T545	Cream floor tile with brown fleck and bitumen 3.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0861	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Hotel services manager T543	Tiles 25.0m ²	Visually Similar To	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0862	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Hotel services manager T543	Above fixed tiles N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0863	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Secretary T543a	Tiles 25.0m ²	Visually Similar To	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0864	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Secretary T543a	Above fixed tiles N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0865	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Stairs T536	Beige tiles and bitumen 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0866	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Function Room	Beige tiles and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0867	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Switch room T544	Cream floor tile with brown fleck and bitumen 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0868	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Switch room T544 Wall	Electric boards N/A	Presumed Asbestos	Rope	No Visible	N/A	Asbestos	Low	5	4	9

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0869	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Store T510	Cream floor tile with brown fleck and bitumen 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0870	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Abernant room T401	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0871	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Lobby T435	Pale blue linoleum 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0872	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Lobby T435	Pale blue linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0873	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T436	Pale blue linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0874	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T436	Pale blue linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0875	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Staff wc T404	Cream tile and bitumen 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0876	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Staff wc T404	Beige tile and bitumen Small Amounts	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0877	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Clean utility T405 Underside of sink	Acoustic pads 2 Items	Sampled	Bitumen	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	4	7
1077922/0878	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Equipment store T407	Cream tile and bitumen 5.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0879	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Bedinog bay T409	Beige tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0880	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Dirty utility T408 Underside of sink	Acoustic pads 2 Items	Sampled	Bitumen	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	4	7
1077922/0881	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T437	Cream tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0882	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T437	Brown tile Small Amounts	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0883	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T437	Mustard tile Small Amounts	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0884	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Hirwaun bay T410	Brown tile and bitumen 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0885	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Hirwaun bay T410	Deep brown tile and bitumen 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0886	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Hirwaun bay T410	Mustard colour tiles Small Amounts	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0887	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Laundry T412	Cream tile and bitumen 5.00m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0888	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Laundry T412	Mustard tile Small Amounts	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0889	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Double room T434	Brown tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0890	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Newton bay T426	Brown tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0891	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Cwmdare room T433	Brown tile and bitumen 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0892	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Wc T432	Grey linoleum 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0893	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Pennar bay T427	Brown tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0894	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Assistant bath and wc T429	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0895	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Assistant wc T430	Grey linoleum 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0896	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T442	Cream tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0897	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T442	Mustard tile Small Amounts	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0898	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T442	Brown tile and bitumen 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0899	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Assistant bath and wc T411	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0900	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T438	Cream tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0901	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T439	Cream tile and bitumen 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0902	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Doctor T414	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0903	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Sister T415	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0904	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Ward pantry T425	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0905	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Sensory room T413	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0906	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Disposal store T426	Grey tile and bitumen 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0907	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Staircase T416	Brown tiles and bitumen 50.0m ²	Sampled	Vinyl	Low	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0908	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Staircase T416	Peach coloured tile and bitumen Small Amounts	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0909	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Lobby T440	Brown tiles and bitumen 10.0m ²	Visually Similar To	Vinyl	Low	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0910	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Lobby T440	Tan coloured tile and bitumen Small Amounts	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0911	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Store T423	Ceiling tiles 10.0m ²	Sampled	Insulating Board	No Visible	Unsealed Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0912	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Store T423	Cream tile and bitumen 10.0m ²	Sampled	Vinyl	Low	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0913	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Store T423 Wall	Electrical boxes N/A	Presumed Asbestos	Rope	No Visible	N/A	Asbestos	Low	5	4	9
1077922/0914	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Quiet room T417	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0915	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Quit smoking room T422	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0916	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Dining/day room T418	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0917	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Assistant wc T419	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0918	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Assistant wc T420	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0919	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T523	Grey linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0920	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T523	Ceiling tiles 50.0m ²	Visually Similar To	Insulating Board	No Visible	Unsealed Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0921	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T523	Paneling 50.0m ²	Sampled	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0922	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T523	Black nosings 2 Items	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0923	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Domestic T424	Grey linoleum 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0924	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T523	Above fixed tiles N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0925	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T556	Cream tile and bitumen 10.0m ²	Visually Similar To	Vinyl	Low	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0926	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T556	Ceiling tiles 10.0m ²	Visually Similar To	Insulating Board	No Visible	Unsealed Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0927	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T556	Above fixed ceiling tiles N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0928	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T557	Cream tile and bitumen 50.0m ²	Visually Similar To	Vinyl	Low	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0929	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T557	Ceiling tiles 50.0m ²	Visually Similar To	Insulating Board	No Visible	Unsealed Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0930	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T557	Above fixed tiles N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0931	Condition Monitoring Survey	Int	St Tydfils Main Building/G	X-ray room T515	Cream tile and bitumen 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0932	Condition Monitoring Survey	Int	St Tydfils Main Building/G	X-ray room T515	Above fixed tiles N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0933	Condition Monitoring Survey	Int	St Tydfils Main Building/G	X-ray room T514	Cream tile and bitumen 25.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0934	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Office T516	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0935	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Wc T517	Cream tile and bitumen 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0936	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Wc T518	Multi coloured linoleum 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0937	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Cloaks T520	Cream tile and bitumen 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0938	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Changing T519	Cream tile and bitumen 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0939	Condition Monitoring Survey	Int	St Tydfils Main Building/G	X-ray room T515 Wall	Electrics N/A	Presumed Asbestos	Rope	No Visible	N/A	Asbestos	Low	5	5	10

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0940	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T522	Cream floor tile and bitumen 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0941	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T522	Ceiling tiles 50.0m ²	Visually Similar To	Insulating Board	No Visible	Unsealed Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0942	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T522	Above fixed tiles N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0943	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Waiting T521	Cream floor tile and bitumen 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0944	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T522	Infill paneling 10.0m Run	Visually Similar To	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0945	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Plant room T513	Cream floor tile and bitumen 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0946	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Domestic T629	Grey linoleum 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0947	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T522	Black nosings Small Amounts	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0948	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Secretary T525	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0949	Condition Monitoring Survey	Int	St Tydfils Main Building/G	League of friends T524	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0950	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Clean utility T614 Underside of sink	Acoustic pads 3 Items	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	Chrysotile	Very Low	2	4	6
1077922/0951	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Clean utility T614	Red tile and bitumen 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0952	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Equipment store T612	Cream tile and bitumen 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0953	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Nurse station T611	Beige tile 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0954	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Nurse station T611	Cream tile and bitumen 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0955	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Staff wc T613	Cream tile and bitumen 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0956	Condition Monitoring Survey	Int	St Tydfils Main Building/G	6 bed ward T603	Grey tile and bitumen 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0957	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Store T602	Cream tile and bitumen 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0958	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Lobby T602	Cream tile and bitumen 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0959	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Disabled wc T601	Grey linoleum 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0960	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T633	Cream tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0961	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Single bed ward T604	Grey tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0962	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Single bed ward T605	Grey tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0963	Condition Monitoring Survey	Int	St Tydfils Main Building/G	5 bed ward T610	Grey tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0964	Condition Monitoring Survey	Int	St Tydfils Main Building/G	5 bed ward T609	Grey tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0965	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Assistant bath and wc T608	Grey linoleum 25.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0966	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Assistant wc T607	Grey linoleum 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0967	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Wc T606	Grey linoleum 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0968	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T634	Cream tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0969	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T634	Green tile 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0970	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Dirty utility T616	Acoustic pad 1 Item	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0971	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Wheel chair store T615	Cream tile and bitumen 25.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0972	Condition Monitoring Survey	Int	St Tydfils Main Building/G	4 bed ward T617	Grey tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0973	Condition Monitoring Survey	Int	St Tydfils Main Building/G	4 bed ward T617	Beige tile and bitumen Small Amounts	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0974	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Disposal T632	Grey floor tile and bitumen 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0975	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Laundry T618	Cream floor tile and bitumen 10.0m ²	Sampled	Vinyl	Low	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0976	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Assisted bath and wc T619	Grey linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0977	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Assistant bath and wc T620	Grey linoleum 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0978	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Disposal T621	Grey floor tile and bitumen 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0979	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Sister T622	Grey floor tile and bitumen 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0980	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T635	Cream floor tile and bitumen 10.0m ²	Visually Similar To	Vinyl	Low	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0981	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T636	Cream floor tile and bitumen 10.0m ²	Visually Similar To	Vinyl	Low	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0982	Condition Monitoring Survey	Int	St Tydfils Main Building/G	ECG store T637a	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0983	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Store T630	Cream floor tile and bitumen 10.0m ²	Visually Similar To	Vinyl	Low	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0984	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Store T630	Tiles 10.0m ²	Sampled	Insulating Board	No Visible	Unsealed Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/0985	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Store T630 Wall	Electrics N/A	Presumed Asbestos	Rope	No Visible	N/A	Asbestos	Low	5	4	9
1077922/0986	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Lobby T637 Floor	Brown tile and bitumen 10.0m ²	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	Chrysotile	Very Low	2	5	7
1077922/0987	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Stairs over ECG store	Brown nosings 50.0m Run	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0988	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Stairs over ECG store Floor	Brown tile and bitumen 10.0m ²	Visually Similar To	Bitumen	No Visible	Reinforced - Composite Materials	Chrysotile	Very Low	2	3	5
1077922/0989	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Stairs over ECG store	Cream floor tile and bitumen Small Amounts	Visually Similar To	Vinyl	Low	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0990	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Dining/day room T628	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/0991	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Assistant wc T625	Grey linoleum 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0992	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Assistant wc T624	Grey linoleum 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0993	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Quiet room T623	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0994	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Quiet room T627	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0995	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Chiropodist T628	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0996	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Lobby T636a	Cream floor tile and bitumen 10.0m ²	Visually Similar To	Vinyl	Low	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/0997	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Ward pantry T707 Underside of sink	Acoustic pads 2 Items	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	Chrysotile	Very Low	2	4	6
1077922/0998	Condition Monitoring Survey	Int	St Tydfils Main Building/G	OT activities room T706	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/0999	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T714	Cream tile and bitumen 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/1000	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Store T704	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/1001	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Office T705	Cream tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/1002	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T724	Black nosing 1 Item	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/1003	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T702	Beige linoleum 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/1004	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Wc T772	Beige linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/1005	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Waiting room T703	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/1006	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Female wc T709	Cream tile and bitumen 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/1007	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Male wc T706	Cream tile and bitumen 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/1008	Condition Monitoring Survey	Int	St Tydfils Main Building/G	ECT treatment T723	Acoustic pad 1 Item	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/1009	Condition Monitoring Survey	Int	St Tydfils Main Building/G	ECT treatment T723	Beige linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/1010	Condition Monitoring Survey	Int	St Tydfils Main Building/G	ECG recovery T701	Beige linoleum 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/1011	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Store T721	Cream tile and bitumen 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/1012	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Corridor T710	Cream tile and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/1013	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Dirty utility T720 Underside of sink	Acoustic pads 2 Items	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	Chrysotile	Very Low	2	4	6
1077922/1014	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Dirty utility T720 Wall	Electrics N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/1015	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Dirty utility T720	Grey linoleum 25.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/1016	Condition Monitoring Survey	Int	St Tydfils Main Building/G	ADL kitchen T719	Acoustic pad 1 Item	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/1017	Condition Monitoring Survey	Int	St Tydfils Main Building/G	ADL kitchen T719	Maroon flecked tile 10.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/1018	Condition Monitoring Survey	Int	St Tydfils Main Building/G	ADL kitchen T718	Brown coloured tile and bitumen 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/1019	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Day/dining/activity room T711	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/1020	Condition Monitoring Survey	Int	St Tydfils Main Building/G	ADL bathroom T718	Grey linoleum 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/1021	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Medical records T717	Cream tiles and bitumen 50.0m ²	Sampled	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/1022	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Office T716	Cream tiles and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/1023	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Community Psychological nurse T712	Cream tiles and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/1024	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Assistant wc T713	Grey linoleum 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/1025	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Assistant wc T715	Grey linoleum 10.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/1026	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Day room T714	Cream tiles and bitumen 50.0m ²	Visually Similar To	Vinyl	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/1027	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Pipe tunnel	No Access N/A	Presumed Asbestos	Thermal Lagging	No Visible	N/A	Asbestos	Low	6	0	6
1077922/1028	Condition Monitoring Survey	Ext	St Tydfils Main Building/G	Yard 1	Felt roof 50.0m ²	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/1029	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Plant room T537 Ceiling	Insulating panels 10.0m ²	Sampled	Insulating Board	No Visible	Painted/Encapsulated Board	Amosite	Low	5	4	9
1077922/1030	Condition Monitoring Survey	Ext	St Tydfils Main Building/G	Yard 2 Wall	Bitumen membrane 50.0m Run	Sampled	Bitumen	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	1	4
1077922/1031	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Over hotel services managers office and secretary office	No Asbestos N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/1032	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Over kitchen stores etc. Flat roof	Bitumen felt 50.0m ²	Presumed Asbestos	Bitumen	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	2	5
1077922/1033	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Beneath disposal T426	Room containing pipe work N/A	Presumed Asbestos	Thermal Lagging	No Visible	N/A	Asbestos	Low	6	0	6
1077922/1034	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Store room T455	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/1035	Condition Monitoring Survey	Ext	St Tydfils Main Building/G	Corridor T523/T557 Wall above and below windows	Red painted panels 50.0m ²	Sampled	Cement	No Visible	Painted/Sealed Cement	Chrysotile	Very Low	2	6	8
1077922/1036	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Loading bay	Underside of hangover 50.0m ²	Sampled	Cement	No Visible	Painted/Sealed Cement	No Asbestos Detected	Non asbestos	0	0	0
1077922/1037	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Loading bay	Tongue and groove 50.0m ²	Sampled	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/1038	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Loading bay	Roof felt 10.0m ²	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/1039	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Loading bay	Bitumen Small Amounts	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/1040	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Loading bay	Insulation board 10.0m ²	Sampled	Insulating Board	No Visible	Unsealed Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/1041	Condition Monitoring Survey	Int	St Tydfils Main Building/G	All areas Floor	Ducts N/A	Presumed Asbestos	Thermal Lagging	No Visible	N/A	Asbestos	Low	6	0	6

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/1042	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/G	Builders store	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/1043	Condition Monitoring Survey	Ext	St Tydfils, Workshops/F 1	Builders store Flat roof	Felt 25.0m ²	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	Chrysotile	Very Low	2	2	4
1077922/1044	Condition Monitoring Survey	Int	St Tydfils, Workshops/F 1	Electricians store FF38 Shelves	Fuse flash guards Small Amounts	Sampled	Rope	No Visible	N/A	Asbestos Removed	Non asbestos	0	0	0
1077922/1045	Condition Monitoring Survey	Int	St Tydfils, Workshops/F 1	Plumber FF39	Insulating tile Small Amounts	Sampled	Insulating Board	Medium	Unsealed Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/1046	Condition Monitoring Survey	Ext	St Tydfils, Workshops/G	Plumber FF38/store FF34 Roof edges and centre	Ridge sections 10.0m ²	Sampled	Cement	Low	Unsealed Cement	Chrysotile	Very Low	4	1	5
1077922/1047	Condition Monitoring Survey	Ext	St Tydfils Main Building/G	Plumber FF38/store FF34 Roof	Profiled sheets 50.0m ²	Sampled	Cement	Low	Unsealed Cement	Chrysotile	Very Low	4	2	6
1077922/1048	Condition Monitoring Survey	Int	St Tydfils Main Building/G	Toilets FF28	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/1049	Condition Monitoring Survey	Ext	St Tydfils Main Building/F 1	Toilets FF28	Bitumen membrane 50.0m Run	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0
1077922/1050	Condition Monitoring Survey	Ext	St Tydfils Main Building/F 1	Roof of stores Roof	Replacment tiles Small Amounts	Sampled	Cement	Low	Unsealed Cement	Chrysotile	Very Low	4	1	5
1077922/1051	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Roof of new part over front entrance of day care unit and on second floor roof Roof	Tiles Small Amounts	Presumed Asbestos	Cement	Low	Unsealed Cement	Chrysotile	Very Low	4	2	6
1077922/1052	Condition Monitoring Survey	Int	St Tydfils Main Building/B	Workshop 1 032	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/1053	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Store 16 031	No Suspect ACMs N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/1054	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Lobby 030	No Suspect ACM Observed N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/1055	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Entrance lobby GF05	Tongue and groove panels 10.0m ²	Sampled	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/1056	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/G	Underside of ambulance drop off canopy	Tongue and groove panels 50.0m ²	Visually Similar To	Insulating Board	No Visible	Painted/Encapsulated Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/1057	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Duct 029 Wall on cables	Debris Small Amounts	Sampled	Debris	High	Debris	Asbestos Removed	Non asbestos	0	0	0
1077922/1058	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Duct 029 Top of pipes	Debris Small Amounts	Sampled	Debris	Visible Debris	Debris	Asbestos Removed	Non asbestos	0	0	0
1077922/1059	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Duct 029 Wall	Debris Small Amounts	Sampled	Debris	Visible Debris	Debris	Asbestos Removed	Non asbestos	0	0	0
1077922/1060	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Duct 029 Floor	Debris Small Amounts	Sampled	Debris	Visible Debris	Debris	Asbestos Removed	Non asbestos	0	0	0
1077922/1061	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Duct 029 Floor/wall	Debris Small Amounts	Sampled	Debris	Visible Debris	Debris	Asbestos Removed	Non asbestos	0	0	0
1077922/1062	Condition Monitoring Survey	Int	St Tydfils Day Care unit/B	Workshop 3, 034	General Observations N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/1063	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Workshop 2, 033	General Observations N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/1064	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Store 18, 036	General Observations N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/1065	Condition Monitoring Survey	Int	St Tydfils Day Care Unit/B	Store 17, 035	General Observations N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/1066	Condition Monitoring Survey	Ext	St Tydfils, Central Offices/F 2	Roof	No access tank room to roof N/A	Presumed Asbestos	Insulating Board	No Visible	N/A	Asbestos	Low	5	0	5
1077922/1067	Condition Monitoring Survey	Int	St Tydfils, Workshops/G	Incinerator 01/Store 02	Board 20.0m ²	Sampled	Insulating Board	No Visible	Unsealed Board	No Asbestos Detected	Non asbestos	0	0	0
1077922/1068	Condition Monitoring Survey	Ext	St Tydfils Incinerator House/G	Incinerator/Store 01 Roof	Tiles 40.0m ²	Sampled	Cement	No Visible	Unsealed Cement	Chrysotile	Very Low	3	2	5
1077922/1069	Condition Monitoring Survey	Ext	St Tydfils Incinerator House/G	Incinerator/Store 01 Wall	Bitumen membrane 40.0m Run	Sampled	Bitumen	Low	Reinforced - Composite Materials	Chrysotile	Very Low	3	1	4
1077922/1070	Condition Monitoring Survey	Ext	St Tydfils, Workshops/G	Salt stores	Bitumen membrane 50.0m Run	Sampled	Bitumen	No Visible	Reinforced - Composite Materials	No Asbestos Detected	Non asbestos	0	0	0

Materials Register : Combined - All Records

Created On 25/10/2012

St Tydfils Hospital - showing 1083 records														
Assess' Number	Survey Type	Int / Ext	Building/Floor	Location and Position	Description and Extent	Material Identification	Product Type	Damage / Deterioration	Surface Treatment	Asbestos Type	Material Risk Category	Material Risk	Priority Risk	Total Risk
1077922/1071	Condition Monitoring Survey	Ext	St Tydfils, Workshops/G	Salt stores Wall	Redundant flue pipe 1.00m Run	Sampled	Cement	Low	Unsealed Cement	Chrysotile	Very Low	4	1	5
1077922/1072	Condition Monitoring Survey	Int	St Tydfils, Workshops/G	Generator House 01 Generator exhaust	Flange gasket 1 Item	Sampled	Gasket	No Visible	Reinforced - Composite Materials	Chrysotile	Very Low	3	4	7
1077922/1073	Condition Monitoring Survey	Int	St Tydfils, Workshops/G	Generator House 01	Rope 50.0m Run	Sampled	Rope	No Visible	Encapsulated Textile/Paper	No Asbestos Detected	Non asbestos	0	0	0
1077922/1074	Condition Monitoring Survey	Int	St Tydfils, Workshops/G	Generator House 01 Wall	Live switch gear Small Amounts	Presumed Asbestos	Rope	No Visible	N/A	Asbestos	Low	5	3	8
1077922/1075	Condition Monitoring Survey	Int	St Tydfils, Workshops/G	Generator House 01	Floor duct N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/1076	Condition Monitoring Survey	Ext	St Tydfils Day Care Unit/G	Store GF44 Below window	White panel 10.0m ²	Sampled	Cement	No Visible	Painted/Sealed Cement	Chrysotile	Very Low	2	2	4
1077922/1077	Condition Monitoring Survey	Ext	St Tydfils, Workshops/G	Chimney Stack Lining	Panel N/A	Presumed Asbestos	Insulating Board	No Visible	N/A	Asbestos	Low	5	0	5
1077922/1078	Condition Monitoring Survey	Ext	St Tydfils, Workshops/G	Tanks Lining	No access N/A	Presumed Asbestos	Insulating Board	No Visible	N/A	Asbestos	Low	5	0	5
1077922/1079	Condition Monitoring Survey	Ext	St Tydfils Day Care unit/G	Front entrance Facia	Fascia board/soffit 30.0m Run	Sampled	Cement	Low	Painted/Sealed Cement	Chrysotile	Very Low	3	2	5
1077922/1080	Condition Monitoring Survey	Ext	St Tydfils Main Building/F 1	Lift motor room Wall	Cement sheets 10.0m ²	Sampled	Cement	Low	Painted/Sealed Cement	Chrysotile	Very Low	3	2	5
1077922/1081	Condition Monitoring Survey	Int	St Tydfils Main Building/F 1	Lift Motor Rooms Lift machinery	Brake Pad 2 Items	Presumed Asbestos	Cement	Low	Unsealed Cement	Asbestos	Low	6	5	11
1077922/1082	Condition Monitoring Survey	Int	St Tydfils, Workshops/G	Water Tank	General Observations N/A	No Suspect ACM	Select Product	No Visible	N/A	No Asbestos Detected	Non asbestos	0	0	0
1077922/1083	Condition Monitoring Survey	Int	St Tydfils, Psychiatric Unit/F 3	Psychiatric Unit Lift Plant room electrical box	Rope Small Amounts	Presumed Asbestos	Rope	No Visible	N/A	Asbestos	Low	5	4	9
1077922/1084	Condition Monitoring Survey	Int	St Tydfils Main Building/F 3	Main block lift plant room Electrical Box	Electrical Board Small Amounts	Presumed Asbestos	Rope	No Visible	N/A	Asbestos	Low	5	2	7

APPENDIX 4 – ASBESTOS SURVEY

Summary of asbestos identified during asbestos survey at St Tydfil's Hospital.

INTERIOR/ EXTERIOR (INT/EXT)	BUILDING/FLOOR	LOCATION AND POSITION	DESCRIPTION AND EXTENT	MATERIAL IDENTIFICATION	PRODUCT TYPE	DAMAGE / DETERIORATION	SURFACE TREATMENT	ASBESTOS TYPE	MATERIAL RISK CATEGORY
Int	St Tydfils, Psychiatric Unit/F 1	Corridor TS253 Ceiling void	Flange gasket Small Amounts	Sampled	Gasket	No Visible	Encapsulated Textile/Paper	Chrysotile	Low
Int	St Tydfils, Psychiatric Unit/F 1	Clean utility TS233 Underside of sink	Acoustic pads 2 Items	Sampled	Bitumen	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils, Psychiatric Unit/F 1	Dirty utility TS232 Underside of sink	Acoustic pads 2 Items	Sampled	Bitumen	Low	Reinforced Composite Materials	Chrysotile	Very low
Int	St Tydfils, Psychiatric Unit/F 1	Lift TS251a Electric Cupboard	Electric box N/A	Presumed Asbestos	Rope	No Visible	N/A	Asbestos	Low
Int	St Tydfils, Psychiatric Unit/F 2	Dirty utility TS267 Underside of sink	Acoustic pad 1 Item	Sampled	Bitumen	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils, Psychiatric Unit/F 3	Lift motor room	No Access N/A	No Access Presumed Asbestos	-	No Visible	N/A	No Access	Very Low
Int	St Tydfils, Psychiatric Unit/F 3	Lift motor room Electric box	Electrics N/A	Presumed Asbestos	Rope	No Visible	N/A	Asbestos	Low
Int	St Tydfils, Psychiatric Unit/F 2	Clean utility TS268 Underside of sink	Acoustic pad 1 Item	Sampled	Bitumen	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils, Psychiatric Unit/F 2	Ward pantry TS287 Underside of sink	Acoustic pads 4 Items	Sampled	Bitumen	Low	Reinforced Composite Materials	Chrysotile	Very Low
Ext	St Tydfils, Psychiatric Unit/G	Front of building Wall	Bitumen membrane 50.0m Run	Sampled	Bitumen	No Visible	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils, Central Offices/F 1	Office TF119a Ceiling	Boxing to beam 10.0m2	Visually Similar To	Insulating Board	No Visible	Painted/Encapsulat ed Board	Amosite	Low

INTERIOR/ EXTERIOR (INT/EXT)	BUILDING/FLOOR	LOCATION AND POSITION	DESCRIPTION AND EXTENT	MATERIAL IDENTIFICATION	PRODUCT TYPE	DAMAGE / DETERIORATION	SURFACE TREATMENT	ASBESTOS TYPE	MATERIAL RISK CATEGORY
Int	St Tydfils, Central Offices/G	Corridor TF027	Cream tile and bitumen 10.0m2	Sampled	Vinyl	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils, Central Offices/G	Corridor TF027 Floor	Green tile and bitumen 1.00m2	Sampled	Vinyl	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils, Central Offices/B	Boiler Room Electric boxes	Boiler Room Wall N/A	Presumed Asbestos	Rope	No Visible	N/A	Asbestos	Low
Int	St Tydfils, Central Offices/B	Boiler Room Electric boxes	Fuse flash guards presumed to be inside electrics Small Amounts	Presumed Asbestos	Cloth	No Visible	N/A	Asbestos	Low
Int	St Tydfils Laundry Store/G	Store Ceiling	Insulating panel 50.0m2	Sampled	Insultaing board	Low	Painted/ Encapsulated Board	Amosite	Low
Int	St Tydfils Laundry Store/G	Store Floor	Beige tile and bitumen Small Amounts	Sampled	Vinyl	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Laundry Store/G	Soffit to side of building Soffit	Insulating panels 25.0m Run	Sampled	Insulating Board	Low	Unsealed board	Amosite	Medium
Int	St Tydfils Day Care Unit/G	Sisters office GF34 Ceiling void underneath RSJ	Slate packer Small Amounts	Sampled	Cement	Low	Unsealed Cement	Chrysotile	Very Low
Int	St Tydfils Day Care Unit/G	Sluice GF29 Underside of sink	Acoustic pads 2 Items	Sampled	Bitumen	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Day Care Unit/G	Ward pantry GF36 Underside of sink	Bitumen pads 2 Items	Sampled	Bitumen	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Day Care Unit/G	Clean utility GF28 Underside of sink	Acoustic pad 1 Item	Sampled	Bitumen	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Day Care Unit/G	Day room GF40 Underside of sink	Acoustic pad 2 Items	Sampled	Bitumen	Low	Reinforced Composite Materials	Chrysotile	Very Low

PHASE 1 ASSESSMENT

INTERIOR/ EXTERIOR (INT/EXT)	BUILDING/FLOOR	LOCATION AND POSITION	DESCRIPTION AND EXTENT	MATERIAL IDENTIFICATION	PRODUCT TYPE	DAMAGE / DETERIORATION	SURFACE TREATMENT	ASBESTOS TYPE	MATERIAL RISK CATEGORY
Int	St Tydfils Day Care Unit/G	Day room GF40 Ceiling void	Ceiling void N/A	Presumed Asbestos	Insulating Board	No Visible	N/A	Asbestos	Low
Int	St Tydfils Day Care Unit/G	ADL kitchen GF08 Underside of sink	Acoustic pads 2 Items	Sampled	Bitumen	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Day Care Unit/G	ADL kitchen GF08 Underside of sink	Acoustic pads 2 Items	Sampled	Bitumen	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Day Care Unit/G	Utility/laundry GF21 Underside of sink	Acoustic pad 1 Item	Sampled	Bitumen	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Day Care Unit/G	Store 02	No Access N/A	No Access Presumed Asbestos	-	No Visible	N/A	No Access	Very Low
Int	St Tydfils Day Care Unit/G	Store 69 Floor	Cream tile and bitumen 50.0m2	Sampled	Vinyl	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Day Care Unit/G	Store 68 Floor	Cream tile and bitumen 50.0m2	Visually Similar To	Vinyl	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils, Main Boiler House/G	Mess room 76 Under window	Cream painted panel 10.0m2	Sampled	Cement	No Visible	Painted/ Sealed Cement	Chrysotile	Very Low
Int	St Tydfils, Main Boiler House/G	Mess room 76 Wall	Electric boxes N/A	Presumed Asbestos	Rope	No Visible	N/A	Asbestos	Low
Int	St Tydfils, Main Boiler House/G	Calorifier 77 Pipework behind calorifier 2	Flange gasket Small Amounts	Sampled	Gasket	No Visible	Encapsulated Textile/Paper	Chrysotile	Low
Int	St Tydfils, Main Boiler House/G	Calorifier 77 Wall around pipe	Putty seal around pipe Small Amounts	Sampled	Mastic	No Visible	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils, Main Boiler House/G	Calorifier 77 Wall	Electrical boxes N/A	Presumed Asbestos	Rope	No Visible	N/A	Asbestos	Low

INTERIOR/ EXTERIOR (INT/EXT)	BUILDING/FLOOR	LOCATION AND POSITION	DESCRIPTION AND EXTENT	MATERIAL IDENTIFICATION	PRODUCT TYPE	DAMAGE / DETERIORATION	SURFACE TREATMENT	ASBESTOS TYPE	MATERIAL RISK CATEGORY
Int	St Tydfils, Main Boiler House/G	Calorifier 77 Metal clad pipework	Pipe work N/A	Presumed Asbestos	Paper	No Visible	N/A	Asbestos	Low
Int	St Tydfils, Main Boiler House/G	Calorifier 77 Wall void	No Access N/A	Presumed Asbestos	Other	No Visible	N/A	Asbestos	Low
Int	St Tydfils, Main Boiler House/G	Calorifier 77 Ceiling	No Access N/A	Presumed Asbestos	Other	No Visible	N/A	Asbestos	Low
Int	St Tydfils, Main Boiler House/G	Boiler house 78 Door header	Infill panel Small Amounts	Sampled	Cement	No Visible	Painted/ Sealed Cement	Chrysotile	Very Low
Int	St Tydfils, Main Boiler House/G	Boiler house 78 Pipe at back of boiler one	Rope seal Small Amounts	Sampled	Rope	No Visible	Encapsulated Textile/Paper	Chrysotile	Low
Int	St Tydfils, Main Boiler House/G	Boiler house 78 Pipe at back of boiler two	Rope seal Small Amounts	Visually Similar To	Rope	No Visible	Encapsulated Textile/Paper	Chrysotile	Low
Int	St Tydfils, Main Boiler House/G	Boiler house 78 Boiler one veiwing eye	White seal Small Amounts	Sampled	Gasket	No Visible	Encapsulated Textile/Paper	Chrysotile	Low
Int	St Tydfils, Main Boiler House/G	Boiler house 78 Front of boiler 2 around viewing eye	White seal Small Amounts	Visually Similar To	Gasket	No Visible	Encapsulated Textile/Paper	Chrysotile	Low
Int	St Tydfils, Main Boiler House/G	Boiler house 78 Front of boiler three around veiwing panel	White seal Small Amounts	Visually Similar To	Gasket	No Visible	Encapsulated Textile/Paper	Chrysotile	Low
Int	St Tydfils, Main Boiler House/G	Boiler house 78 Bottom left hand corner of boiler room	Flange gasket Small Amounts	Sampled	Gasket	Low	Unsealed Spray/Lagging/Texti le	Chrysotile	Medium
Int	St Tydfils, Main Boiler House/G	Boiler house 78 Front of boiler three	Cream flange gasket Small Amounts	Sampled	Gasket	No Visible	Encapsulated Textile/Paper	Chrysotile	Low
Int	St Tydfils, Main Boiler House/G	Boiler house 78 Door header	Infill panel Small Amounts	Visually Similar To	Cement	Medium	Painted/ Sealed Cement	Chrysotile	Very Low

INTERIOR/ EXTERIOR (INT/EXT)	BUILDING/FLOOR	LOCATION AND POSITION	DESCRIPTION AND EXTENT	MATERIAL IDENTIFICATION	PRODUCT TYPE	DAMAGE / DETERIORATION	SURFACE TREATMENT	ASBESTOS TYPE	MATERIAL RISK CATEGORY
Int	St Tydfils, Main Boiler House/G	Boiler house 78 Sky lights	Boiler house Small Amounts	Presumed Asbestos	Other	No Visible	N/A	Asbestos	Low
Int	St Tydfils, Main Boiler House/G	Boiler house 78 Wall	Electric boxes N/A	Presumed Asbestos	Rope	No Visible	N/A	Asbestos	Low
Int	St Tydfils, Main Boiler House/G	Boiler house 78 Pipework	Pipe work clad in metal N/A	Presumed Asbestos	Paper	No Visible	N/A	Asbestos	Low
Int	St Tydfils Day Care Unit/G	Electricians workshop 75 Wall	Electric box N/A	Presumed Asbestos	Insulating Board	Low	Unsealed board	Asbestos	Medium
Int	St Tydfils, Main Boiler House/G	Boiler house 78 Back wall	Old coal store N/A	Presumed Asbestos	Thermal Lagging	No Visible	N/A	Asbestos	Low
Ext	St Tydfils, Hafod House/G	Kitchen 006 Roo	Roof slates 50.0m2	Sampled	Cement	Low	Unsealed Cement	Chrysotile	Very Low
Int	St Tydfils, Psychology Therapy Centre/G	All roof area Roof Space	Roof area entry point N/A	Presumed Asbestos	Bitumen	No Visible	N/A	Asbestos	Very Low
Int	St Tydfils, Gardeners Shed/G	Gardeners shed 01 Floor	Slate coloured floor covering 50.0m2	Sampled	Vinyl	No Visible	Reinforced Composite Materials	Chrysotile	Very Low
Ext	St Tydfils, Gardeners Shed/G	Gardeners shed 01 Wall	Expansion joints 50.0m Run	Sampled	Mastic	Low	Reinforced Composite Materials	Chrysotile	Very Low
Ext	St Tydfils, Gardeners Shed/G	Roof	Cement corrugated roof 50.0m2	Sampled	Cement	Low	Reinforced Composite Materials	Chrysotile	Very Low
Ext	St Tydfils, Gardeners Shed/G	Gardeners shed 01 Edge and centre of roof	Corner covering 5.00m2	Sampled	Cement	Low	Unsealed Cement	Chrysotile	Very Low
Ext	St Tydfils, Gardeners Shed/G	Gardeners shed 01 Walls at either end	Corrugated wall cover 50.0m2	Sampled	Cement	Low	Unsealed Cement	Chrysotile	Very Low
Ext	St Tydfils, Gardeners Shed/G	Gardeners shed 01 Wall	Cement rain water goods 25.0m Run	Sampled	Cement	Low	Unsealed Cement	Chrysotile	Very Low

INTERIOR/ EXTERIOR (INT/EXT)	BUILDING/FLOOR	LOCATION AND POSITION	DESCRIPTION AND EXTENT	MATERIAL IDENTIFICATION	PRODUCT TYPE	DAMAGE / DETERIORATION	SURFACE TREATMENT	ASBESTOS TYPE	MATERIAL RISK CATEGORY
Ext	St Tydfils, Gardeners Shed/G	Gardeners shed 01 Wall	Rain water down pipe 6.00m Run	Sampled	Cement	Low	Unsealed Cement	Chrysotile	Very Low
Int	St Tydfils Day Care Unit/B	Female wc 003 Floor	Blue linoleum 50.0m2	Sampled	Vinyl	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Day Care Unit/B	Cupboard 004 Floor	Blue linoleum 4.00m2	Visually Similar To	Vinyl	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Day Care Unit/B	Lobby 002 Floor	Blue linoleum 5.00m2	Visually Similar To	Vinyl	No Visible	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Day Care Unit/B	Lobby 002 step	Black vinyl nosings 2 Items	Sampled	Plastics	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Day Care Unit/B	Male wc 005 Floor	Blue linoleum 5.00m2	Visually Similar To	Vinyl	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Day Care Unit/B	Store 3 008 Door frame	Slate packers Small Amounts	Sampled	Cement	Medium	Unsealed Cement	Chrysotile	Low
Int	St Tydfils Day Care Unit/B	Store 8 015 Floor	Green vinyl tiles and bitumen Small Amounts	Sampled	Vinyl	Medium	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Day Care Unit/B	Store 8 015 Floor	Beige tile and bitumen 50.0m2	Sampled	Vinyl	Medium	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Day Care Unit/B	Corridor 2 009 Ceiling	Slate packing Small Amounts	Sampled	Cement	No Visible	Unsealed Cement	Chrysotile	Very Low
Int	St Tydfils Day Care Unit/B	Corridor 2 009 Redundant pipework	Flange gasket Small Amounts	Sampled	Gasket	Low	Encapsulated Textile/Paper	Chrysotile	Low
Int	St Tydfils Day Care Unit/B	Corridor 4 018 Pipework	Flange gasket Small Amounts	Sampled	Gasket	No Visible	Encapsulated Textile/Paper	Chrysotile	Low
Int	St Tydfils Day Care Unit/B	Stairwell 019 Steps	White nosings 46 Items	Sampled	Vinyl	Low	Reinforced Composite Materials	Amosite	Very Low
Int	St Tydfils Day Care Unit/B	Stairwell 019 Steps	Green tile and bitumen 50.0m2	Sampled	Vinyl	Visible Debris	Reinforced Composite Materials	Chrysotile	Low

PHASE 1 ASSESSMENT

INTERIOR/ EXTERIOR (INT/EXT)	BUILDING/FLOOR	LOCATION AND POSITION	DESCRIPTION AND EXTENT	MATERIAL IDENTIFICATION	PRODUCT TYPE	DAMAGE / DETERIORATION	SURFACE TREATMENT	ASBESTOS TYPE	MATERIAL RISK CATEGORY
Int	St Tydfils Day Care Unit/B	Corridor 5 022 Ceiling	Slate packing Small Amounts	Visually Similar To	Cement	No Visible	Unsealed Cement	Chrysotile	Very Low
Int	St Tydfils Day Care Unit/B	Lift	Redundant Lift N/A	No Access - Presumed Asbestos	-	No Visible	N/A	No Access	Very Low
Int	St Tydfils Day Care Unit/B	Store 14 026 Sterilizer drum	Card wrap 2.00m2	Sampled	Paper	No Visible	Encapsulated Textile/Paper	Chrysotile	Low
Int	St Tydfils Day Care Unit/B	Store 14 026 Inside sterilizer drum	Flange gasket Small Amounts	Sampled	Gasket	Low	Encapsulated Textile/Paper	Chrysotile	Low
Int	St Tydfils Day Care Unit/B	Store 15 028 Pipework	Flange gasket Small Amounts	Sampled	Gasket	No Visible	Encapsulated Textile/Paper	Chrysotile	Low
Int	St Tydfils Day Care Unit/F 1	Craft room FF10 Underside of sink	Acoustic pad 1 Item	Sampled	Bitumen	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Day Care Unit/F 1	Workshop FF14 Underside of sink	Acoustic pad 1 Item	Sampled	Bitumen	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Day Care Unit/F 1	Woodwork FF15 Underside of sink	Acoustic pad 1 Item	Presumed Asbestos	Bitumen	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Day Care Unit/F 1	Lift FF01a	No Access N/A	No Access - Presumed Asbestos	-	No Visible	N/A	No Access	Very Low
Int	St Tydfils Day Care Unit/G	Stairs GF04 Steps	White nosings 36 Items	Sampled	Vinyl	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Day Care Unit/G	Lift GF08a	No Access N/A	No Access - Presumed Asbestos	-	No Visible	N/A	No Access	Very Low
Int	St Tydfils Day Care Unit/F 2	Ward SF20 Floor	White tile Small Amounts	Sampled	Vinyl	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Day Care Unit/F 2	Workshop SF26 Floor, back half of room	Red linoleum 50.0m2	Sampled	Vinyl	Low	Reinforced Composite Materials	Chrysotile	Very Low

PHASE 1 ASSESSMENT

INTERIOR/ EXTERIOR (INT/EXT)	BUILDING/FLOOR	LOCATION AND POSITION	DESCRIPTION AND EXTENT	MATERIAL IDENTIFICATION	PRODUCT TYPE	DAMAGE / DETERIORATION	SURFACE TREATMENT	ASBESTOS TYPE	MATERIAL RISK CATEGORY
Int	St Tydfils Day Care Unit/F 2	Workshop SF25 Floor	Grey linoleum 50.0m2	Sampled	Vinyl	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Day Care Unit/F 2	Store SF22 Floor	Grey linoleum 50.0m2	Visually Similar To	Vinyl	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Day Care Unit/F 2	Store SF22 Inside sluice machine	Flange gaskets Small Amounts	Sampled	Gasket	Low	Reinforced Composite Materials	Chrysotile	Very Low
Ext	St Tydfils Day Care Unit/F 2	Office SF15 Skylight	Rope seal 25.0m Run	Sampled	Rope	Low	Unsealed Spray/Lagging/Texti le	Chrysotile	Medium
Int	St Tydfils Day Care Unit/F 2	Lift SF01a	No Access N/A	No Access Presumed Asbestos	-	No Visible	N/A	No Access	Very Low
Int	St Tydfils Day Care Unit/F 2	Flat roof Inner roof	Flat roof N/A	Presumed Asbestos	Bitumen	Low	Reinforced Composite Materials	Asbestos	Low
Int	St Tydfils Day Care Unit/F 2	Stairs SF31 Floor	Dark green tile 50.0m2	Visually Similar To	Vinyl	Medium	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils, Workshops/F 1	Store FF32 Roof/ceiling in centre of room	Cement profiled sheets 10.0m2	Presumed Asbestos	Cement	Low	Unsealed Cement	Asbestos	Low
Int	St Tydfils, Workshops/F 1	Store FF33 Floor	Deep grey tile and bitumen 50.0m2	Sampled	Vinyl	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Main Building/F 1	Clean utility T447 Underside of sink	Acoustic pad 1 Item	Sampled	Bitumen	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Main Building/F 1	First floor ceiling voids	No Access N/A	No Access Presumed Asbestos	-	No Visible	N/A	No Access	Very Low
Int	St Tydfils Main Building/F 1	Treatment room T559 Underside of sink	Acoustic pads 3 Items	Sampled	Bitumen	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Main Building/F 1	Store T558 Ceiling void	Cement tile used as packing Small Amounts	Sampled	Cement	Low	Painted/ sealed Cement	Chrysotile	Very Low

PHASE 1 ASSESSMENT

INTERIOR/ EXTERIOR (INT/EXT)	BUILDING/FLOOR	LOCATION AND POSITION	DESCRIPTION AND EXTENT	MATERIAL IDENTIFICATION	PRODUCT TYPE	DAMAGE / DETERIORATION	SURFACE TREATMENT	ASBESTOS TYPE	MATERIAL RISK CATEGORY
Int	St Tydfils Main Building/F 1	Kitchen T563 Underside of sink	Acoustic pads 2 Items	Sampled	Bitumen	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Main Building/F 1	Male wc T567 Ceiling void	Slate packers Small Amounts	Sampled	Cement	Low	Unsealed Cement	Chrysotile	Very Low
Int	St Tydfils Main Building/F 1	Attic space Attic	Limited access due to height restrictions and visual restrictions N/A	Presumed Asbestos	Insulating Board	No Visible	N/A	Asbestos	Low
Int	St Tydfils Main Building/F 1	Clean utility T651 Underside of sink	Acoustic pads 3 Items	Sampled	Bitumen	No Visible	Reinforced Composite Materials	Chrysotile	Very low
Int	St Tydfils Main Building/F 1	Dirty utility T653 Underside of sink	Acoustic pads 2 Items	Sampled	Bitumen	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Main Building/F 1	Above all areas on first floor Ceiling voids	Panels N/A	Presumed Asbestos	Insulating Board	No Visible	N/A	Asbestos	Low
Int	St Tydfils Main Building/F 1	Loft area Loft	Panels N/A	Presumed Asbestos	Insulating Board	No Visible	N/A	Asbestos	Low
Int	St Tydfils Main Building/G	Porters room T511 Under pipe	Cement packer under pipe Small Amounts	Sampled	Cement	Low	Unsealed Cement	Chrysotile	Very Low
Int	St Tydfils Main Building/G	Kitchen T501 Underside of sink	Acoustic pad 1 Item	Sampled	Bitumen	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Main Building/G	Porters rest room T506 Fixed ceiling panel	Cement board 10.0m2	Sampled	Cement	No Visible	Painted/ Sealed Cement	Chrysotile	Very Low
Int	St Tydfils Main Building/G	Visitors wc T507 Fixed ceiling panel	Cement board 10.0m2	Visually Similar To	Cement	No Visible	Painted/ Sealed Cement	Chrysotile	Very Low

PHASE 1 ASSESSMENT

INTERIOR/ EXTERIOR (INT/EXT)	BUILDING/FLOOR	LOCATION AND POSITION	DESCRIPTION AND EXTENT	MATERIAL IDENTIFICATION	PRODUCT TYPE	DAMAGE / DETERIORATION	SURFACE TREATMENT	ASBESTOS TYPE	MATERIAL RISK CATEGORY
Int	St Tydfils Main Building/G	Cooking prep T454 Underside of movavle trolley	Acoustic pads 3 Items	Sampled	Bitumen	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Main Building/G	Switch room T544 Wall	Electric boards N/A	Presumed Asbestos	Rope	No Visible	N/A	Asbestos	Low
Int	St Tydfils Main Building/G	Clean utility T405 Underside of sink	Acoustic pads 2 Items	Sampled	Bitumen	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Main Building/G	Dirty utility T408 Underside of sin	Acoustic pads 2 Items	Sampled	Bitumen	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Main Building/G	Store T423 Wall	Electrical boxes N/A	Presumed Asbestos	Rope	No Visible	N/A	Asbestos	Low
Int	St Tydfils Main Building/G	X-ray room T515 Wall	Electrics N/A	Presumed Asbestos	Rope	No Visible	N/A	Asbestos	Low
Int	St Tydfils Main Building/G	Clean utility T614 Underside of sink	Acoustic pads 3 Items	Sampled	Bitumen	No Visible	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Main Building/G	Store T630 Wall	Electrics N/A	Presumed Asbestos	Rope	No Visible	N/A	Asbestos	Low
Int	St Tydfils Main Building/G	Lobby T637 Floor	Brown tile and bitumen 10.0m2	Sampled	Bitumen	No Visible	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Main Building/G	Stairs over ECG store Floor	Brown tile and bitumen 10.0m2	Visually Similar To	Bitumen	No Visible	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Main Building/G	Ward pantry T707 Underside of sink	Acoustic pads 2 Items	Sampled	Bitumen	No Visible	Reinforced Composite Materials	Chrysotile	Very Low

PHASE 1 ASSESSMENT

INTERIOR/ EXTERIOR (INT/EXT)	BUILDING/FLOOR	LOCATION AND POSITION	DESCRIPTION AND EXTENT	MATERIAL IDENTIFICATION	PRODUCT TYPE	DAMAGE / DETERIORATION	SURFACE TREATMENT	ASBESTOS TYPE	MATERIAL RISK CATEGORY
Int	St Tydfils Main Building/G	Dirty utility T720 Underside of sink	Dirty utility T720 Underside of sink	Sampled	Bitumen	No Visible	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Main Building/G	Pipe tunne	No Access N/A	Presumed Asbestos	Thermal Lagging	No Visible	N/A	Asbestos	Low
Int	St Tydfils Main Building/G	Plant room T537 Ceiling	Insulating panels 10.0m2	Sampled	Insulating Board	No Visible	Painted/Encapsulat ed Board	Amosite	Low
Ext	St Tydfils Main Building/G	Yard 2 Wall	Bitumen membrane 50.0m Run	Sampled	Bitumen	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Main Building/G	Over kitchen stores etc. Flat roof	Bitumen felt 50.0m2	Presumed Asbestos	Bitumen	Low	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils Main Building/G	Beneath disposal T426	Room containing pipe work N/A	Presumed Asbestos	Thermal Lagging	No Visible	N/A	Chrysotile	Low
Ext	St Tydfils Main Building/G	Corridor T523/T557 Wall above and below windows	Red painted panels 50.0m2	Sampled	Cement	No Visible	Painted/ sealed cement	Chrysotile	Very Low
Int	St Tydfils Main Building/G	All areas Floor	Ducts N/A	Presumed Asbestos	Thermal Lagging	No Visible	N/A	Asbestos	Low
Ext	St Tydfils, Workshops/F 1	Builders store Flat roof	Felt 25.0m2	Sampled	Bitumen	No Visible	Reinforced Composite Materials	Chrysotile	Very Low
Ext	St Tydfils, Workshops/G	Plumber FF38/store FF34 Roof edges and centre	Ridge sections 10.0m2	Sampled	Cement	Low	Unsealed Cement	Chrysotile	Very Low
Ext	St Tydfils Main Building/G	Plumber FF38/store FF34 Roof	Profiled sheets 50.0m2	Sampled	Cement	Low	Unsealed Cement	Chrysotile	Very Low
Ext	St Tydfils Main Building/F 1	Roof of stores Roof	Replacment tiles Small Amounts	Sampled	Cement	Low	Unsealed Cement	Chrysotile	Very Low

INTERIOR/ EXTERIOR (INT/EXT)	BUILDING/FLOOR	LOCATION AND POSITION	DESCRIPTION AND EXTENT	MATERIAL IDENTIFICATION	PRODUCT TYPE	DAMAGE / DETERIORATION	SURFACE TREATMENT	ASBESTOS TYPE	MATERIAL RISK CATEGORY
Int	St Tydfils Day Care Unit/G	Roof of new part over front entrance of day care unit and on second floor roof Roof	Tiles Small Amounts	Presumed Asbestos	Cement	Low	Unsealed Cement	Chrysotile	Very Low
Ext	St Tydfils, Central Offices/F 2	Roof	No access tank room to roof N/A	Presumed Asbestos	Insulating Board	No Visible	N/A	Asbestos	Low
Ext	St Tydfils Incinerator House/G	Incinerator/Store 01 Roof	Tiles 40.0m2	Sampled	Cement	No Visible	Unsealed Cement	Chrysotile	Very Low
Ext	St Tydfils Incinerator House/G	Incinerator/Store 01 Wall	Bitumen membrane 40.0m Run	Sampled	Bitumen	Low	Reinforced Composite Materials	Chrysotile	Very Low
Ext	St Tydfils, Workshops/G	Salt stores Wal	Redundant flue pipe 1.00m Run	Sampled	Cement	Low	Unsealed Cement	Chrysotile	Very Low
Int	St Tydfils, Workshops/G	Generator House 01 Generator exhaust	Flange gasket 1 Item	Sampled	Gasket	No Visible	Reinforced Composite Materials	Chrysotile	Very Low
Int	St Tydfils, Workshops/G	Generator House 01 Wall	Live switch gear Small Amounts	Presumed Asbestos	Rope	No Visible	N/A	Asbestos	Low
Ext	St Tydfils Day Care Unit/G	Store GF44 Below window	White panel 10.0m2	Sampled	Cement	No Visible	Painted/Sealed Cement	Chrysotile	Very Low
Ext	St Tydfils, Workshops/G	Chimney Stack Lining	Panel N/A	Presumed Asbestos	Insulating Board	No Visible	N/A	Asbestos	Low
Ext	St Tydfils, Workshops/G	Tanks Lining	No access N/A	Presumed Asbestos	Insulating Board	No Visible	N/A	Asbestos	Low
Ext	St Tydfils Day Care unit/G	Front entrance Facia	Fascia board/soffit 30.0m Run	Sampled	Cement	Low	Painted/ Sealed Cement	Chrysotile	Very Low
Ext	St Tydfils Main Building/F 1	Lift motor room Wall	Cement sheets 10.0m2	Sampled	Cement	Low	Painted/ Sealed Cement	Chrysotile	Very Low

INTERIOR/ EXTERIOR (INT/EXT)	BUILDING/FLOOR	LOCATION AND POSITION	DESCRIPTION AND EXTENT	MATERIAL IDENTIFICATION	PRODUCT TYPE	DAMAGE / DETERIORATION	SURFACE TREATMENT	ASBESTOS TYPE	MATERIAL RISK CATEGORY
Int	St Tydfils Main Building/F 1	Lift Motor Rooms Lift machinery	Brake Pad 2 Items	Presumed Asbestos	Cement	Low	Unsealed Cement	Asbestos	Low
Int	St Tydfils, Psychiatric Unit/F 3	Psychiatric Unit Lift Plant room electrical box	Rope Small Amounts	Presumed Asbestos	Rope	No Visible	N/A	Asbestos	Low
Int	St Tydfils Main Building/F 3	Main block lift plant room Electrical Box	Electrical Board Small Amounts	Presumed Asbestos	Rope	No Visible	N/A	Asbestos	Low

APPENDIX 6 ▪ Asbestos testing results 2018

APPENDIX 5 – LOCATION OF ASBESTOS SAMPLES





Certificate of Analysis

Certificate Number 18-19574

20-Aug-18

Client Terra Firma (Wales) Ltd
5 Deryn Court
Wharfdale Road
Pentwyn
Cardiff
CF23 7HB

Our Reference 18-19574

Client Reference 14907/18

Order No (not supplied)

Contract Title Merthyr

Description 2 Misc samples.

Date Received 16-Aug-18

Date Started 16-Aug-18

Date Completed 20-Aug-18

Test Procedures Identified by prefix DETSn (details on request).

Notes Opinions and interpretations are outside the laboratory's scope of ISO 17025 accreditation. This certificate is issued in accordance with the accreditation requirements of the United Kingdom Accreditation Service. The results reported herein relate only to the material supplied to the laboratory. This certificate shall not be reproduced except in full, without the prior written approval of the laboratory.

Approved By

Adam Fenwick
Contracts Manager



Summary of Asbestos Analysis

Bulk Samples

Our Ref 18-19574

Client Ref 14907/18

Contract Title Merthyr

Lab No	Sample ID	Sample Location	Material Type*	Result	Comment*	Analyst
1380238	Tile 1		Vinyl	NAD	none	Keith Wilson
1380239	Pipe 1		Insulation	NAD	none	Keith Wilson

Crocidolite = Blue Asbestos, Amosite = Brown Asbestos, Chrysotile = White Asbestos. Anthophyllite, Actinolite and Tremolite are other forms of Asbestos. Samples are analysed by DETSC 1101 using polarised light microscopy in accordance with HSG248 and documented in-house methods. NAD = No Asbestos Detected. Where a sample is NAD, the result is based on analysis of at least 2 sub-samples and should be taken to mean 'no asbestos detected in sample'. Key: * -not included in laboratory scope of accreditation.

Information in Support of the Analytical Results

Our Ref 18-19574
Client Ref 14907/18
Contract Merthyr

Containers Received & Deviating Samples

Lab No	Sample ID	Date		Holding time exceeded for tests	Inappropriate container for tests
		Sampled	Containers Received		
1380238	Tile 1 MISC	13/08/18	PT 1L		
1380239	Pipe 1 MISC	13/08/18	PT 1L		

Key: P-Plastic T-Tub

DETS cannot be held responsible for the integrity of samples received whereby the laboratory did not undertake the sampling. In this instance samples received may be deviating. Deviating Sample criteria are based on British and International standards and laboratory trials in conjunction with the UKAS note 'Guidance on Deviating Samples'. All samples received are listed above. However, those samples that have additional comments in relation to hold time, inappropriate containers etc are deviating due to the reasons stated. This means that the analysis is accredited where applicable, but results may be compromised due to sample deviations. If no sampled date (soils) or date+time (waters) has been supplied then samples are deviating. However, if you are able to supply a sampled date (and time for waters) this will prevent samples being reported as deviating where specific hold times are not exceeded and where the container supplied is suitable.

Disposal

From the issue date of this test certificate, samples will be held for the following times prior to disposal :-
Soils - 1 month, Liquids - 2 weeks, Asbestos (test portion) - 6 months



Certificate of Analysis

Certificate Number 18-19628

21-Aug-18

Client Terra Firma (Wales) Ltd
5 Deryn Court
Wharfdale Road
Pentwyn
Cardiff
CF23 7HB

Our Reference 18-19628

Client Reference (not supplied)

Order No 1490/01

Contract Title St Tydfils

Description 4 Soil samples.

Date Received 16-Aug-18

Date Started 16-Aug-18

Date Completed 21-Aug-18

Test Procedures Identified by prefix DETSn (details on request).

Notes Opinions and interpretations are outside the laboratory's scope of ISO 17025 accreditation. This certificate is issued in accordance with the accreditation requirements of the United Kingdom Accreditation Service. The results reported herein relate only to the material supplied to the laboratory. This certificate shall not be reproduced except in full, without the prior written approval of the laboratory.

Approved By

Adam Fenwick
Contracts Manager



Summary of Asbestos Analysis Soil Samples

Our Ref 18-19628

Client Ref

Contract Title St Tydfils

Lab No	Sample ID	Material Type	Result	Comment*	Analyst
1380593	SA	SOIL	NAD	none	Colin Patrick
1380594	SB	SOIL	NAD	none	Colin Patrick
1380595	S101	SOIL	NAD	none	Colin Patrick
1380596	S102	SOIL	NAD	none	Colin Patrick

Crocidolite = Blue Asbestos, Amosite = Brown Asbestos, Chrysotile = White Asbestos. Anthophyllite, Actinolite and Tremolite are other forms of Asbestos. Samples are analysed by DETSC 1101 using polarised light microscopy in accordance with HSG248 and documented in-house methods. NAD = No Asbestos Detected. Where a sample is NAD, the result is based on analysis of at least 2 sub-samples and should be taken to mean 'no asbestos detected in sample'. Key: * - not included in laboratory scope of accreditation.

Information in Support of the Analytical Results

Our Ref 18-19628

Client Ref

Contract St Tydfils

Containers Received & Deviating Samples

Lab No	Sample ID	Date Sampled	Containers Received	Holding time exceeded for tests	Inappropriate container for tests
1380593	SA SOIL	14/08/18	PT 1L		
1380594	SB SOIL	14/08/18	PT 1L		
1380595	S101 SOIL	14/08/18	PT 1L		
1380596	S102 SOIL	14/08/18	PT 1L		

Key: P-Plastic T-Tub

DETS cannot be held responsible for the integrity of samples received whereby the laboratory did not undertake the sampling. In this instance samples received may be deviating. Deviating Sample criteria are based on British and International standards and laboratory trials in conjunction with the UKAS note 'Guidance on Deviating Samples'. All samples received are listed above. However, those samples that have additional comments in relation to hold time, inappropriate containers etc are deviating due to the reasons stated. This means that the analysis is accredited where applicable, but results may be compromised due to sample deviations. If no sampled date (soils) or date+time (waters) has been supplied then samples are deviating. However, if you are able to supply a sampled date (and time for waters) this will prevent samples being reported as deviating where specific hold times are not exceeded and where the container supplied is suitable.

Disposal

From the issue date of this test certificate, samples will be held for the following times prior to disposal :-

Soils - 1 month, Liquids - 2 weeks, Asbestos (test portion) - 6 months



Certificate of Analysis

Certificate Number 18-19629

22-Aug-18

Client Terra Firma (Wales) Ltd
5 Deryn Court
Wharfdale Road
Pentwyn
Cardiff
CF23 7HB

Our Reference 18-19629

Client Reference (not supplied)

Order No 1490/18

Contract Title Thomas Street

Description 3 Soil samples.

Date Received 16-Aug-18

Date Started 16-Aug-18

Date Completed 22-Aug-18

Test Procedures Identified by prefix DETSn (details on request).

Notes Opinions and interpretations are outside the laboratory's scope of ISO 17025 accreditation. This certificate is issued in accordance with the accreditation requirements of the United Kingdom Accreditation Service. The results reported herein relate only to the material supplied to the laboratory. This certificate shall not be reproduced except in full, without the prior written approval of the laboratory.

Approved By

Adam Fenwick
Contracts Manager



Summary of Asbestos Analysis Soil Samples

Our Ref 18-19629

Client Ref

Contract Title Thomas Street

Lab No	Sample ID	Material Type	Result	Comment*	Analyst
1380597	S1	SOIL	NAD	none	Rebecca Burgess
1380598	S2	SOIL	NAD	none	Rebecca Burgess
1380599	S3	SOIL	Chrysotile	bundle of Chrysotile fibres	Rebecca Burgess

Crocidolite = Blue Asbestos, Amosite = Brown Asbestos, Chrysotile = White Asbestos. Anthophyllite, Actinolite and Tremolite are other forms of Asbestos. Samples are analysed by DETSC 1101 using polarised light microscopy in accordance with HSG248 and documented in-house methods. NAD = No Asbestos Detected. Where a sample is NAD, the result is based on analysis of at least 2 sub-samples and should be taken to mean 'no asbestos detected in sample'. Key: * -not included in laboratory scope of accreditation.

Information in Support of the Analytical Results

Our Ref 18-19629
 Client Ref
 Contract Thomas Street

Containers Received & Deviating Samples

Lab No	Sample ID	Date Sampled	Containers Received	Holding time exceeded for tests	Inappropriate container for tests
1380597	S1 SOIL	14/08/18	PT 1L		
1380598	S2 SOIL	14/08/18	PT 1L		
1380599	S3 SOIL	14/08/18	PT 1L		

Key: P-Plastic T-Tub

DETS cannot be held responsible for the integrity of samples received whereby the laboratory did not undertake the sampling. In this instance samples received may be deviating. Deviating Sample criteria are based on British and International standards and laboratory trials in conjunction with the UKAS note 'Guidance on Deviating Samples'. All samples received are listed above. However, those samples that have additional comments in relation to hold time, inappropriate containers etc are deviating due to the reasons stated. This means that the analysis is accredited where applicable, but results may be compromised due to sample deviations. If no sampled date (soils) or date+time (waters) has been supplied then samples are deviating. However, if you are able to supply a sampled date (and time for waters) this will prevent samples being reported as deviating where specific hold times are not exceeded and where the container supplied is suitable.

Disposal

From the issue date of this test certificate, samples will be held for the following times prior to disposal :-

Soils - 1 month, Liquids - 2 weeks, Asbestos (test portion) - 6 months

APPENDIX 7 ▪ Asbestos testing results from IDOM walkover



Tim Crowe
Merebrook
Cromford Mills
Mill Lane
Cromford
Derbyshire
DE4 3RQ

e: tcrowe@idom.com

i2 Analytical Ltd.
7 Woodshots Meadow,
Croxley Green
Business Park,
Watford,
Herts,
WD18 8YS

t: 01923 225404
f: 01923 237404
e: reception@i2analytical.com

Analytical Report Number : 19-49276

Project / Site name:	Merthyr Tidfil Hospital	Samples received on:	11/07/2019
Your job number:	21988	Samples instructed on:	11/07/2019
Your order number:	19-S2-FDO-LABS	Analysis completed by:	16/07/2019
Report Issue Number:	1	Report issued on:	16/07/2019
Samples Analysed:	11 bulk samples		

Signed:

Zina Abdul Razzak
Senior Quality Specialist
For & on behalf of i2 Analytical Ltd.

Standard Geotechnical, Asbestos and Chemical Testing Laboratory located at: ul. Pionierów 39, 41 -711 Ruda Śląska, Poland.

Accredited tests are defined within the report, opinions and interpretations expressed herein are outside the scope of accreditation.

Standard sample disposal times, unless otherwise agreed with the laboratory, are :

soils	- 4 weeks from reporting
leachates	- 2 weeks from reporting
waters	- 2 weeks from reporting
asbestos	- 6 months from reporting

Excel copies of reports are only valid when accompanied by this PDF certificate.

Any assessments of compliance with specifications are based on actual analytical results with no contribution from uncertainty of measurement. Application of uncertainty of measurement would provide a range within which the true result lies. An estimate of measurement uncertainty can be provided on request.



Analytical Report Number: 19-49276

Project / Site name: Merthyr Tidfil Hospital

Lab Sample Number				1263790	1263791	1263792	1263793	1263794
Sample Reference				Bulk Sample A	Bulk Sample B	Bulk Sample C	Bulk Sample D	Bulk Sample E
Sample Number				Black Floor Tile	Car Park Tank	Car Park Surface	Pipe Lagging 1	Red Floor Tile
Depth (m)				0.00	0.00	0.00	0.00	0.00
Date Sampled				09/07/2019	09/07/2019	09/07/2019	09/07/2019	09/07/2019
Time Taken				None Supplied	None Supplied	None Supplied	None Supplied	None Supplied
Analytical Parameter (Bulk Analysis)	Units	Limit of detection	Accreditation Status					
Asbestos Identification Name	Type	N/A	ISO 17025	Chrysotile- Black Floor Tile	No Asbestos Detected	No Asbestos Detected	No Asbestos Detected	No Asbestos Detected



Analytical Report Number: 19-49276

Project / Site name: Merthyr Tidfil Hospital

Lab Sample Number				1263795	1263796	1263797	1263798	1263799
Sample Reference				Bulk Sample F	Bulk Sample G	Bulk Sample H	Bulk Sample I	Bulk Sample J
Sample Number				Green Floor Tile	Pipe Lagging 2	White Floor Tile	Possible Paper	Foam
Depth (m)				0.00	0.00	0.00	0.00	0.00
Date Sampled				09/07/2019	09/07/2019	09/07/2019	09/07/2019	09/07/2019
Time Taken				None Supplied	None Supplied	None Supplied	None Supplied	None Supplied
Analytical Parameter (Bulk Analysis)								
				Units	Limit of detection	Accreditation Status		
Asbestos Identification Name				Type	N/A	ISO 17025	No Asbestos Detected	No Asbestos Detected



Analytical Report Number: 19-49276

Project / Site name: Merthyr Tidfil Hospital

Lab Sample Number				1263800				
Sample Reference				Bulk Sample K				
Sample Number				Base of Concrete				
Depth (m)				0.00				
Date Sampled				09/07/2019				
Time Taken				None Supplied				
Analytical Parameter (Bulk Analysis)								
Asbestos Identification Name				Chrysotile- Bitumen				



Analytical Report Number : 19-49276

Project / Site name: Merthyr Tidfil Hospital

Water matrix abbreviations: Surface Water (SW) Potable Water (PW) Ground Water (GW) Process Water (PrW)

Analytical Test Name	Analytical Method Description	Analytical Method Reference	Method number	Wet / Dry Analysis	Accreditation Status
Asbestos Identification in Bunks	Asbestos Identification in bulk material with the use of polarised light microscopy in conjunction with dispersion staining techniques.	In house method based on HSG 248	A001-PL	W	ISO 17025

For method numbers ending in 'UK' analysis have been carried out in our laboratory in the United Kingdom.

For method numbers ending in 'PL' analysis have been carried out in our laboratory in Poland.

Soil analytical results are expressed on a dry weight basis. Where analysis is carried out on as-received the results obtained are multiplied by a moisture correction factor that is determined gravimetrically using the moisture content which is carried out at a maximum of 30°C.

IDOM

IDOM Cromford Mills, Mill Lane, Matlock, Derbyshire DE4 3RQ
t +44 (0)1773 829 988 **f** +44 (0)1773 829 393 **e** info.derbyshire@idom.com **idom.com**

Registered in England No. 02740216 Registered office: as above

offices Birmingham London Kent Derbyshire Cardiff Manchester Stirling