


Window notes:

- W.01 - stained window to be refurbished and repaired
- W.02 - stained window to be refurbished and repaired
- W.03 - stained window to be refurbished and repaired
- W.04 - timber small plain window to be retained and made good
- W.05 - timber small plain window to be retained and made good
- W.06 - timber small plain window to be retained and made good
- W.07 - timber small plain window to be retained and made good
- W.08 - stained window to be refurbished and repaired
- W.09 - stained window to be refurbished and repaired
- W.10 - stained window to be refurbished and repaired
- W.11 - white upvc window to be replaced with timber window to match
- W.12 - timber window to be retained and made good
- W.13 - white upvc window to be replaced with timber window to match
- W.14 - white upvc window to be replaced with timber window to match
- W.15 - white upvc window to be replaced with timber window to match
- W.16 - stained window to be refurbished and repaired
- W.17 - timber window to be retained and made good
- W.18 - stained window to be refurbished and repaired
- W.19 - timber window to be retained and made good
- W.20 - stained window to be refurbished and repaired
- W.21 - timber window to be retained and made good
- W.22 - stained window to be refurbished and repaired
- W.23 - stained window to be refurbished and repaired
- W.24 - stained window to be refurbished and repaired
- W.25 - stained window to be refurbished and repaired


- W.26 - stained window above door and door to be refurbished and repaired
- W.27 - stained window to be refurbished and repaired

existing upvc window to be replaced by white timber window to match

notes: exact window opening size to be measured on site

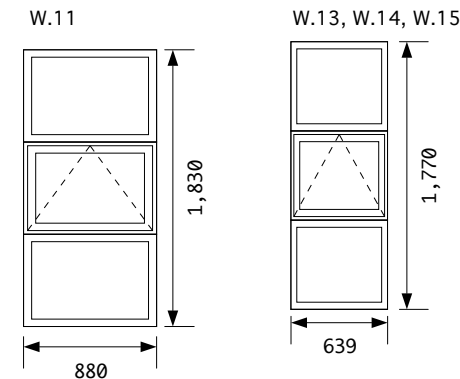


front elevation

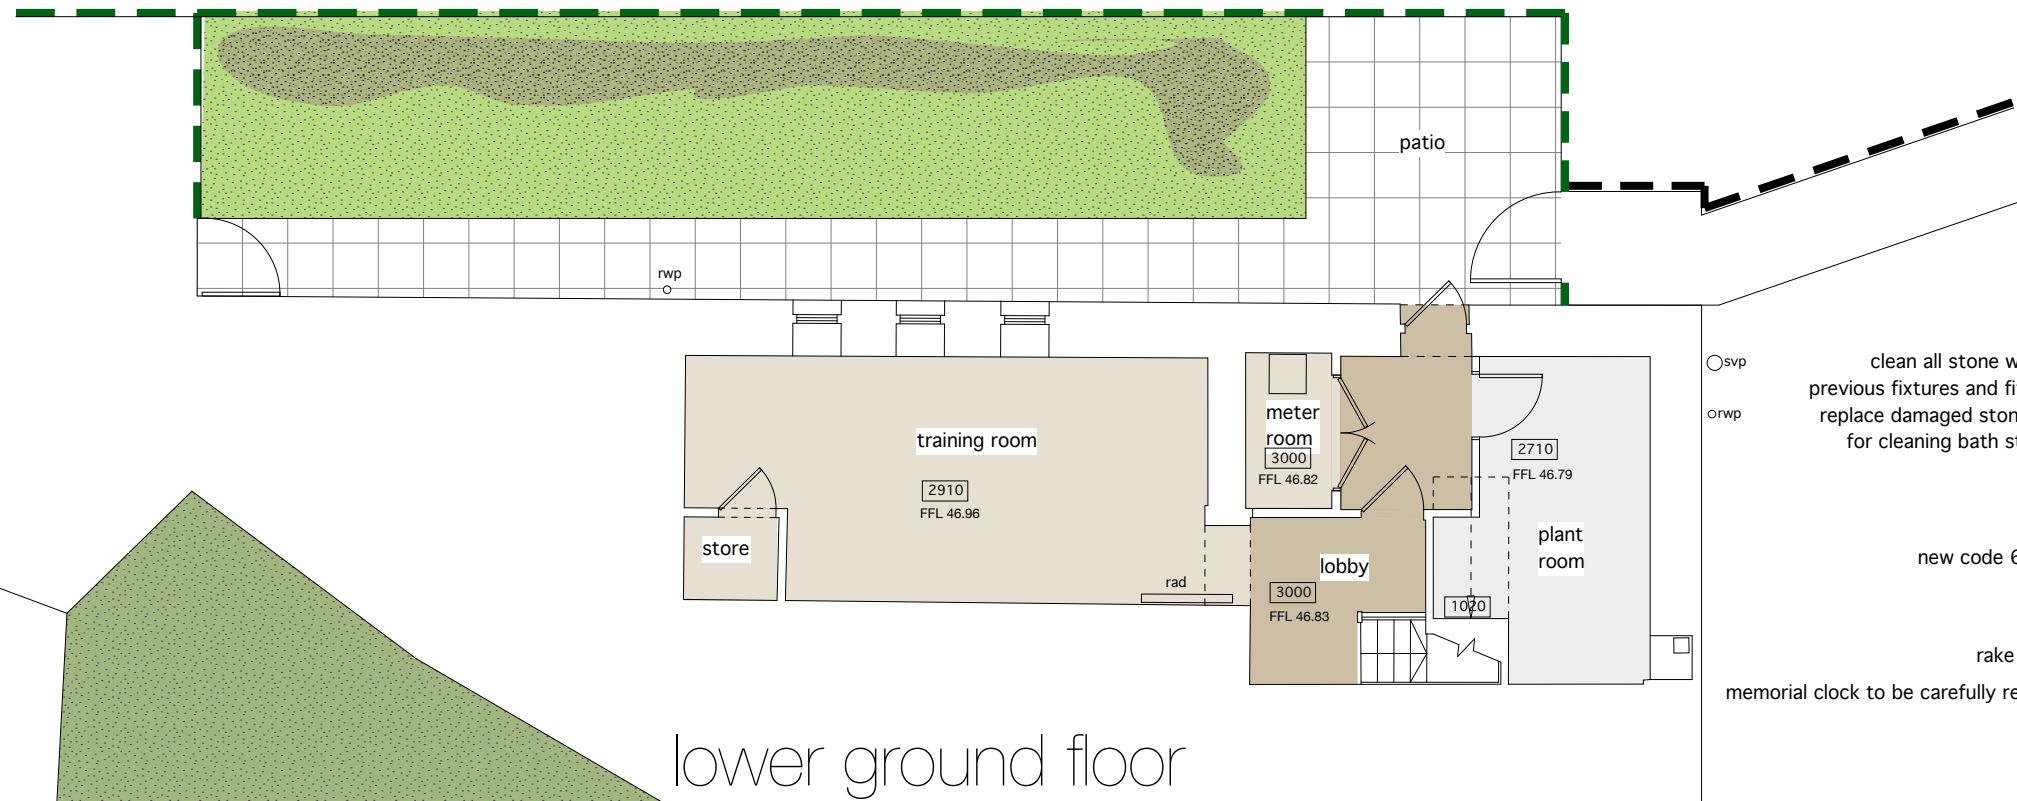


lower ground floor

- clean all stone work. repair bath stone where previous fixtures and fittings have been removed or replace damaged stone details. method statement for cleaning bath stone features to be prepared in due course
- new code 6 lead weathering to cornices
- rake out and re-point lime mortar
- memorial clock to be carefully removed and stored for reuse. cleaning and repair included
- remove render finish, prep surface and re-render with 2 coat through colour lime render
- existing upvc window to be replaced by timber window to match existing
- all broken ceramic vent grilles to be replaced and matched existing

side 1 elevation

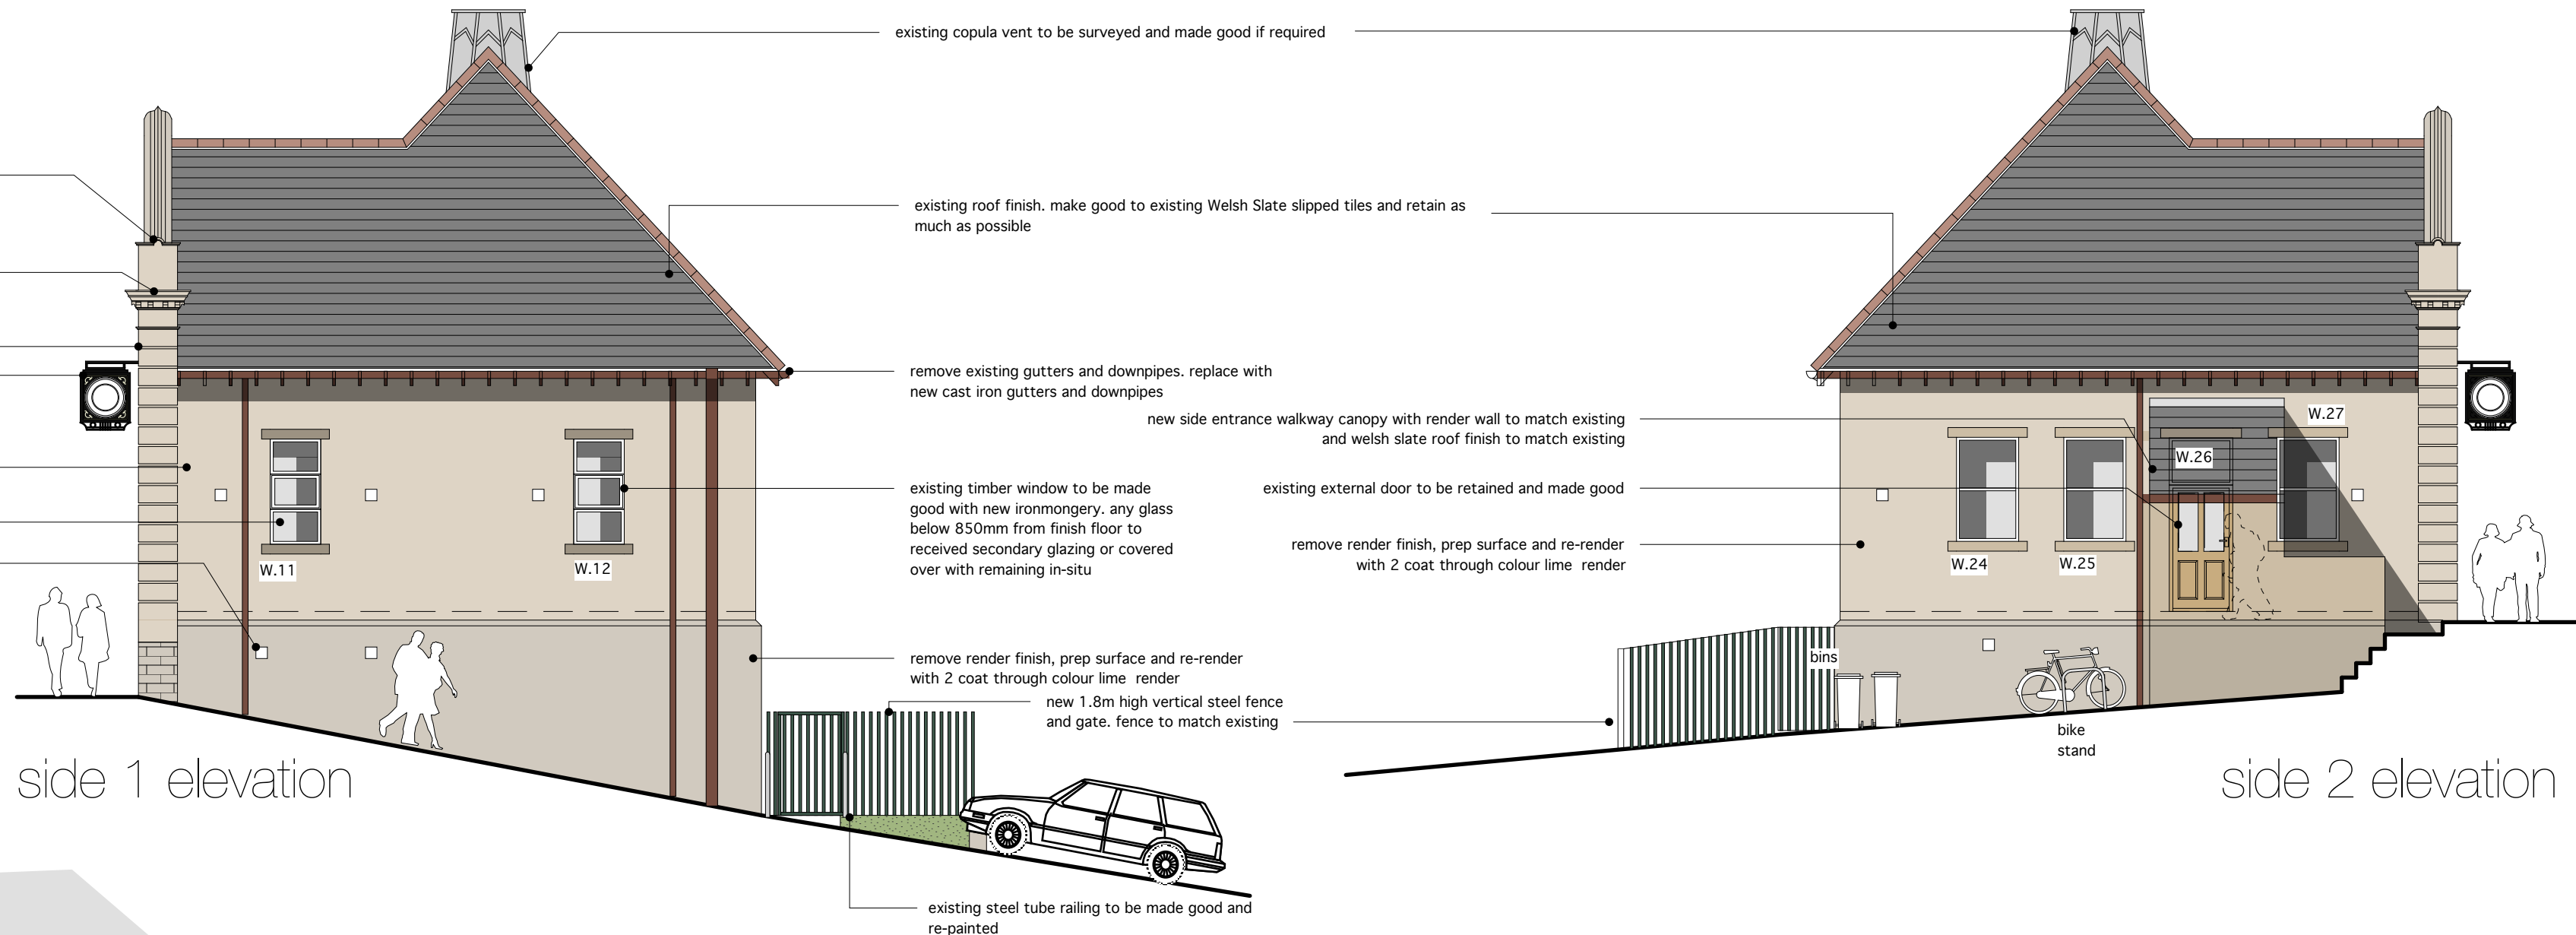


side 2 elevation

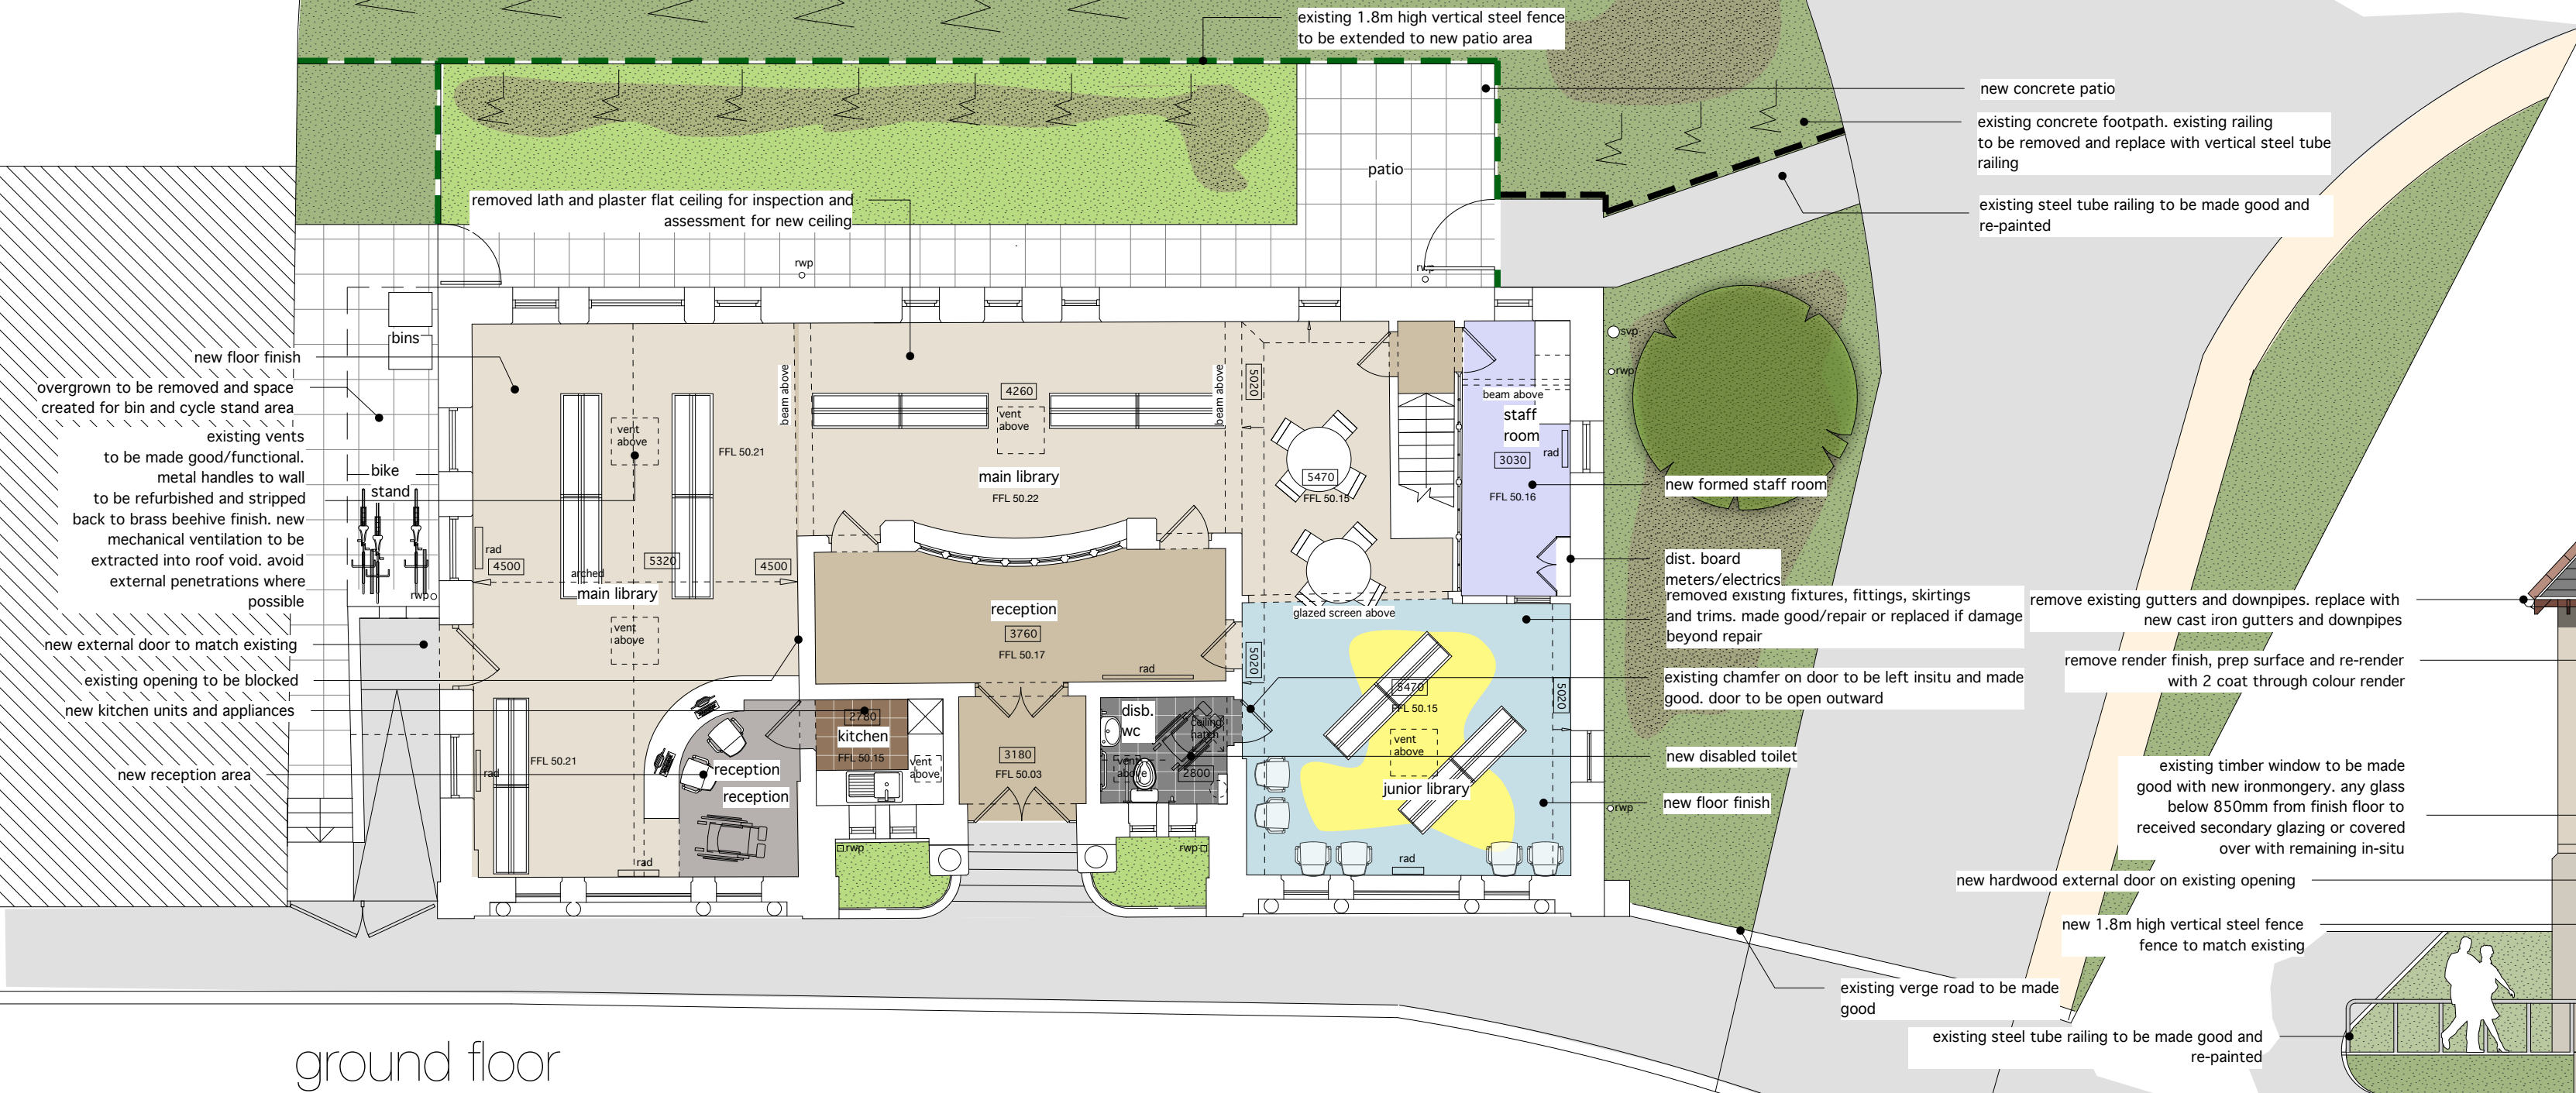

ground floor

- new concrete patio
- existing concrete footpath. existing railing to be removed and replace with vertical steel tube railing
- existing steel tube railing to be made good and re-painted

rear elevation

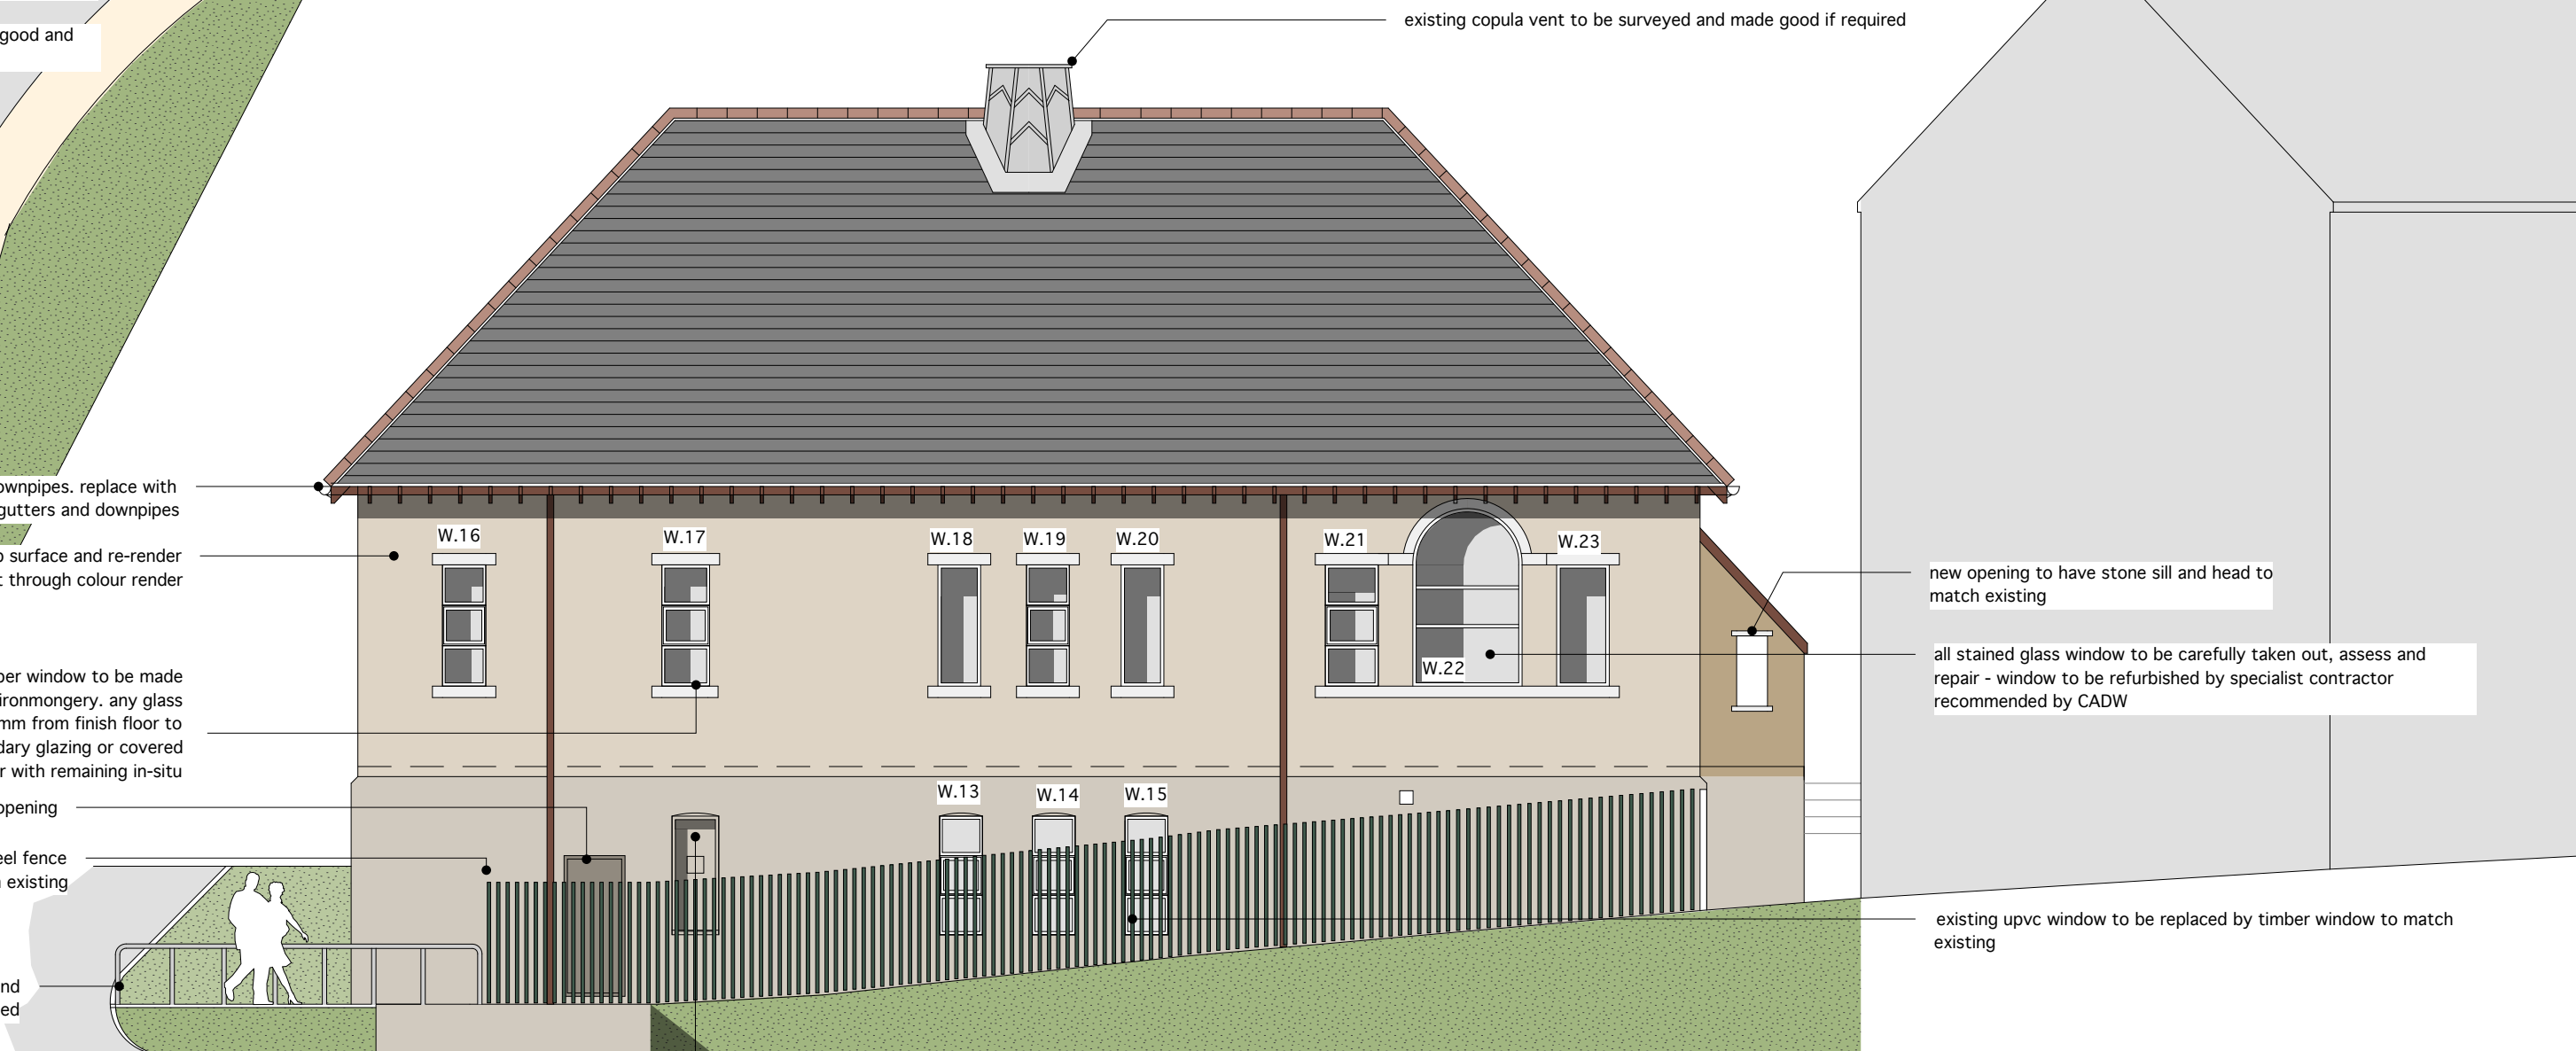

Treharris Library
proposed plans + elevations

1:100 @ A1 102 104 10m

C 20.03.23 drawings updated to match survey plots
B 28.11.22 drawings updated following meeting
A 26.07.22 notes added
Rev Date Action
This drawing is copyright.
Dimensions to be checked on site and any discrepancies reported to the Architect immediately.
Do not scale, use figured dimensions only.