

Arboricultural Method Statement

Premier Inn Hotels

**Premier Inn,
Duffryn,
Pentrebacj,
Merthyr Tydfil,
CF48 4BB**

22 October 2025

Chris Wren BSc (Hons) MArborA

Table of Contents

This report has been released electronically and the appendices have been included at the end of this report. Plans are included as A0, A1, A2 or A3 as appropriate.

Introduction	1
Executive Summary.....	1
General Information	4
Tree Survey	5
Arboricultural Impact Assessment.....	6
Arboricultural Method Statement	7
Tree Works.....	8
Protected Species (general informative for tree works)	11
Sequencing of works	13
Protective Measures.....	14
Demolition	19
Construction	20
Prohibition	22
Site Management	23
Services	24
Landscaping	26
Monitoring and Supervision.....	27
Appendix 1: Tree Survey Schedule.....	31
Appendix 2: Tree Protection Notice	42
Appendix 3: Contact Details.....	44
Document Production Record.....	45

Introduction

Arbtech Consulting Limited (Arbtech) received written instruction on 4 April 2024 from Matthew Mills of M2 Project Surveyors on behalf of Whitbread Group PLC to attend Premier Inn, Duffryn, Pentrebacj, Merthyr Tydfil, CF48 4BB; grid reference, SO 06177 03790 (site) to undertake an arboricultural survey a to BS5837:2012 guidance to assess trees, hedges and major shrub groups growing on and within influencing distance of the site and to produce a Schedule of trees, Tree Constraints Plan, Arboricultural Impact Assessment, Arboricultural Method Statement and Tree Protection Plan.

Executive Summary

This report describes the extent and effect of the proposed development at Site on individual trees and groups of trees within and adjacent to the site.

Trees within the site were surveyed; using a methodology guided by British Standard 5837:2012 'Trees in relation to design, demolition and construction – Recommendations' ("BS5837").

Subsequently, this report has been produced, balancing the layout of the proposed development against the competing needs of trees. This report comprises all of the requisite elements of an arboricultural implications assessment, method statement and supporting plans.

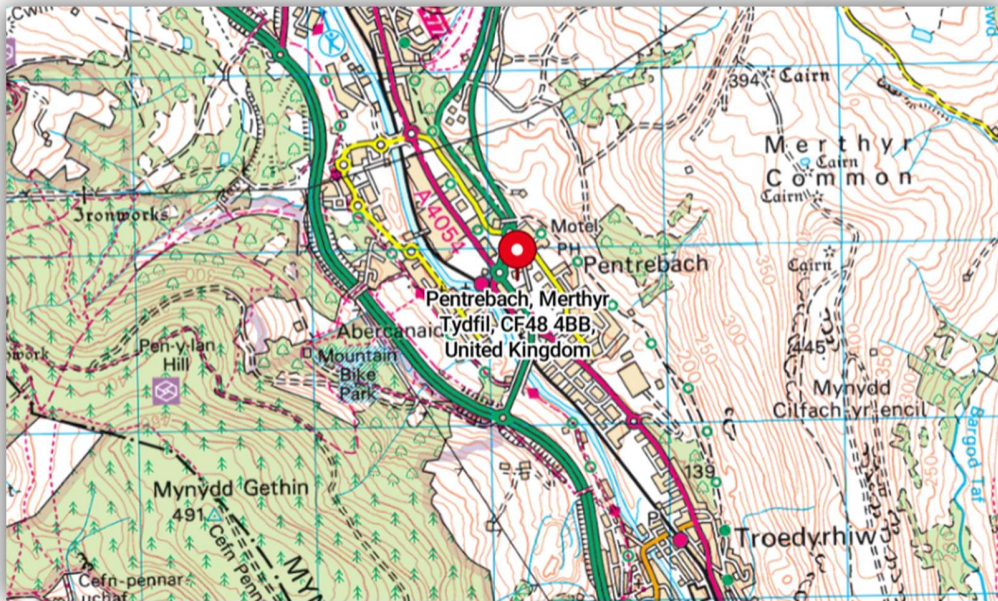


Figure 1: OS Map (Bing Maps)



Figure 2: Aerial Image of site with approximate red line boundary (Google Earth)

Proposed scheme

The proposed scheme for the site involves extending the existing hotel and adding additional bedrooms.

It is likely that arboricultural impacts can be addressed with arboricultural methodology or minor amendments to the proposal.

Checklist for Submission to Local Planning Authority

Tree survey	✓
Tree constraints plan	✓
Arboricultural impact assessment	✓
Arboricultural method statement	✓
Tree protection plan	✓

This report and its appendices precisely follow the strategy for arboricultural appraisal intended to provide local planning authorities with evidence that trees have been properly considered throughout the development process.

It is the conclusion of this report that the overall quality and longevity of the amenity contribution provided for by the trees and groups of trees within and adjacent to the site will not be adversely affected as a result of the local planning authority consenting to the proposed development. It is considered that any issues raised in this report, or beyond the scope of it can be dealt with by planning conditions.

General Information

Client: Whitbread Group PLC

Site: Premier Inn, Duffryn, Pentrebacj, Merthyr Tydfil, CF48 4BB.

Brief proposal description: Extend the existing hotel, adding 16 new bedrooms.

Table 1: Documents referred to.

Document	Reference No.
Topographical / Site survey drawing	4520/10/001
Proposed layout drawing	6153-PL 011 Rev G
British Standard 5837:2012	“BS5837”
Arboricultural Impact Assessment	Arbtech AIA 01 D
Tree Protection Plan	Arbtech TPP 01 D

Tree Survey

Survey: An arboricultural survey to BS5837 of all trees within impacting distance of the site was undertaken by Thomas Ramm on 17 April 2024.

A total of 33No individual trees, 8No groups of trees and, 5No hedges were surveyed. Details for each of the trees surveyed are provided in the Schedule of Trees (see Appendix 1)

Table 2: Documents upon which this tree survey has been based.

Document	Originator	Reference Number	Title
Survey Base Drawing	Clugston Survey Services	4520/10/001	Topographical Survey & Utilities Survey

Limitations: The survey was made at ground level using visual observation only. Detailed examinations, such as climbing inspections and decay detection equipment were not employed, though may form part of the survey's management recommendations. Measurements were taken using specialist tapes, laser, and GPS devices. Where this was not possible, measurements are estimated.

Scope: Pre-development tree surveys make arboricultural management recommendations based exclusively upon the individual tree or group of trees condition relative to their present context (*i.e. not in relation to the proposed development*).

Legal Status: No statutory protection check has been performed. BS5837 does not draw any distinction between trees subject to statutory protection, such as a Tree Preservation Order ("TPO"), and those trees without, stating at Annex B:

*The potential effect of development on trees, **whether statutorily protected** (e.g. by a tree preservation order or by their inclusion within a conservation area) **or not**, is a material consideration that is taken into account in dealing with planning applications.*

Consequently, we do not seek to offer any comparison between or infer any difference in the quality or importance of TPO trees and other trees.

For more information on the surveyed trees please see Arbtech Consulting Ltd, Tree Survey Schedule (**Appendix 1**), Tree Survey Report and Tree Constraints Plan.

Arboricultural Impact Assessment

Table 3: Documents upon which this assessment has been based.

Document	Originator	Reference Number	Title
Survey Base Drawing	Clugston Survey Services	4520/10/001	Topographical Survey & Utilities Survey
Proposed Site Plan	Axiom Architects	6153-PL 011 Rev G	Proposed Site Plan

The proposed has no impact on any retained trees and groups.

These impacts can be seen on the Arboricultural Impact Assessment drawing number Arbtech AIA 01 D.

Trees to be removed

The total number of trees to be removed for this scheme is 4No individuals, and the partial removal of 1No hedges as a part of this development.

A breakdown of all tree removals and pruning works can be seen in Table 7: Summary of Tree Works

Table 4: Number of individual trees to be removed.

U	A	B	C
0	0	2	2

Table 5: Number of groups to be removed.

U	A	B	C
0 (0)	0 (0)	0 (0)	0 (1)

() = partial removal of a group

Canopy cover is ecologically important and the loss of canopy cover by this tree will be mitigated with planting within the development.

Arboricultural Method Statement

The purpose of this method statement is to demonstrate how any aspect of the development that has potential to result in loss or damage to a tree may be implemented and provide an adequate level of protection for those trees that are to be retained during the proposed works.

Details of key site personnel, including site/project manager will be submitted to the Council's Tree Officer before the commencement of site works.

This method statement is to be approved and agreed to in writing by all key personnel before the commencement of site works.

No site personnel are to be present and no demolition, site clearance, building work or delivery of materials is to occur until the protective measures are in accordance with this method statement and the Tree Protection Plan drawing number Arbtech TPP 01 D.

Protective measures will be in accordance with this method statement and the Tree Protection Plan; drawing number Arbtech TPP 01 D will remain unaltered and in situ, unless otherwise specified, for the entire duration of the construction.

Table 6: Documents upon which this assessment has been based.

Document	Originator	Reference Number	Title
Survey Base Drawing	Clugston Survey Services	4520/10/001	Topographical Survey & Utilities Survey
Proposed Site Plan	Axiom Architects	6153-PL 011 Rev G	Proposed Site Plan

Tree Works

For reasons of public safety, all tree works referred to herein must be carried out before any site personnel commencing works or any building materials being delivered.

Tree T33 and part of group G03 have been removed separately from the project.

Table 7: Summary of Tree Works.

No.	Species	Works	Category
H01	Cherry Laurel	Prune: Cut back canopy back to the kerb line	C2
H02	Cherry Laurel	Prune: Cut back canopy back to the kerb line	C2
H03	Various	Partial fell: Remove southern section as shown in Arbtech AIA 01	C2
H03	Various	Prune: Cut back canopy back to the kerb line	C2
T05	Common Alder	Fell and remove stump	C12
T06	Common Alder	Fell and remove stump	C12
T07	Silver Birch	Fell and remove stump	B12
T08	Scots Pine	Fell and remove stump	B1
T10	Common Holly	Prune: Raise crown over the highway as required to give 6m ground clearance	B12
T11	Common Horse Chestnut	Prune: Raise crown over the highway as required to give 6m ground clearance	B12
T12	Common Holly	Prune: Raise crown over the highway as required to give 6m ground clearance	B12
T13	Scots Pine	Prune: Raise crown over the highway as required to give 6m ground clearance	B12

Notes: All tree work is to be undertaken in accordance with British Standard BS 3998:2010, Recommendations for tree work. All arising's are to be removed and the site is to be left as found. Care is to be taken of the ground around retained trees to make sure that it does not become compacted as a result of tree surgery operations. No equipment or vehicles such as timber Lorries, tractors, excavators, or cranes shall be parked or driven beneath the crowns of any retained trees, to prevent subsequent compaction and root death.

Tree removal

A tree should be felled in one piece only when there is no significant risk of damage to people, property, or protected species (see Annex A).

Where restrictions (e.g. lack of space, buildings, other features, land ownership or use, or other trees which are to be retained) cannot be overcome, trees should be dismantled in sections.

This also applies where a tall stump is being retained but where branches are to be removed/pruned.

Extensively decayed trees can be unpredictable when they are being felled, and special precautions should, therefore, be taken, such as the use of a winch to guide the direction of fall.

Stump removal – stump grinding

Stump grinding will be to a minimum of 300mm deep or to extend through the base of the stump leaving the major roots disconnected if the intention is to reduce the potential for the spread of Honey fungus.

The grinding residue will be treated as arising's and removed from site.

NOTE: Mechanical destruction of a stump by stump grinding is less disruptive to the site than digging out.

The hole left by stump removal will be filled with soil or other material. The filling should be appropriate for future site usage, and for any surface treatment that is to be installed.

Where future plant growth is desired, the backfill material will be firmed in 150 mm layers by treading, avoiding excessive compaction and destruction of the soil structure.

Stump removal - digging

Stump removal by digging out will include disposal/utilisation of woody material.

NOTE: Mechanical destruction of a stump by stump grinding is less disruptive to the site than digging out.

Where possible when winching out a stump, a ground, or other type of anchor, will be used rather than a tree to be retained. If there is no alternative to using such a tree as an anchor, appropriate protective measures will be adopted.

After stump removal

The hole left by stump removal, whether by digging out or grinding, will be filled with soil or other material. The filling will be appropriate for future site usage and for any surface treatment that is to be installed.

Where future plant growth is desired, the back-fill material will be firmed in 150mm layers by treading, avoiding excessive compaction and destruction of the soil structure.

Protected Species (general informative for tree works)

Conservation Status of British Bats

The consensus in Britain and Europe is that virtually all bat species are declining and vulnerable. Our understanding of population status is poor as there is very little historical data for most bat species. Certain species, such as the horseshoe bats, are better understood and have well-documented contractions in range and population size.

Given this general picture of decline in UK Government within the UK Biodiversity Action Plan has designated five species of bats as priority species (greater and lesser horseshoe bats, barbastelle, Bechstein's and pipistrelle). These plans provide an action pathway whereby the maintenance and restoration of the former populations' levels are investigated.

Legal Status of British Bats

Given the above position, all British bats, as well as their breeding sites and resting places, enjoy national and international protection.

All bat species in the UK are fully protected under the Wildlife and Countryside Act 1981 (as amended) through inclusion in Schedule 5. All bats are also listed on Annex IV (and some on Annex II) of the EC Habitats Directive giving further, European protection. Taken together, the Act and Conservation of Habitats and Species Regulations 2012 (as amended) * make it an offence to; intentionally or deliberately kill, injure or capture (take) bats.

- Deliberately disturb bats (whether in a roost or not).
- Damage, destroy or obstruct access to bat roosts.
- Possess or transport a bat or any part of a bat, unless acquired legally.
- Sell, barter or exchange bats, or parts of bats.

The legislation although not strictly affording protection to foraging grounds does protect roost sites. Bat roosts are protected at all times of the year whether or not bats are present. Any disturbance of a roost due to development must be licenced.

**The regulations that delivered by the UK's commitments to the Habitats Directive.*

Breeding birds

All nesting birds are protected under the Wildlife and Countryside Act (as amended) 1981, which makes it an offence to intentionally kill, injure or take any wild bird or take, damage or destroy its nest whilst in use or being built, or take or destroy its eggs. Furthermore, several birds enjoy further protection under that Act and are listed on Schedule 1 of the Act. These further protected birds are also protected from disturbance and it may be necessary to operate “no-go” buffer zones around such nests – typically out to 100m.

Planning policy guidance on the treatment of species identified as priorities under the biodiversity action programme suggests that local authorities should take measures to protect the habitats of these species from further decline through policies in local development documents and should ensure that they are protected from the adverse effects of development, where appropriate, by using planning conditions or obligations. The conservation of these species should be promoted through the incorporation of beneficial biodiversity designs within developments.

Sequencing of works

A logical sequence of events is to be observed and shall be phased as follows.

Table 8: Sequence of Events

Stage	Event
Stage 1	Carry out tree works as specified within the summary of tree works
Stage 2	Installation of protective measures in accordance with the approved tree protection plan
Stage 3	Pre-commencement site meeting
Stage 4	Undertake removal of hard surfacing
Stage 5	Undertake and complete construction works
Stage 6	Undertake external landscaping works outside of the construction exclusion zones
Stage 7	Removal of all machinery and materials from site
Stage 8	Dismantle and removal of protective measures
Stage 9	Undertake external landscaping works within the construction exclusion zones
Stage 10	Sign off from Project Arboriculturist

Protective Measures

Protective measures are to be installed immediately following the completion of the tree works and are to be sited and aligned in accordance with the tree protection plan (Arbtech TPP 01 D) before the commencement of any works or the introduction of any machinery or material to Site.

Upon installation of the protective measures around the retained trees, the Project Arboriculturist will visit the site to inspect and document the position and specifications of the protective measures.

If the protective measures and their positions do not comply with this arboricultural method statement document number Arbtech AMS 01 (4) (22 October 2025) and tree protection plan drawing number Arbtech TPP 01 D, the Project Arboriculturist shall inform the client and fencing contractor so adjustments can be made.

When the protective measures comply with document number Arbtech AMS 01 (4) (22 October 2025) and tree protection plan drawing number Arbtech TPP 01 D, the Project Arboriculturist will sign off the protective measures in writing to the client and will send a copy to the fencing contractor, site agent and local authority tree officer.

If the protective measures become damaged or there is any accident or emergencies involving trees, these areas are to be cordoned off immediately with high visibility plastic mesh fencing. The site agent is to photograph and document the damage and inform the Project Arboriculturist immediately after the incident and all work within this area is to cease until the Project Arboriculturist has visited the site. Any damaged sections of protective measures shall be replaced within 48 hours of the initial incident.

The protected area is sacrosanct and will not be invaded by the storage of materials, mixing of concrete or other products, accessed by machinery, equipment, or pedestrians or in any other way disturbed by construction activity.

The protective measures will remain in place until the completion of stage 7 (see Sequencing of Works), thereafter they will be carefully dismantled only with the agreement of the Project Arboriculturist and or the local authority tree officer.

The existing site boundary measures are to be retained for the duration of the development. If for any reason the existing boundary measures are not to be used protective barrier fencing is to be installed along the line of the boundaries and is only to be removed upon the written permission of the Project Arboriculturist upon the

completion of the development or immediately before the installation of the permanent boundary measures.

The proposed hard surfacing is to be installed immediately to act as ground protection, where it is decided that this is not a viable option these areas are to be covered by ground boarding as designed by the project engineer to cope with any likely loading.

No equipment, vehicles or plant shall operate beyond the tree protection fencing. Booms, hoists, and rigs should be kept as far away from the canopies of retained trees at all times. Where it is necessary to operate within 5m of a tree canopy, it will be done with the utmost caution and under the control of a banks man. Damage to trees will be considered a breach of this tree protection plan, which in turn could be a breach of planning permission.

Construction Exclusion Zone

A construction exclusion zone (CEZ) as designated by the protective barrier fencing, is an area where there is to be no construction activity. Access to the area for construction personnel or machinery is strictly prohibited, unless detailed in the tree protection plan, and there is no scope for materials or waste storage; welfare facilities etc. There may be some construction activities planned for these areas (e.g. the installation of service trenches) these activities will be undertaken under direct, on-site arboricultural supervision.

Protective Barrier Fencing

Protective barrier fencing should be appropriate for the intensity and proximity of the development to protect trees where development activity is nearby.

To comprise either 2.4m wooden site hoarding or 2m tall welded mesh panels on rubber or concrete feet. Panels are to be joined together using a minimum of two anti-tamper couplers, installed so that they can only be removed from inside the fence. The panels will be supported on the inner side by stabiliser struts, which will be attached to a base plate and secured with ground pins.

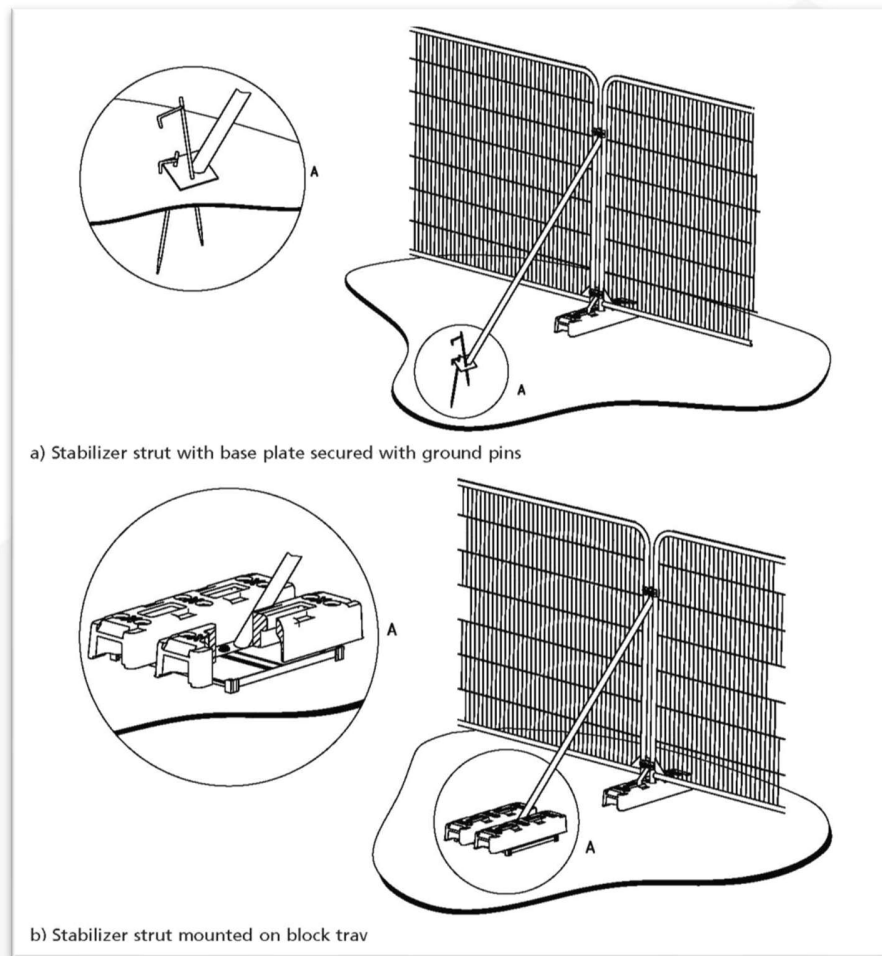


Figure 3: Examples of protective barrier fencing with above-ground stabilising systems (BS5837).

Signage denoting the words “*tree protection area*” at 5.0m intervals will be fixed to the protective barrier fencing (See Appendix 2).

Protective fencing is to be removed ONLY with the written permission of the Project Arboriculturist.

Ground boarding

New temporary ground protection will be capable of supporting any traffic entering or using the site without being distorted or causing compaction of the underlying soil.

Where it is determined by the project engineer that any hard surfacing is not adequate protection from any expected loading, ground boarding is to be installed to the engineer's specification on top of the hard surfacing within the root protection areas of retained trees.

Where machinery will be stored or used from the ground boarding within the RPAs of the retained trees an impervious barrier and or bunding to prevent oils, fuel or chemicals is to be installed to prevent leaching into the soil within or adjacent to the RPAs.

Note The ground protection might comprise one of the following:

- a) for pedestrian movements only, a single thickness of scaffold boards placed either on top of a driven scaffold frame, as to form a suspended walkway, or on top of a compression-resistant layer (e.g. 100mm depth of woodchip), laid onto a geotextile membrane.
- b) for pedestrian-operated plant up to a gross weight of 2t, proprietary inter-linked ground protection boards placed on top of a compression-resistant layer (e.g. 150mm depth of woodchip), laid onto a geotextile membrane.
- c) for wheeled or tracked construction traffic exceeding 2t gross weight, an alternative system (e.g. proprietary system or pre-cast reinforced concrete slabs) to an engineering specification designed in conjunction with arboricultural advice, to accommodate the likely loading to which it will be subjected.

For any situations other than those described in a) or b) (as above), the ground boarding is to be designed by a suitably qualified person to an engineering specification in conjunction with arboricultural advice, to be suitable of supporting the expected loading to be placed upon it.

In all cases, the objective of the ground boarding is to avoid compaction of the soil beneath, so that tree root functions remain unimpaired.

At this stage, no contractors have been approached so it is not possible to know exactly what equipment they have available and will be using.

Due to the various sizes of demolition and construction plant available and the potential requirements for material storage within the site, the final specifications for the ground boarding will be designed and supplied to the Project Arboriculturist for their approval by the project engineer a minimum of ten (10) working days before its installation.

Demolition

Before the demolition of the existing site features, all tree works are to have been completed, tree protection measures are to be in place as per Arbtech Consulting Ltd. tree protection plan document number Arbtech TPP 01 D and have been signed off and a copy of the demolition method statement has been submitted and approved by the Project Arboriculturist to ensure that there is no conflict with this method statement.

All demolition work within or immediately adjacent to RPAs or canopies of retained trees is to be undertaken under the direct on-site supervision of an arboriculturist.

Hard Surfacing

Where it is required for hard surfacing is to be removed and or re-surfaced within the RPAs of retained trees it is to be undertaken under direct on-site arboricultural supervision, during the landscaping phase of the development.

The wearing course will be broken up using a handheld pneumatic breaker, hand tools and wheelbarrows to break up and remove the surfacing. Where is necessary to remove the subbase, this is to be undertaken using a fork to loosen the material and moved using shovels and wheelbarrows.

In some situations, and at the discretion of the arborist it may be possible to use an excavator using a hydraulic breaker and a suitably sized toothless grading bucket. If an excavator is to be used it must be situated outside of the RPAs, on top of the hard surfacing working away from the RPAs or from ground boarding.

Whichever system is used there is to be **NO** disturbance of the soil beneath. If roots are found they are to be covered over with damp hessian and a layer of either sharp sand, wood chip or topsoil will be applied as soon as practicably possible to prevent desiccation.

Existing Underground Services

Existing services within the site should be retained wherever possible. Where existing services within RPAs require upgrading, the utmost care must be taken to minimise disturbance, and where feasible trenchless techniques are to be employed, and only where necessary should open excavations be considered.

Construction

Before the construction of the proposed development, a copy of the construction method statement will have been submitted and approved by the Project Arboriculturist to ensure that there is no conflict with this method statement.

All excavations and construction work within or immediately adjacent to RPAs or canopies of retained trees is to be undertaken under the direct on-site supervision of an arboriculturist.

Replacement of hard surfacing

Removal of and or replacement of hard surfacing situated either partially or completely within the RPAs of retained trees shall be undertaken with care and under the direct on-site arboricultural supervision as these areas are likely to contain roots.

Where this is necessary the wearing course will be broken up using a handheld pneumatic breaker, hand tools and a wheel barrow to break up and remove the surfacing. In some situations and at the discretion of the arborist it may be possible to use an excavator using a hydraulic breaker and suitably sized toothless grading bucket. If an excavator is to be used it must be situated outside of the RPAs, on top of the hard surfacing working away from the RPAs or from ground boarding.

Whichever system is used there is to be NO disturbance of the soil beneath. If roots are found they are to be covered over with damp hessian and a layer of either sharp sand, wood chip or topsoil to prevent desiccation.

Replacement hard surfacing to be situated within the RPAs of retained trees is to be designed in conjunction with arboricultural advice to accommodate the likely loading. The design should not require excavation below the existing subbase and the construction will be situated entirely above the existing ground level.

Concrete foundations

Before concrete being poured to form the foundations within or immediately adjacent to the RPAs of retained trees the excavation is to be lined and sealed to prevent any leaching of the concrete into the soil and causing desiccation of retained roots by concrete runoff.

Manual excavation

Excavation within RPAs will be undertaken by hand under direct on-site arboricultural supervision of the required depth of the foundation; Or to a minimum of 600mm deep of any excavation, whether for proposed foundations, hard surfacing, or underground services. The total depth of the manual excavation will be determined by the arboriculturist whilst on site.

The soil is to be loosened with the aid of a fork or pickaxe and then cleared with the aid of an Air-spade, Air-vac and or shovel. Any roots found will be cleanly severed by the Project Arboriculturist with either a hand saw or secateurs.

Any roots found with a diameter of less than 25mm shall be cleanly severed by the Project Arboriculturist. Any roots of 25mm and above shall be excavated around without damaging them; the Project Arboriculturist shall decide if it is feasible or necessary to retain the root, if not it shall be severed.

The edge of the excavation closest to the trees will be covered with damp hessian to prevent soil collapse or contamination by concrete.

The soil beneath the depth may be sheet piled, regular piled or excavated deeper. Machinery may be used for this providing that it is situated outside of the RPA or has appropriate ground protection in place to move around on and work upon.

Prohibition

- Mechanical digging or scraping is not permitted within a defined root protection area or areas cordoned off by protective barrier fencing.
- No access will be permitted within the protected areas.
- No materials, equipment or debris will be stored within any of the fenced areas, or against the fencing.
- Fires are not permitted within 10m of any vegetation.
- Leaning objects against or attaching of objects to a tree is not permitted.
- Machinery, plant, and vehicles are not permitted to be washed down within 10m of vegetation.
- Chemicals and materials are not to be transported, stored, used, or mixed within a root protection area or areas cordoned off by protective barrier fencing.
- Cement silos, mixing site to be situated within a bunded area to prevent spillage/leaking of chemicals harmful to trees. These areas are to be sited well clear of protected trees.
- Refuelling of plant or machinery is prohibited within 10m of the construction exclusion zones.
- Allowance must be made for the slope of the ground so that damaging materials such as concrete washings, mortar or diesel oil cannot run towards trees.
- Where machinery is to be used within 5m of retained tree canopies a banks man will be required at all times whilst setting up, moving, or operating within this distance of retained trees canopies.
- Storage of all caustic material and chemicals are to be situated well clear of protected areas and preferably on lower ground if slopes are present, or to be situated within a bonded area to prevent any spills or leaks entering the ground.

Site Management

The site manager will be responsible for briefing and inducting all personnel who will be working on any stage of this development and especially those who will be working within or adjacent to the canopies or RPAs of retained trees, and will make them aware of, and provide a copy of this method statement and tree protection plan drawing number Arbtech TPP 01 D; this is to include but not exclusively the movement and or operation of plant, excavations, unloading deliveries, mixing and or pouring of cement and concrete.

The site manager will be responsible for the day to day running and protection of all retained trees and for liaising with the project arborist about any tree-related matters and before any works that may or will affect the RPAs or canopies of retained trees; this is to include but not exclusively the movement and or operation of plant, excavations, unloading deliveries, mixing, pouring and storage of all caustic materials that may cause harm to retained trees.

Any incidents of damage to retained trees or tree protection measures will be documented by the site manager who will then report these incidents to the Project Arboriculturist immediately and make sure that works within this area cease until the project arborist has had an opportunity to inspect the damage and where appropriate, agree on a mitigation plan with the local planning authority tree officer.

The site manager may designate another person to take charge of briefing and inducting process of new site personnel or visitors in his absence.

If the site manager is replaced or is absent from the site for more than three consecutive working days, the project arborist will be informed, and a prestart meeting will be held with the new or acting site manager.

It is the responsibility of the site manager to ensure that the planning conditions attached to the planning consent are adhered to at all times and that a monitoring regime and supervision of any works within or adjacent to the RPAs are adopted.

If at any time pruning works are required other than those previously approved, permission must be sought from the LPA tree officer and once permission is granted, they are to be carried out by a suitably qualified person in accordance with BS3998:2010 Tree work – Recommendations.

Services

Detailed drawings of proposed underground services are not available at this time; hence it is not possible to identify any specific potential impacts associated with the scheme at this stage.

Existing services within the site will be retained wherever possible. Where existing services within RPAs require upgrading, the utmost care must be taken to minimise disturbance, and where feasible trenchless techniques are to be employed, and only where necessary should open excavations be considered.

Where new services are to be introduced into the site they will be located outside of RPAs, where they will not interfere with tree roots. If any excavations are required within the RPAs all trenches are to be excavated by hand and radially to the tree trunks under direct on-site arboricultural supervision and are to be carried out under NJUG guidelines.

Final positions of any proposed services will be verified and approved by the Project Arboriculturist and local authority tree officer before implementation.

New Underground services

Trenching for installation of underground services and drainage routes could sever any roots that may be present and as such adversely affects the health of the tree. For this reason, particular care will be taken in routing and methods of installation of all underground services. All underground services and drainage routes will be located so that no excavations are required within RPAs.

Where it has been impossible to keep underground services from passing through RPAs or within proximity to trees, these sections are to be installed in one of three ways in accordance with the guidance set out in National Joint Utilities Group guidelines (NJUG 4), under on-site arboricultural supervision.

Trenchless Techniques

There are three main types of trenchless techniques, these include, guided and unguided boring and pipe replacement by lining or bursting. These allow for the installation, maintenance, or renewal of underground services, without the disturbance of soil in which roots are likely to be growing. Starting and receiving pits for the boring machinery are to be located outside of the RPAs of any retained trees, with the bore depth being maintained at a minimum depth of 600mm below the existing ground level.

Techniques involving external lubrication of the equipment shall use no material other than water as other lubricants could contaminate the soil (e.g. oil, bentonite, etc.).

Manual Excavation

Excavation within RPAs will be undertaken by hand under direct on-site arboricultural supervision of the required depth of the foundation; Or to a minimum of 600mm deep of any excavation, whether for proposed foundations, hard surfacing, or underground services. The total depth of the manual excavation will be determined by the arboriculturist whilst on site.

The soil is to be loosened with the aid of a fork or pickaxe and then cleared with the aid of an Air-spade, Air-vac and or shovel. Any roots found will be cleanly severed by the Project Arboriculturist with either a hand saw or secateurs.

Any roots found with a diameter of less than 25mm shall be cleanly severed by the Project Arboriculturist. Any roots of 25mm and above shall be excavated around without damaging them; the Project Arboriculturist shall decide if it is feasible or necessary to retain the root, if not it shall be severed.

The edge of the excavation closest to the trees will be covered with damp hessian to prevent soil collapse or contamination by concrete.

The soil beneath the depth may be sheet piled, regular piled or excavated deeper. Machinery may be used for this providing that it is situated outside of the RPA or has appropriate ground protection in place to move around on and work upon.

Broken Trench – Hand Dug

This technique combines both trenchless techniques and manual excavation where excavation is unavoidable. Excavations will be limited to where there is clear access around and below the roots. All trenches shall be excavated by hand with the same precautions taken as for manual excavation. The open section of the trench will only be large enough to allow access for linking to the next section.

Landscaping

A specification for and notation relating to the precise alignment of replacement trees will be contained in the landscape proposals.

Landscaping around retained trees may only be carried out once all tree protection measures have been removed (planting, turfing, fencing etc.).

All excavations within the Root Protection Areas shall be undertaken by hand and without reducing current ground levels unless it is agreed in writing with the LPA. At no time is the use of a rotavator permitted within the RPAs of retained trees.

Any tree roots discovered will be left in-situ and shall not be cut or otherwise damaged. Where possible, the soil structure within the Root Protection area shall be preserved.

No works will be carried out within the RPAs of any trees if the soil moisture is of such a level that soil compaction may be likely. Should the soil become compacted or has a poor structure which would hinder the development of the existing trees and plants or any new plantings the arboriculturist will be consulted about soil decompaction techniques.

Monitoring and Supervision

Where trees have been identified within this method statement and tree protection plan drawing number Arbtech TPP 01 D for retention, there will be an auditable system of arboricultural monitoring. This is to extend to arboricultural supervision whenever demolition or construction activity is to take place within or adjacent to any canopy or RPA.

The development's tree protection measures are to be monitored and all demolition and construction works are to be undertaken within or adjacent to the RPAs of retained trees are to be supervised by Project Arboriculturist, who will be retained to record and report observations to the council at appropriate intervals.

Pre-commencement site meeting

Before the commencement of any works or machinery and materials arriving on site a pre-commencement site meeting involving the project arborist, landowner or agent, site manager, contractors and engineer (as appropriate) and the relevant LPA officers will be held to ensure that all aspects of the arboricultural method statement and tree protection are understood and for all parties to swap contact details (see Appendix 3).

Monitoring and supervision schedule

The initial monitoring visit will be to check that the tree protection measures are in the correct location and as specified within the approved method statement, if so to sign off their installation.

Thereafter, monitoring visits are to take place at regular intervals, to ensure that tree protection measures are in place and are functioning as designed or whenever necessary to undertake works to be carried out under arboricultural supervision. The frequency of the monitoring visits is to be agreed with the LPA tree officer at the pre-commencement site meeting.

A record of all arboricultural monitoring and supervision visits will be kept, and any faults will be logged, this will then be copied to the site agent, developer, and local planning authority in a digital format.

If during the development areas must be re-designed so that they would require changes to the approved arboricultural method statement or tree protection plan and so affecting retained trees the project arborist and LPA tree officer will be invited to

attend a site meeting with all relevant parties. Before any changes being implemented these must have been approved in writing by the LPA tree officer.

Supervision

The Project Arboriculturist will be required to attend site to directly supervise all demolition and construction works that are to be undertaken within or adjacent to the RPAs of all retained trees and will be advised a minimum of 72 hours before the commencement of any works that require his attendance, these will include:

1. Pre-commencement site meeting.
2. Location of protective measures.
3. Supervised removal of the hard surfacing, kerb edging and associated foundations within or immediately adjacent to the canopies and RPAs of all retained trees.
4. Any excavations within and immediately adjacent to RPAs, including foundations, hard surfacing, or underground services.
5. Removal of protective measures and sign off.

Completion meeting

Once all construction works have been completed all materials and machinery has been removed from site the project arborist shall be informed and will invite the LPA tree officer to meet on site to discuss the process and discuss any final remedial works that may be required and to sign the development off so that the protective measures may be removed.

Arboricultural Monitoring and Supervision Sign Off Checklist Premier Inn, Duffryn, Pentrebacj, Merthyr Tydfil, CF48 4BB

Tree Number	Task	Date Completed	Signed (Project Arboriculturist)	Signed (Site Manager)
All	Pre-commencement site meeting			
All	Sign off of the location and specification of the protective measures			
T01, T02, T03, T04, H01, H02 & H03	Supervised removal of the Hard surfacing & kerb edging			
	Additional excavations (if required)			
All	Completion of groundworks			
All	Completion of construction			
All	Removal of machinery and materials from Site			
All	Dismantle & removal of protective measures			
All	Completion of Landscaping			
All	Sign off from Project Arboriculturist			

Appendix 1: Tree Survey Schedule

BS5837:2012 Tree Survey

Arbtech Consulting Limited

Client: Premier Inn Hotels - Merthyr Tydfil
 Project: Premier Inn, Duffryn, Pentrebacj, Marthyr Tydfil, CF484BB
 Survey Date: 17/04/2024
 Surveyor: Thomas Ramm

Unit 3, Well House Barns
 Chester Road
 Chester
 Cheshire
 CH4 0DH
 Phone: 01244661170

Tree and Tag No Species	Hght (m)	Stems		Crown		Age	RP A (m²) R (m)	Phys Condition	Structural Condition	Preliminary Recommendations			Cat ERC
		No	Ø (mm)	Spread (m)	Clear (m)					Survey Comment			
G01												Estimated Measurements	
Various	15	1	360	N	4	2	SM	A: 58.6	Good	C: Good			B.1.2
See comments for details				E	4	2		R: 4.31		S: Good	Group is situated off site to the west following to the south; Group is comprised of circa 75+ stems with species to include pine, sycamore, alder, goat willow, hawthorn and scrub; Dimensions recorded represent maximum for group; Overall the tree population within the group are of good vigor.	20+ yrs	
				S	4	2			B: Good				
				W	4	2							
G02													
Various	18	1	520	N	4	2	SM	A: 122.3	Good	C: Good			B.1.2
See comments for details				E	4	2		R: 6.23		S: Good	Group is situated off site to the north; Group is comprised of circa 30+ stems with species to include silver birch, sycamore, cherry and hornbeam; Dimensions recorded represent maximum for group; Over all the tree population within the group are of good vigor.	20+ yrs	
				S	4	2			B: Good				
				W	4	2							
G03													
Various	5	1	150	N	2	0.5	SM	A: 10.2	Good	C: Good			C.1.2
See comments for details				E	2	0.5		R: 1.8		S: Good	Group is situated to the gardens of 'Table Table' restaurant; Group is comprised of circa 10+ stems with species to include silver birch, goat willow and pontic rhododendron; Dimensions recorded represent maximum for group.	10+ yrs	
				S	2	0.5			B: Good				
				W	2	0.5							
G04													
A Group	5	1	150	N	2	0.5	SM	A: 10.2	Good	C: Good			C.1.2
See comments for details				E	2	0.5		R: 1.8		S: Good	Group is situated to the gardens of 'Table Table' restaurant; Group is comprised of circa 7+ stems of pontic rhododendron; Dimensions recorded represent maximum for group.	10+ yrs	
				S	2	0.5			B: Good				
				W	2	0.5							
Age Classifications:	N	Newly planted	EM	Early Mature	Condition:			C	Crown	Stems:	Ø	Diameter	
	Y	Young	M	Mature				S	Stem		(Eq)	Equivalent stem diameter using BS5837:2012 definition	
	SM	Semi-mature	OM	Over Mature				B	Basal area	ERC:		Estimated Remaining Contributio	

Tree and Tag No Species		Hght (m)	Stems		Crown		Age	RP A (m²) R (m)	Phys Condition	Structural Condition	Preliminary Recommendations			Cat ERC
			No	Ø (mm)	Spread (m)	Clear (m)					Survey Comment			
G05														
Various <i>See comments for details</i>		4	1	150	N	2	0.5	SM	A: 10.2 R: 1.8	Good	C: Good S: Good B: Good	Group is situated to the gardens of 'Table Table' restaurant; Group is comprised of circa 7+ stems of pontic rhododendron and hawthorn; Dimensions recorded represent maximum for group.		C.1.2 10+ yrs
G06														
Various <i>See comments for details</i>		1	1	75	N	1	0.5	SM	A: 2.5 R: 0.89	Good	C: Good S: Good B: Good	Group is situated to the west of 'Table Table' restaurant; Group is comprised of circa 15+ stems of shrubs and herbaceous with species to include rhododendron, cherry laurel and boxleaf honeysuckle.		C.2 10+ yrs
G07														
Various <i>See comments for details</i>		1	1	75	N	1	0.5	SM	A: 2.5 R: 0.89	Good	C: Good S: Good B: Good	Group is situated to the west of 'Table Table' restaurant; Group is comprised of circa 15+ stems of shrubs and herbaceous with species to include rhododendron, cherry laurel and boxleaf honeysuckle.		C.2 10+ yrs
G08												Estimated Measurements		
Various <i>See comments for details</i>		12	1	310	N	3	2	EM	A: 43.5 R: 3.72	Good	C: Good S: Good B: Good	Group partially removed after the survey as evidenced by photos taken in Feb 2025		B.1.2 20+ yrs
H01														
Cherry Laurel <i>Prunus laurocerasus</i>		1	1	75	N	1	0.5	SM	A: 2.5 R: 0.89	Good	C: Good S: Good B: Good	Linear hedge-line situated to the southern boundary line; Hedge is comprised of circa 10+ stems; Hedge is regularly maintained on top and sides to current dimensions.		C.2 10+ yrs
Age Classifications:		N Y SM	Newly planted Young Semi-mature	EM M OM	Early Mature Mature Over Mature	Condition:		C S B	Crown Stem Basal area	Stems:		Ø (Eq)	Diameter Equivalent stem diameter using BS5837:2012 definition	ERC: Estimated Remaining Contributio

Tree and Tag No Species		Hght (m)	Stems		Crown		Age	RP A (m²) R (m)	Phys Condition	Structural Condition	Preliminary Recommendations			Cat ERC
			No	Ø (mm)	Spread (m)	Clear (m)					Survey Comment			
H02														
Cherry Laurel <i>Prunus laurocerasus</i>		1	1	75	N	1	0.5	SM	A: 2.5 R: 0.89	Good	C: Good S: Good B: Good	Linear hedge-line situated to the southern boundary line; Hedge is comprised of circa 15+ stems; Hedge is regularly maintained on top and sides to current dimensions.	C.2 10+ yrs	
H03														
Various <i>See comments for details</i>		1	1	75	N	1	0.5	SM	A: 2.5 R: 0.89	Good	C: Good S: Good B: Good	Linear hedge-line situated to the southern boundary line; Hedge is comprised of circa 15+ stems with species to include box and cherry laurel; Hedge is regularly maintained on top and sides to current dimensions.	C.2 10+ yrs	
H04														
Various <i>See comments for details</i>		1	1	75	N	1	0.5	SM	A: 2.5 R: 0.89	Good	C: Good S: Good B: Good	Fragmented linear hedge-line situated to the southern boundary line; Hedge is comprised of circa 50+ stems with species to include box and cherry laurel; Hedge is regularly maintained on top and sides to current dimensions.	C.2 10+ yrs	
H05														
Various <i>See comments for details</i>		1	1	80	N	1	0.5	SM	A: 2.9 R: 0.96	Good	C: Good S: Good B: Good	Fragmented linear hedge-line situated to the southern boundary line; Hedge is comprised of circa 50+ stems with species to include box and cherry laurel; Hedge is regularly maintained on top and sides to current dimensions.	C.2 10+ yrs	
T01														
Goat Willow <i>Salix caprea</i>		16	1	450	N	5	4	EM	A: 91.6 R: 5.39	Good	C: Good S: Ivy B: Good	Tree is situated towards the southern boundary line; Main stem leans to the east from base; Unable to gain a detailed inspection of main stem due to ivy; Main stem bifurcates to codominant stem at 4 m; Naturally occurring deadwood typical for species; Over all the tree is in good vigor.	B.1.2 20+ yrs	
Age Classifications:		N Y SM	Newly planted Young Semi-mature	EM M OM	Early Mature Mature Over Mature	Condition:		C S B	Crown Stem Basal area	Stems:		Ø Diameter (Eq) Equivalent stem diameter using BS5837:2012 definition	ERC: Estimated Remaining Contributio	

Tree and Tag No Species		Hght (m)	Stems		Crown		Age	RP A (m²) R (m)	Phys Condition	Structural Condition	Preliminary Recommendations			Cat ERC
			No	Ø (mm)	Spread (m)	Clear (m)					Survey Comment			
T02														
Common Alder <i>Alnus glutinosa</i>		17	1	480	N E S W	5 4 5 7	7 7 7 7	EM A: 104.2 R: 5.75	Good	C: Good S: Good B: Good	Tree is situated to the south; Main stem leans slightly to the south from base; Naturally occurring deadwood typical for species.			B.1.2 20+ yrs
T03														
Goat Willow <i>Salix caprea</i>		8	1	320	N E S W	4 1 4 5	3 3 3 3	SM A: 46.3 R: 3.83	Good	C: Good S: Good B: Good	Tree is situated towards the southern boundary line; Main stem leans to the west from base; Asymmetrical crown due to suppression from adjacent companion trees; Naturally occurring deadwood typical for species; Over all the tree is in good vigor.			B.1.2 20+ yrs
T04														
Common Alder <i>Alnus glutinosa</i>		14	1	340	N E S W	4 3 4 3	4 4 4 4	EM A: 52.3 R: 4.08	Good	C: Good S: Good B: Good	Tree is situated to the south; Naturally occurring deadwood typical for species.			B.1.2 20+ yrs
T05														
Common Alder <i>Alnus glutinosa</i>		11	1	110	N E S W	1 2 2 2	4 3 3 3	SM A: 5.5 R: 1.32	Good	C: Good S: Good B: Good	Tree is situated to the western boundary line; Asymmetrical crown due to suppression from adjacent companion trees; Naturally occurring deadwood typical for species.			C.1.2 10+ yrs
T06														
Common Alder <i>Alnus glutinosa</i>		11	1	210	N E S W	3 2 1 2	4 4 4 4	SM A: 20 R: 2.52	Fair	C: Good S: Fair B: Good	Tree is situated to the western boundary line; Historical mechanical damage to the main stem on the eastern aspect at 3 m where wound has not yet occluded; Sparse foliage density throughout crown; Naturally occurring deadwood typical for species.			C.1.2 10+ yrs
Age Classifications:		N Y SM	Newly planted Young Semi-mature	EM M OM	Early Mature Mature Over Mature	Condition:		C S B	Crown Stem Basal area	Stems:		Ø (Eq)	Diameter Equivalent stem diameter using BS5837:2012 definition	ERC: Estimated Remaining Contributio

Tree and Tag No Species		Hght (m)	Stems		Crown		Age	RP A (m²) R (m)	Phys Condition	Structural Condition	Preliminary Recommendations			Cat ERC	
			No	Ø (mm)	Spread (m)	Clear (m)					Survey Comment				
T07															
Silver Birch		14	1	340	N	4	3	SM	A: 52.3	Good	C: Good			B.1.2	
Betula pendula					E	3	3		R: 4.08		S: Good	Tree is situated towards the western boundary line; Naturally occurring deadwood typical for species.	20+ yrs		
					S	3	4				B: Good				
					W	4	4								
T08 385															
Scots Pine		9	1	390	N	6	4	SM	A: 68.8	Good	C: Good			B.1	
Pinus sylvestris					E	5	3		R: 4.67		S: Good	Tree is situated within raised planing pit towards the eastern boundary; Main stem leans to the west from base then straightens at 1 m; Main stem bifurcates to codominant stem at 3 m; Historically pruned to the eastern lateral extent to non appropriate attachment points; Naturally occurring deadwood typical for species.	20+ yrs		
					S	6	3				B: Good				
					W	5	3								
T09															
Scots Pine		10	1	370	N	4	3	SM	A: 61.9	Good	C: Good			B.1	
Pinus sylvestris					E	4	3		R: 4.43		S: Good	Tree is situated within raised planing pit towards the eastern boundary; Ring bulge from base of tree on all aspects; Historically pruned to the eastern and western lateral extent to non appropriate attachment points; Naturally occurring deadwood typical for species.	20+ yrs		
					S	5	3				B: Good				
					W	5	3								
T10 387															
Common Holly		10	1	410	N	2	4	SM	A: 76.1	Good	C: Good			B.1.2	
Ilex aquifolium					E	2	4		R: 4.92		S: Good	Tree is situated towards the eastern boundary line; Historical damage to the northern aspect of main stem at 3 m where wound has occluded; Main stem trifurcates at 3 m; Asymmetrical crown due to suppression from adjacent companion trees; Natural bracing throughout crown; Naturally occurring deadwood typical for species.	20+ yrs		
					S	3	4				B: Good				
					W	3	4								
Age Classifications:		N	Newly planted	EM	Early Mature		Condition:		C	Crown	Stems:		Ø	Diameter	
		Y	Young	M	Mature				S	Stem			(Eq)	Equivalent stem diameter using BS5837:2012 definition	
		SM	Semi-mature	OM	Over Mature				B	Basal area	ERC:		Estimated Remaining Contributio		

Tree and Tag No Species		Hght (m)	Stems		Crown		Age	RP A (m²) R (m)	Phys Condition	Structural Condition	Preliminary Recommendations			Cat ERC
			No	Ø (mm)	Spread (m)	Clear (m)					Survey Comment			
T11												Estimated Measurements		
Common Horse Chestnut <i>Aesculus hippocastanum</i>		12	1	630	N	7	5	EM	A: 179.6 R: 7.56	Good	C: Good S: Good B: Not visible	Tree is situated off site to the eastern boundary line; Unable to gain a detailed inspection of base due to restricted access; Main stem bifurcates at 3 m to codominant stem; Historically pruned to the northern aspect of main stem at 4-5 m where wounds have occluded; Naturally occurring deadwood typical for species.		B.1.2 20+ yrs
T12												Estimated Measurements		
Common Holly <i>Ilex aquifolium</i>		9	1	410	N	2	4	SM	A: 76.1 R: 4.92	Good	C: Good S: Good B: Good	Tree is situated towards the eastern boundary line; Main stem bifurcates at 2 m to codominant stem; Asymmetrical crown due to suppression from adjacent companion trees; Natural bracing throughout crown; Naturally occurring deadwood typical for species.		B.1.2 20+ yrs
T13												Estimated Measurements		
Scots Pine <i>Pinus sylvestris</i>		12	1	420	N	1	8	SM	A: 79.8 R: 5.03	Good	C: Good S: Fair B: Not visible	Tree is situated off site to the eastern boundary line; Historical limb failure at 3 m to northern aspect of main stem where wound has not yet occluded; Heavy lean to the south west at 6 m; Naturally occurring deadwood typical for species.		B.1.2 20+ yrs
T14												Estimated Measurements		
Lawson Cypress <i>Chamaecyparis lawsoniana</i>		8	1	320	N	1	0.5	SM	A: 46.3 R: 3.83	Good	C: Good S: Good B: Good	Tree is situated to the northern boundary line; No notable features.		B.1.2 20+ yrs
T15												Estimated Measurements		
Lawson Cypress <i>Chamaecyparis lawsoniana</i>		6	1	260	N	1	0.5	SM	A: 30.6 R: 3.12	Fair	C: Fair S: Good B: Good	Tree is situated to the northern boundary line; Visible browning to the eastern and western aspect; Low foliage density throughout crown.		C.1.2 10+ yrs
Age Classifications:		N Y SM	Newly planted Young Semi-mature	EM M OM	Early Mature Mature Over Mature	Condition:		C S B	Crown Stem Basal area	Stems:		Ø (Eq)	Diameter Equivalent stem diameter using BS5837:2012 definition	ERC: Estimated Remaining Contributio

Tree and Tag No Species	Hght (m)	Stems		Crown		Age	RP A (m²) R (m)	Phys Condition	Structural Condition	Preliminary Recommendations			Cat ERC
		No	Ø (mm)	Spread (m)	Clear (m)					Survey Comment			
T16													
Lawson Cypress <i>Chamaecyparis lawsoniana</i>	8	1	330	N	1	0.5	SM	A: 49.3 R: 3.96	Good	C: Good S: Good B: Good	Tree is situated to the northern boundary line; No notable features.	B.1.2 20+ yrs	
T17													
Norway Maple <i>Acer platanoides</i>	17	1	740	N	3	10	M	A: 247.8 R: 8.88	Good	C: Good S: Good B: Good	Tree is situated to the north of 'Table Table's restaurant; Surface roots exposed to northern and eastern aspect of base; Historically pruned to the southern lateral extent to non appropriate attachment points; Asymmetrical crown due to suppression from adjacent companion trees; Naturally occurring deadwood typical for species.	B.1.2 20+ yrs	
T18													
Common Beech <i>Fagus sylvatica</i>	17	1	1020	N	9	3	M	A: 470.7 R: 12.24	Good	C: Good S: Good B: Good	Tree is situated to the north of 'Table Table' restaurant; Surface roots exposed to western aspect of base; Historically pruned to the southern and western aspect of main stem at 3-5 m where wounds have fully occluded; Asymmetrical crown due to suppression from adjacent companion tree; Naturally occurring deadwood typical for species.	A.1.2 40+ yrs	
T19													
Common Yew <i>Taxus baccata</i>	7	1	520	N	3	1	SM	A: 122.3 R: 6.23	Good	C: Good S: Good B: Good	Tree is situated towards the northern boundary; Surface roots exposed on all aspects of base; Historical pruning to southern extent of main stem at 2 m to appropriate attachment point where wound has not yet occluded; Naturally occurring deadwood typical for species.	B.1.2 20+ yrs	
T20													
Common Beech <i>Fagus sylvatica</i>	21	1	1000	N	11	5	M	A: 452.4 R: 12	Good	C: Good S: Good B: Good	Tree is situated within the gardens of 'Table Table' restaurant; Historically pruned to the northern and western aspect of main stem where wounds have fully occluded; Naturally occurring deadwood typical for species.	A.1.2 40+ yrs	
Age Classifications:	N Y SM	Newly planted Young Semi-mature	EM M OM	Early Mature Mature Over Mature	Condition:			C S B	Crown Stem Basal area	Stems:	Ø Diameter (Eq) Equivalent stem diameter using BS5837:2012 definition	ERC:	Estimated Remaining Contributio

Tree and Tag No Species	Hght (m)	Stems		Crown		Age	RP A (m²) R (m)	Phys Condition	Structural Condition	Preliminary Recommendations		Cat ERC
		No	Ø (mm)	Spread (m)	Clear (m)					Survey Comment		
T21												
Common Hornbeam <i>Carpinus betulus</i>	20	1	980	N E S W	12 10 9 9	4 4 4 4	M A: 434.5 R: 11.76	Good	C: Good S: Good B: Good	Tree is situated to the northern boundary line; Naturally occurring deadwood typical for species.		A.1.2 40+ yrs
T22												
Common Beech <i>Fagus sylvatica</i>	21	1	1250	N E S W	11 10 11 12	5 5 5 5	M A: 706.9 R: 15	Good	C: Good S: Good B: Good	Tree is situated within the gardens of 'Table Table' restaurant; Historically pruned to the northern and western aspect of main stem where wounds have fully occluded; Naturally occurring deadwood typical for species.		A.1.2 40+ yrs
T23												
Silver Birch <i>Betula pendula</i>	17	1	710	N E S W	5 10 9 9	5 3 4 2	M A: 228.1 R: 8.52	Good	C: Good S: Good B: Fair	Tree is situated in the gardens of 'Table Table' restaurant; Open cavity to base of northern aspect from group level to 150 mm in height X 130 mm in width; Naturally occurring deadwood typical for species.		B.1.2 20+ yrs
T24												
Monkey Puzzle Tree <i>Araucaria araucana</i>	17	1	760	N E S W	5 5 5 5	13 13 13 13	M A: 261.3 R: 9.11	Good	C: Good S: Good B: Good	Tree is situated to the western boundary line; Naturally occurring deadwood typical for species.		B.1.2 20+ yrs
T25												
Austrian Pine <i>Pinus nigra ssp. Nigra</i>	17	1	640	N E S W	3 2 5 5	3 10 4 4	M A: 185.3 R: 7.68	Good	C: Good S: Good B: Good	Tree is situated to the western boundary line; Asymmetrical crown due to suppression from adjacent companion trees; Naturally occurring deadwood typical for species.		B.1.2 20+ yrs
Age Classifications:	N Y SM	Newly planted Young Semi-mature	EM M OM	Early Mature Mature Over Mature	Condition:		C S B	Crown Stem Basal area	Stems:	Ø Diameter (Eq) Equivalent stem diameter using BS5837:2012 definition	ERC:	Estimated Remaining Contributio

Tree and Tag No Species	Hght (m)	Stems		Crown		Age	RP A (m²) R (m)	Phys Condition	Structural Condition	Preliminary Recommendations		Cat ERC
		No	Ø (mm)	Spread (m)	Clear (m)					Survey Comment		
T26												
Common Yew <i>Taxus baccata</i>	8	2	334 (Eq)	N E S W	3 3 3 3	1 1 1 1	M A: 50.5 R: 4	Good	C: Good S: Good B: Good	Tree is situated towards the western boundary line; Subsidiary stems from base comprised of 11No stems; Dimensions recorded main stem and average for subsidiary stems; Historically pruned to the lateral extent on all aspects to appropriate attachment points; Natural bracing throughout crown; Naturally occurring deadwood typical for species.		B.1.2 20+ yrs
T27												
Monkey Puzzle Tree <i>Araucaria araucana</i>	17	1	720	N E S W	4 4 4 4	3 3 3 3	M A: 234.5 R: 8.63	Good	C: Good S: Good B: Good	Tree is situated to the western boundary line; Naturally occurring deadwood typical for species.		B.1.2 20+ yrs
T28												
Pear <i>Pyrus Spp.</i>	6	1	240	N E S W	2 2 2 2	2 2 2 2	SM A: 26.1 R: 2.88	Good	C: Good S: Good B: Good	Tree is situated to the west of 'Table Table' restaurant; No notable features.		B.1.2 20+ yrs
T29												
Pear <i>Pyrus Spp.</i>	6	1	220	N E S W	2 2 2 2	2 2 2 2	SM A: 21.9 R: 2.64	Good	C: Good S: Good B: Good	Tree is situated to the west of 'Table Table' restaurant; No notable features.		B.1.2 20+ yrs
T30												
Monkey Puzzle Tree <i>Araucaria araucana</i>	5	1	300	N E S W	2 2 2 2	1 1 1 1	SM A: 40.7 R: 3.59	Dead	C: Poor S: Poor B: Fair	Tree is dead standing.		U n/a
Age Classifications:	N Y SM	Newly planted Young Semi-mature	EM M OM	Early Mature Mature Over Mature	Condition:		C S B	Crown Stem Basal area	Stems:	Ø (Eq)	Diameter Equivalent stem diameter using BS5837:2012 definition	ERC: Estimated Remaining Contributio

Appendix 2: Tree Protection Notice

(To be printed at A3 or larger)

Tree Protection Area **KEEP OUT**

Do not move this fence

(TOWN & COUNTRY PLANNING ACT 1990)

**TREES ENCLOSED BY THIS FENCE ARE PROTECTED BY PLANNING CONDITIONS
AND/OR ARE THE SUBJECT OF A TREE PRESERVATION ORDER.
CONTRAVENTION OF A TREE PRESERVATION ORDER MAY LEAD TO CRIMINAL
PROSECUTION**

**ANY INCURSION INTO THE PROTECTED AREA MUST BE WITH THE WRITTEN
PERMISSION OF THE LOCAL PLANNING AUTHORITY**



Unit 3, Well House Barn, Chester Road, Chester, CH4 0DH
<https://arbtech.co.uk> - 01244 661170

Appendix 3: Contact Details

Name	Position	Company	Contact
	Client		
	Agent / Project Manager		
	Tree Officer		
	Project Arboriculturist	Arbtech Consulting Ltd.	01244 661170 https://arbtech.co.uk
	Site Manager		
	Main contractor		

Arbtech Consulting Limited is registered in England and Wales: 05678552. VAT: GB903660148

Document Production Record

Document number	Editor	Signature	Position	Issue number	Date
Arbtech AMS 01	Chris Wren		Senior Arboricultural Consultant	05	22/10/25

Limitations

Arbtech Consulting Ltd has prepared this report for the sole use of the above-named Client/Agent in accordance with our terms of business, under which our services were performed. No other warranty, expressed or implied, is made as to the professional advice included in this Report or any other services provided by us. This Report may not be relied upon by any other party without the prior and express written agreement of Arbtech Consulting Ltd. The assessments made assume that the sites and facilities will continue to be used for their current purpose without significant change. The conclusions and recommendations contained in this Report are based upon information provided by others and upon the assumption that all relevant information has been provided by those parties from whom it has been requested. Information obtained from third parties has not been independently verified by Arbtech Consulting Ltd.

Copyright

© This Report is the copyright of Arbtech Consulting Ltd. Any unauthorised reproduction or usage by any person other than the addressee is strictly prohibited.