


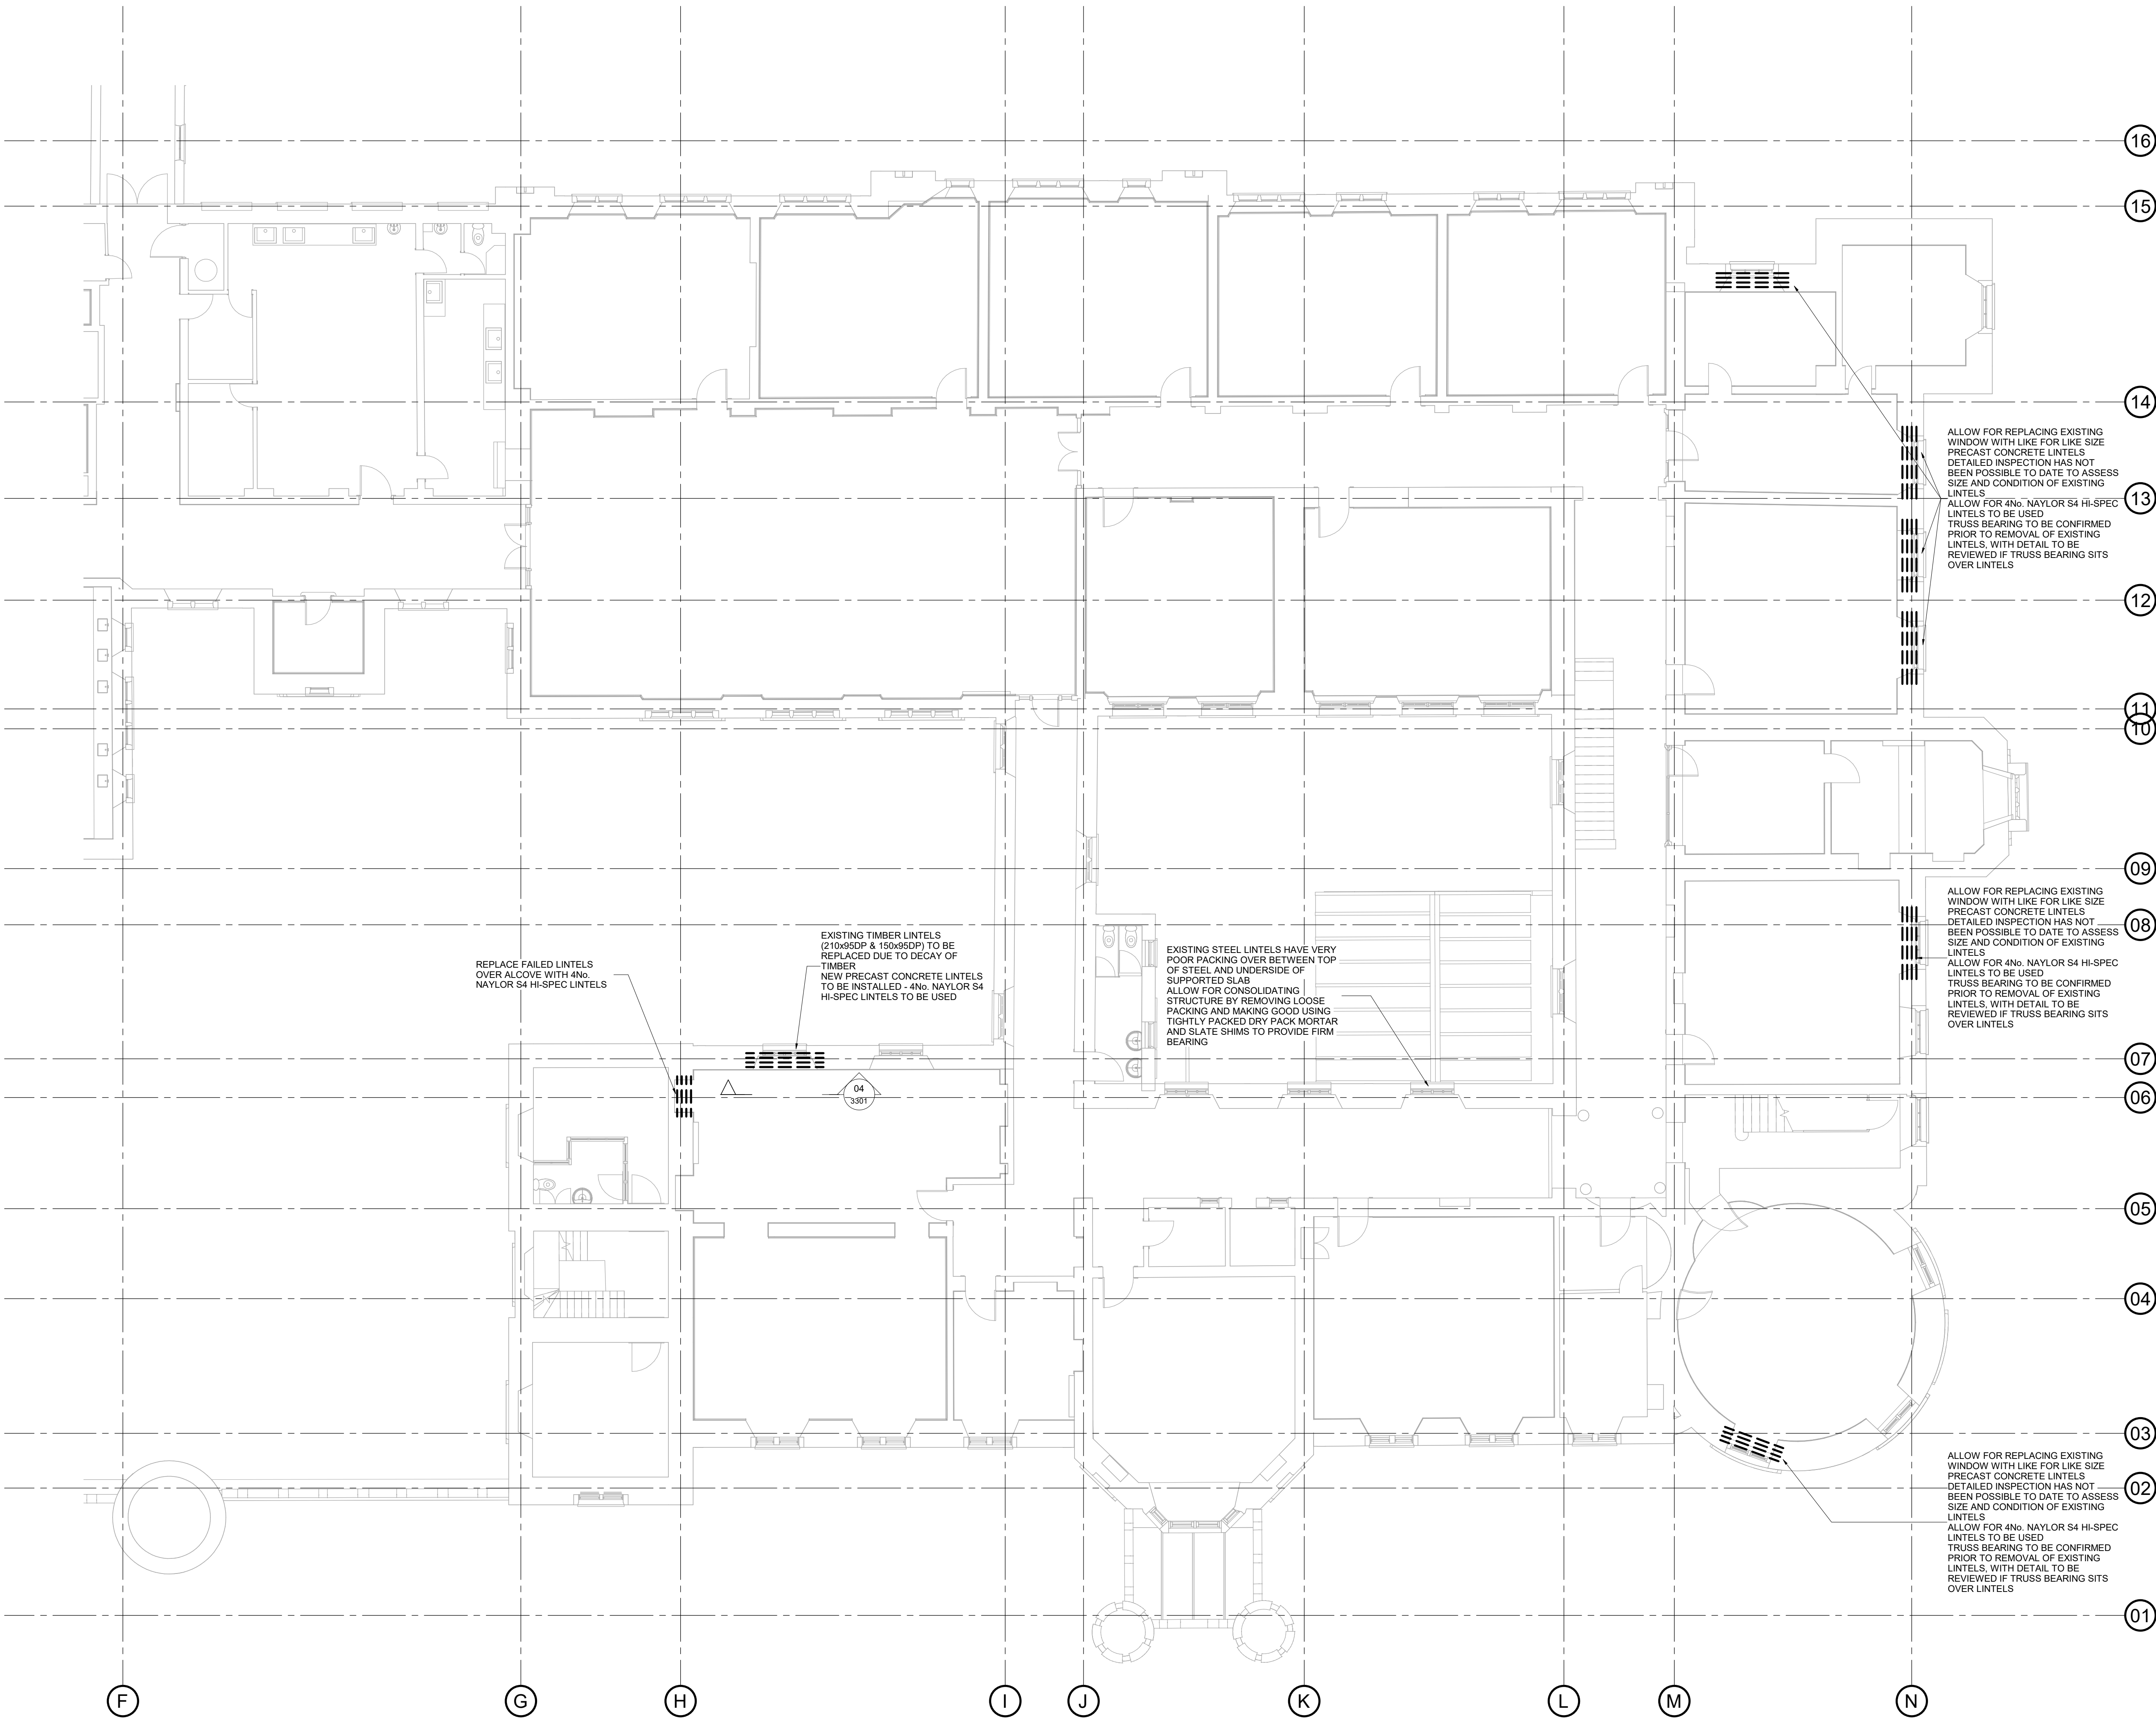

STATUS CODES FOR INFORMATION CONTAINERS WITHIN A COMMON DATA ENVIRONMENT IN ACCORDANCE WITH BS EN ISO 19650-2:2018	
CODE	DESCRIPTION
SHARED (NON-CONTRACTUAL - NOT FOR CONSTRUCTION)	
S1	SUITABLE FOR COORDINATION
S2	SUITABLE FOR INFORMATION
S3	SUITABLE FOR REVIEW AND COMMENT
S4	SUITABLE FOR STAGE REVIEW AND AUTHORIZATION
S5	SUITABLE FOR STAGE REVIEW AND ACCEPTANCE
PUBLISHED (CONTRACTUAL)	
A1	STAGE 1 AUTHORIZED (NOT FOR CONSTRUCTION)
A2	STAGE 2 AUTHORIZED (NOT FOR CONSTRUCTION)
A3	STAGE 3 AUTHORIZED (NOT FOR CONSTRUCTION)
A4	STAGE 4 AUTHORIZED (FOR CONSTRUCTION)
A5	STAGE 5 AUTHORIZED (FINAL DESIGN RECORD)


- NOTES**
- THIS DRAWING IS COPYRIGHT AND MAY NOT BE REPRODUCED WITHOUT THE PERMISSION OF MANN WILLIAMS.
 - ALL DRAWINGS ARE TO BE READ IN CONJUNCTION WITH THE PROJECT SPECIFICATION AND ALL WORK CARRIED OUT IN ACCORDANCE WITH THE LATEST BRITISH STANDARDS AND CODES OF PRACTICE.
 - ANY AMBIGUITIES OR DISCREPANCIES BETWEEN THIS DRAWING AND ANY OTHER INFORMATION GIVEN ELSEWHERE MUST BE REPORTED TO MANN WILLIAMS FOR REVIEW BEFORE WORK COMMENCES.
 - ALL DIMENSIONS TO BE CHECKED ON SITE AND ANY DISCREPANCIES REPORTED TO THE ENGINEER BEFORE ANY WORK COMMENCES.
 - ONLY FIGURED OR CALCULATED DIMENSIONS SHOULD BE USED AND NO DIMENSIONS IN ANY FORMAT SHOULD BE SCALED.

EMBEDDED STEEL/IRON

WHERE EMBEDDED STEEL OR IRONWORK HAS CORRODED AND CAUSED FRACTURING / SPALLING OF STONE WINDOW REVEALS, ALLOW FOR CUTTING OUT CORRODED STEEL AND SECTION OF SPALLED STONEMASONRY AND PINNING IN NEW STONE PIECE TO MATCH, USING 2No. M6 STAINLESS STEEL PINS - ALLOW FOR 5No. SUCH REPAIRS TO BE REVIEWED FOLLOWING ERECTION SCAFFOLDING

LINTEL REPLACEMENT

IN ADDITION TO THOSE NOTED ON PLAN ALLOW FOR 20% OF ALL WINDOW LINTELS TO BE REPLACED USING LIKE FOR LIKE SIZED PRE-CAST CONCRETE LINTELS (NAYLOR HI-SPEC OR EQUIVALENT APPROVED) DURING REPAIR WORKS TO WINDOW FRAMES, THE LINTELS SHOULD BE INVESTIGATED BY THE MAIN CONTRACTOR AND ANY WHICH SHOW SIGNS OF DECAY OR FAILURE SHOULD BE REPORTED TO THE STRUCTURAL ENGINEER FOR REVIEW PRIOR TO REPLACEMENT WHERE FRACTURES ARE IDENTIFIED IN EXTERNAL STONE LINTELS - ALLOW FOR STITCHING FRACTURES AS PER DETAIL 03/3301 ALLOW FOR FRACTURE STITCHING IN 10No. LOCATIONS - TO BE REVIEWED FOLLOWING ERECTION OF SCAFFOLD

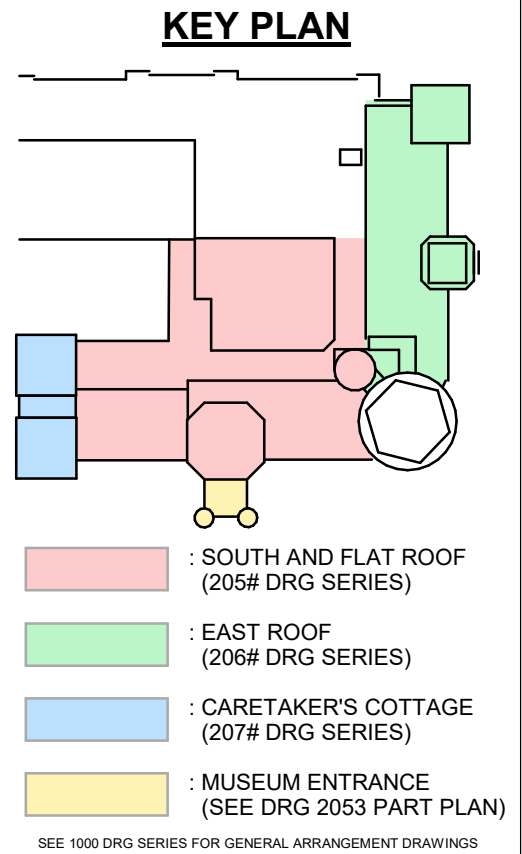

DRAWING TO BE READ IN COLOUR			
REV	DESCRIPTION	BY	DATE
P1	PRELIMINARY ISSUE	JL	22.08.2025
P2	PRELIMINARY ISSUE	JL	29.08.2025

PROJECT

**CYFARTHFA CASTLE
ROOF REPAIRS**

TITLE

**GENERAL ARRANGEMENT
PLAN**

**FIRST FLOOR
EAST**

MANN WILLIAMS
CONSULTING CIVIL AND
STRUCTURAL ENGINEERS

7 OLD KING STREET
QUEEN SQUARE
BATH BA1 2JW

T 01225 464419
E bath@mnnwilliams.com
W www.mannwilliams.co.uk

DRAWN	CHECKED	SIZE	SCALE	DATE	REV	DATE
JL	MAB	A1	1 : 100	AUG 2025	12803	

S2 : INFORMATION (NOT FOR CONSTRUCTION)					
ZONE/SYSTEM	LEVEL	TYPE	ROLE	ORIGINATOR	REVISION
XX	01	DR	S	MWB	
PROJECT CODE	NUMBER	REVISION			
12803	1101	P2			